



INSPECTION REPORT

46 Chestnut Grove Rd
Conestoga, PA 17516

Renee Weaver
05/06/2024



Inspector
Matthew Haughery

Matthew Haughery

ASHI, #267507
717-808-5997

Bill@PreciseInspecting.com



Agent
Renee Weaver
HK Keller

TABLE OF CONTENTS

1: Inspection Details	7
2: Roofing	9
3: Exterior	17
4: Interiors	27
5: Structural Components	42
6: Heating	49
7: Insulation and Ventilation	54
8: Plumbing	59
9: Electrical	74
10: Utility Locations and Shut-offs	88
11: Fireplaces and Fuel-Burning Appliances	89
12: Built-in Appliances	92
13: Scope and Limitations	99
14: Environmental Concerns	102
15: Checklist	103
Standards of Practice	105

NAVIGATING THE REPORT

Thank you for choosing **Precise Inspecting** to inspect your home! Please carefully read your entire Inspection Report. If you have any questions throughout the closing process please don't hesitate to ask. I am here to help make your home purchase as pleasant as possible. Happy reading!



OVERVIEW - This tab gives a quick summation of the areas inspected, not inspected, not present, or defective.

INFORMATION - This tab is the descriptive section of the report in which you will find all the general information required by the ASHI Standards of Practice. It includes all the general photos of the property, including roofs, attics, crawlspaces and any thermal images.

LIMITATIONS - This tab is an important section that highlights the areas of the home that could not be inspected because they were not visible or accessible at the time of inspection. Please read in full the limitations sections. In most instances, there are important recommendations that should be followed in order to protect you from unseen defects in the home.

STANDARDS - This tab consists of the ASHI Standards of Practice broken down by its general category.

It is important that you act on the defects, safety issues and recommendations of this entire report, including the Summary and the Limitations sections. Furthermore is important that you do this prior to the end of your inspection contingency period so that you can be fully aware of the nature and cause of the issues noted in this report. The evaluation by a professional may discover additional problems that are not visible at the time of the inspection and that require repairs. The opinions of these professionals are an important supplement to this report.

SUMMARY



MAINTENANCE



RECOMMENDATIONS











MATERIAL DEFECTS

SUMMARY




1) Material Defects - This category is composed of "material defects" as defined by the state of Pennsylvania. Specifically it refers to "a problem with a residential real property or any portion of it that would have a significant adverse impact on the value of the property or that involves an unreasonable risk to people on the property." They consist of systems, structures, or components that are broken, not working as intended, not installed properly, of immediate safety concern, or have a significant adverse impact on the property's value. **It is important that these items should be addressed by a qualified contractor prior to the end of your contingency agreement.**

2) Recommendations - Recommendations refer to components that are functional at the time of the inspection but require a qualified contractor to evaluate further, in order to determine life expectancy or if repairs or replacements are necessary. Also included in this category are mechanical and structural systems nearing the end of their useful life but still working. Items in this category may or may not be defective. I recommend that these items be addressed by a qualified contractor prior to the end of your contingency agreement.

3) Maintenance - These observations are primarily comprised of maintenance items and are provided in order to draw attention to items that need attention or repair by a professional before they develop into significant problems.

-  2.1.1 Roofing - Coverings: Tree(s) overhanging roof
-  2.1.2 Roofing - Coverings: Debris on roof
-  2.1.3 Roofing - Coverings: Biological growth, moderate
-  2.3.1 Roofing - Roof Drainage Systems: Gutter - Leaves and debris
-  2.5.1 Roofing - Skylights, Chimneys & Roof Penetrations: Chimney Cap missing
-  2.5.2 Roofing - Skylights, Chimneys & Roof Penetrations: Block pointing needed
-  3.3.1 Exterior - Porches, Balconies, Steps and Railings: Temporary support
-  3.3.2 Exterior - Porches, Balconies, Steps and Railings: Porch defects

- ⊖ 3.4.1 Exterior - Grading and Drainage: Grading - Low spot(s)
- ⊖ 3.5.1 Exterior - Siding: Loose siding
- ⚠ 3.7.1 Exterior - Service Entrance Conductors and Grounding: Frayed Sheathing
- ⚠ 3.7.2 Exterior - Service Entrance Conductors and Grounding: Meter base - Loose
- 🔧 3.13.1 Exterior - Exterior Paint: Peeling paint
- 🔧 3.14.1 Exterior - Vegetation: Vegetation in contact with structure
- 🔧 4.2.1 Interiors - Ceilings: Evidence of past moisture
- ⚠ 4.2.2 Interiors - Ceilings: Ceiling damage
- ⊖ 4.3.1 Interiors - Walls: Wall - Hole(s)
- 🔧 4.4.1 Interiors - Windows: Older vinyl windows
- ⚠ 4.5.1 Interiors - Floors: Damaged floorboards
- 🔧 4.6.1 Interiors - Doors: Door(s) - sticking
- ⊖ 4.10.1 Interiors - Steps, Stairways & Railings: Stair tread split
- ⊖ 5.4.1 Structural Components - Floor Structure: Split-jacks
- ⚠ 5.5.1 Structural Components - Foundation Structure: Moisture penetration
- ⚠ 6.3.1 Heating - Distribution Systems: Radiator(s) not working
- ⚠ 6.3.2 Heating - Distribution Systems: Corrosion at fittings
- ⊖ 7.1.1 Insulation and Ventilation - Insulation Unfinished Areas: Insulation - below current standards
- ⊖ 7.3.1 Insulation and Ventilation - Exhaust Systems: Radon - Test recommended
- ⊖ 7.3.2 Insulation and Ventilation - Exhaust Systems: Bath exhaust fan not working
- ⚠ 7.3.3 Insulation and Ventilation - Exhaust Systems: Dryer venting to attic
- ⚠ 8.2.1 Plumbing - Water Distribution lines: Active leak
- ⚠ 8.3.1 Plumbing - Toilets, Fixtures, Faucets: Urinal - no water
- ⊖ 8.4.1 Plumbing - Sinks, Tubs, Showers: Loose or missing grout
- 🔧 8.6.1 Plumbing - Water Heater: Hot water temp high
- ⊖ 9.2.1 Electrical - Main Distribution Panel: Shared neutral/ground wires
- ⚠ 9.2.2 Electrical - Main Distribution Panel: Improper Double tapped breaker(s)
- ⚠ 9.2.3 Electrical - Main Distribution Panel: Panel screws with pointed tips
- ⚠ 9.2.4 Electrical - Main Distribution Panel: Electric panel - Corrosion at main lug
- ⚠ 9.3.1 Electrical - Sub Panel: Sub panel incorrectly wired
- ⚠ 9.3.2 Electrical - Sub Panel: Double tap
- ⊖ 9.4.1 Electrical - Branch Wiring: Junction box cover(s) missing
- ⊖ 9.4.2 Electrical - Branch Wiring: Branch wiring not supported
- ⊖ 9.6.1 Electrical - Receptacles : GFCI outlet(s) protection missing
- ⚠ 9.6.2 Electrical - Receptacles : Receptacle not working
- ⊖ 9.6.3 Electrical - Receptacles : GFCI not tripping
- 🔧 9.6.4 Electrical - Receptacles : Receptacle - Cover Plate missing
- ⊖ 9.8.1 Electrical - Fire/CO Safety: Recommend replace all fire/CO safety devices
- ⚠ 11.1.1 Fireplaces and Fuel-Burning Appliances - Fireplaces, Stoves & Inserts: Damper not working
- ⊖ 12.1.1 Built-in Appliances - Dishwasher: Air gap missing
- ⚠ 12.3.1 Built-in Appliances - Garbage Disposal: Garbage Disposal Not Working

-  12.3.2 Built-in Appliances - Garbage Disposal: Active leak
-  12.5.1 Built-in Appliances - Cooktop: Burner(s) Not Working
-  12.7.1 Built-in Appliances - Washer/Dryer: 3-prong dryer outlet

1: INSPECTION DETAILS

Information

Front Elevation



Right Side Elevation



Left Side Elevation



Temperature and Weather

46 Chestnut Grove... @ 46 Chestnut Grove Rd, C...

TODAY

12PM	1PM	2PM	3PM	4PM	5PM
66°	68°	70°	72°	73°	74°
6%	0%	0%	0%	4%	0%

Cloudy

Feels Like 69° Humidity 81%

Wind 2 MPH WNW Cloud Cover 98%

Hourly 10 Day Alerts

Year built

1762

Square Footage

2475

Type

Detached, Single Family

In Attendance

Home Owner, Workmen

Style

Two-story, Farmhouse

Your home's life expectancy

[Home Material Life Expectancy](#)

Rear Elevation



Occupancy

Unfurnished, Unoccupied

Where the home is furnished there will be certain limitations to the home inspection. These limitations are spelled out in the [ASHI Standard of Practice](#) which provides the guide for this home inspection.

2: ROOFING

		IN	NI	NP	C
2.1	Coverings	X			X
2.2	Flashings	X			
2.3	Roof Drainage Systems	X			X
2.4	Venting	X			
2.5	Skylights, Chimneys & Roof Penetrations	X			X

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

Information


Coverings: Type

Asphalt architectural 30 yr

At the time of the inspection, it was not possible to determine the life expectancy of the entire roof because I was not able to determine 1) the roof material manufacturer, 2) the exact installation method, or 3) the date of installation. Climate and regular maintenance also affect longevity. In addition, some roofs with multiple coverings have been installed at different times meaning leaks can occur as the coverings age differently over time.

All of these are factors in determining a roof's life expectancy. It is important to have a qualified professional regularly inspect the roof in order to more accurately anticipate a roof replacement. I highly recommend you research the roof material of your roof in order to better determine its condition and serviceable life. This is the only way to obtain an accurate assessment of a roof's life expectancy.

How Long Does a Roof Last?

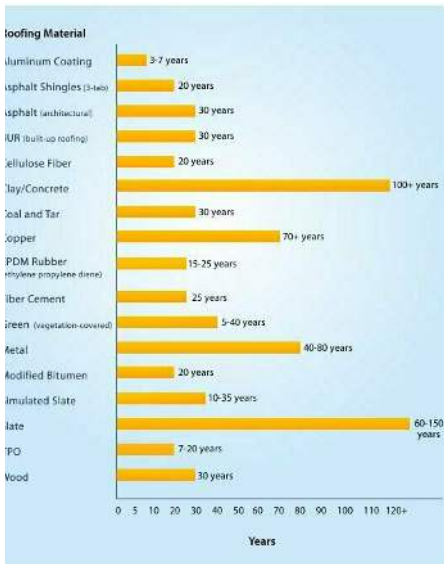

Clemens Home Solutions

Coverings: Roof inspection method

Walked roof

The inspector will make every effort to inspect all accessible roof surfaces and materials. The inspector is not required to access roofs that, in his judgment, are unsafe to traverse or may result in damage to the roofing materials (i.e. slate, tile, etc.)

In other cases, conditions on the day of inspection may make certain areas of the roof inaccessible, not visible, or obstructed from view. When these conditions are present the roof will not be fully inspected. Hidden damage may exist. In these cases, a qualified roofing contractor should evaluate the roof prior to settlement.

At times a drone can be used to visually inspect the roof. It is not required. The preferred method of inspecting a roof is to physically access the roof but if the roof is too steep or the materials are brittle and susceptible to breaking when walked on a drone may be used. While drones are good at accessing difficult-to-reach portions of the roof (like tops of chimneys) they are not able to feel brittle surfaces or spongy roof conditions. Drone photography falls outside the requirements of a home inspection and its inclusion has limitations as stated above. Where these limitations exist it is recommended that a licensed, professional roofing contractor be contacted to evaluate the overall condition of the roof prior to settlement.


Coverings: Roof Photos



Flashings: Material

Aluminium

At the time of the inspection the roof flashings appeared to be functional. Not all flashing is visible due to the siding and shingles that cover it. Any defects will be listed separately in the report.

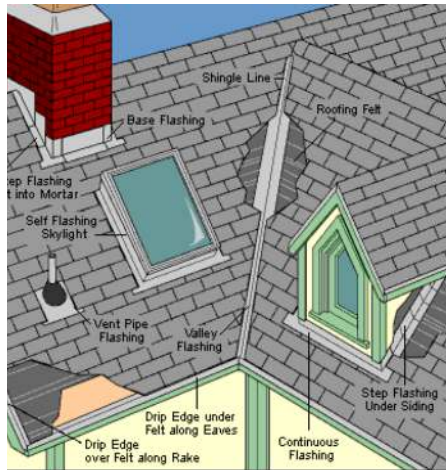


Various Types of Roof Flashing

Roof Drainage Systems: Gutter and Downspout material

K style, Aluminium


At the time of the inspection the gutter and downspouts appeared to be functional. I recommend periodic cleaning to maintain open flow of water.

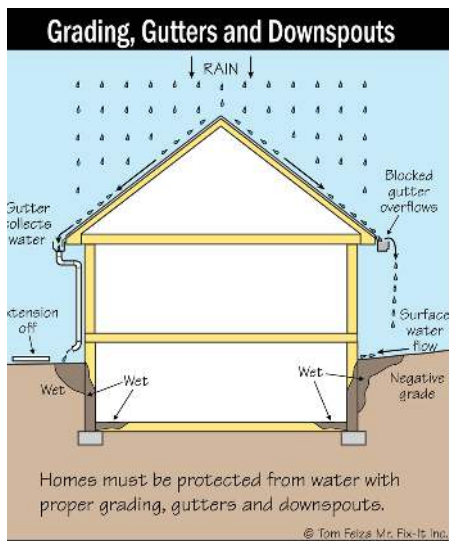

15BC

Venting: Type

Attic fan

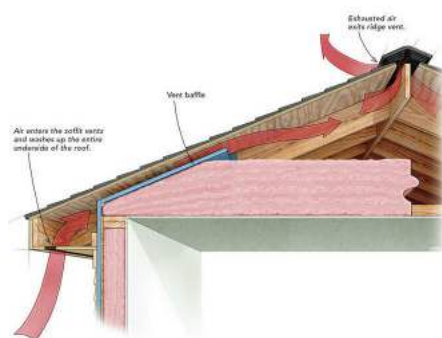

Ventilation Illustration



Skylights, Chimneys & Roof Penetrations: Roof Penetrations

Plumbing vent PVC

Rubber boots systems have a limited life expectancy and can fail without warning. I recommend a qualified professional to evaluate these connections yearly to check for deterioration and to replace before a roof leak develops.

Skylights, Chimneys & Roof Penetrations: Chimney Type

Brick chimney, Block chimney, W/ Parging

Masonry products, including stucco and adhered masonry, tend to absorb and hold moisture. This moisture will then dry inwards and can carry that moisture into the interior structure. I recommend periodic examination of the structure on the inside in order to verify that moisture intrusion is not occurring.



Front Chimney



Left Side Chimney



Right Side Chimney

Skylights, Chimneys & Roof Penetrations: Skylights

None

Skylights are popular architectural features in homes, on both flat (low-sloped) and sloped (steep) roofs. They may be single-, double- or triple-glazed, and they may have flat or curved glazing. Skylights may be installed on curbs, or they may be flush mounted. Most templates are manufactured units, but they also may be site-built.*

Older and less expensive skylights were often installed without a curb and step flashing. These skylights are often acrylic and sealed to the roof with a mastic/adhesive. Because this type of skylight cannot accommodate seasonal expansion and contraction, the mastic often fails and leaks result.

*See [Skylights](#)

Comments

2.1.1 Coverings



TREE(S) OVERHANGING ROOF

2 LOCATIONS

I observed a tree(s) whose branches were overhanging the roof. This condition is not healthy for roof life. Moisture, insects and biological growth are encouraged to remain on and around the roof surface. I recommend this growth be cut back.



Front



Rear

2.1.2 Coverings



DEBRIS ON ROOF

REAR ROOF

At the time of the inspection vegetation debris had collected on the roof. This condition allows for moisture to remain trapped close to the roof surface and can lead to early deterioration of the roof surface. I recommend removal.



2.1.3 Coverings

BIOLOGICAL GROWTH, MODERATE

REAR

I observed moderate amounts of biological growth on the roof. This is more than a cosmetic issue. As moss, lichen or algae builds up, moisture is held close to the roof surface which leads to a more rapid breakdown of the roof materials. I recommend a qualified professional to advise on cleaning the roof.

[Newly Restored](#)

 Recommendations



2.3.1 Roof Drainage Systems


GUTTER - LEAVES AND DEBRIS

REPRESENTATIVE LOCATIONS

Leaves and debris have accumulated in the gutter. If this is not removed at all locations, especially around downspout openings, water will back up and overflow. This may cause significant damage to the structure including the foundation. I recommend cleaning the gutters to facilitate effective water flow.

[Here is a DIY resource](#) for cleaning your gutters.

 Maintenance

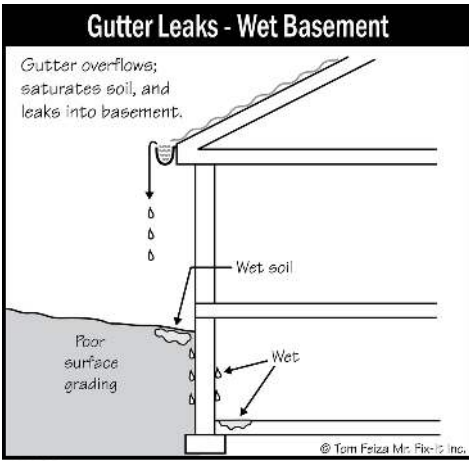

B065




2.5.1 Skylights, Chimneys & Roof Penetrations

Recommendations

CHIMNEY CAP MISSING

CHIMNEY 5 LOCATIONS

The chimney vent did not have a cap. The absence of a cap can lead to potential damage to the flue through moisture penetrating into the home. I recommend installing a properly sized cap.

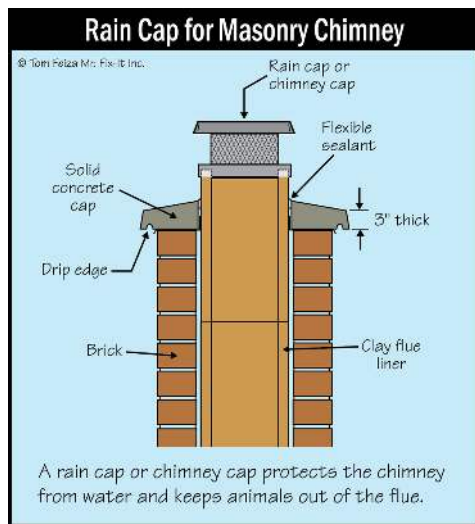

F030C



Front Chimney



Left Side Chimney



Right Side Chimney


2.5.2 Skylights, Chimneys & Roof Penetrations

 Recommendations


BLOCK POINTING NEEDED

LEFT SIDE CHIMNEY

The chimney block was in need of repair due to loose, crumbling or missing mortar and/or brick. This condition allows the chimney to deteriorate over time. I recommend this be evaluated by a masonry specialist for advice on repair.

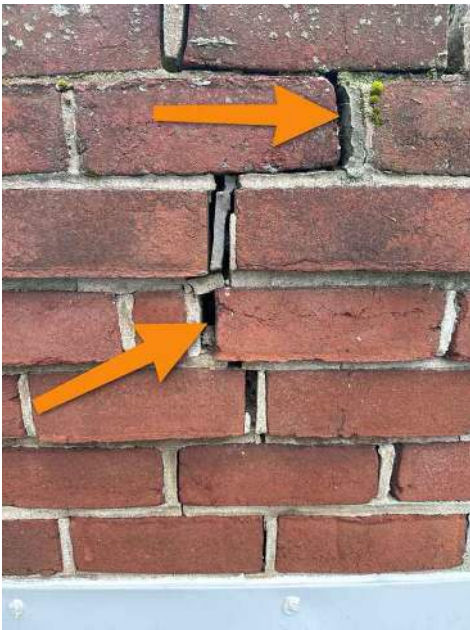

Close up

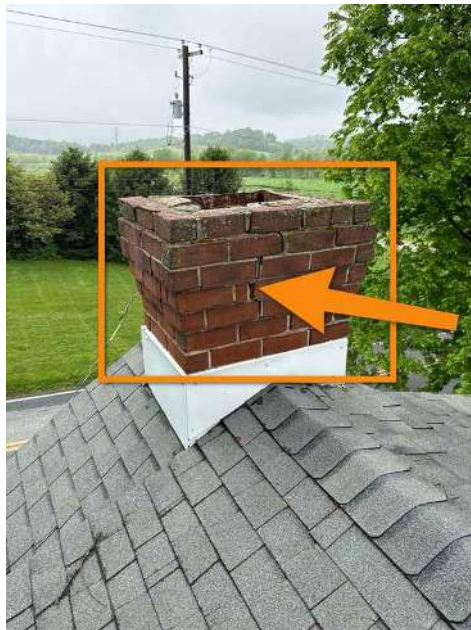

Brick repairs needed

3: EXTERIOR

		IN	NI	NP	C
3.1	Walkways	X			
3.2	Driveways	X			
3.3	Porches, Balconies, Steps and Railings	X			X
3.4	Grading and Drainage	X			X
3.5	Siding	X			X
3.6	Foundation Wall Exterior	X			
3.7	Service Entrance Conductors and Grounding	X			X
3.8	Exterior Doors	X			
3.9	Flashing & Trim	X			
3.10	Eaves, Soffits & Fascia	X			
3.11	Exterior Venting	X			
3.12	Exterior Hose Bibs			X	
3.13	Exterior Paint	X			X
3.14	Vegetation	X			X

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

Information

Walkways: Material

Slate

Driveways: Material

Asphalt

Porches, Balconies, Steps and Railings: Type

Front porch, Covered, w/ Steps,
Rear Porch, w/ Railing

Porches, Balconies, Steps and Railings: Material

Wood, Concrete

Siding: Material

Vinyl

Siding: Siding Style

German lap

Service Entrance Conductors and Grounding: Type and Voltage

150 amp

Exterior Hose Bibs: Type

No water supply

Out buildings

Buildings on site that are not attached to the home are not included in this home inspection unless paid for separately. Examples of such buildings: detached garages, barns, pool houses, sheds, gazebos, covered patios or similar structures.



Life expectancy of exterior components

Note: Life expectancy of exterior building materials varies with installation, maintenance, and quality of materials. The link below includes a general guideline for life expectancy for common building materials.

[Standard Estimated Life Expectancy Chart for Homes](#)

Grading and Drainage: Drainage Type


Exterior Foundation

Downspout to grade

The proper diverging of rain water away from the house is a crucial aspect of keeping foundations and basements dry. It is recommended that all surface drains be directed at least 4 feet away from the foundation any underground drainage pipes are not within the scope of this home inspection I recommend their non-visible sections and all outlets be investigated prior to settlement by a qualified professional.

Important note: the interior of downspouts and underground drains cannot be visually inspected and may contain hidden defects such as clogged gutters or holes not visible. I highly recommend a thorough inspection of the downspouts prior to settlement. Consider a video scope inspection.

Article on [Proper Drainage](#)

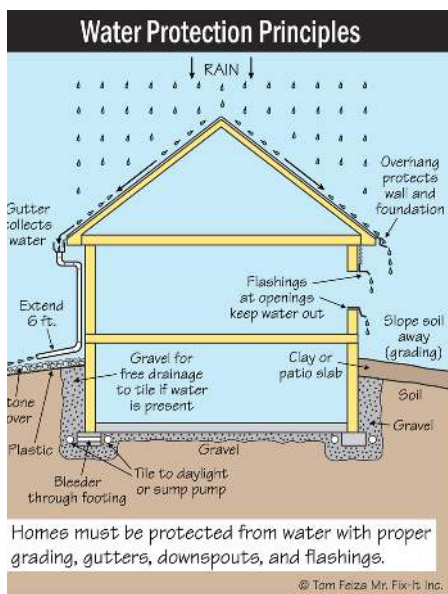

2310

Grading and Drainage: Direction

Neutral


Definitions:

Positive - At the time of the inspection, the grading around the house appeared to be sloped away from the house to allow for proper drainage of rainwater. Any specific recommendations will be mentioned in the report below.

Neutral - At the time of the inspection, I observed grading against the house that could potentially collect water and create an avenue for moisture to enter the home. Neutral grades should be inspected regularly in order to access if they are adequate in directing water away from the house. Any specific recommendation will be mentioned in the report below.

Negative - At the time of the inspection, I observed a negative grading against the house that could potentially collect water and create an avenue for moisture to enter the foundation. Negative grading should be addressed ASAP as damage to the structure can result quickly. Specific conditions and recommendations are mentioned in comments below.

Prevent basement water problems

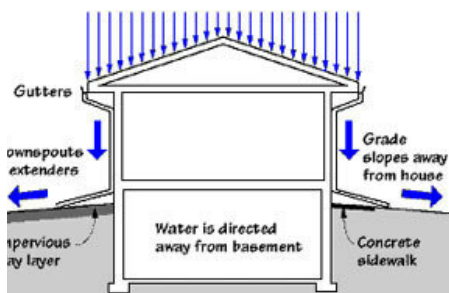


Foundation Wall Exterior: Type

Concrete, Stone, Parging

Foundation walls are an important structural component of a home. However they are vulnerable to water penetration at all times. It is important to know that not all walls perform the same with regards to moisture penetration into the basement or crawlspace. Even if a wall is structurally sound it may transfer moisture into the interior. Older hand laid stone walls can be very porous and will allow water to enter the interior space easily. Brick or concrete block walls are less porous but still are vulnerable to moisture penetration, especially during heavy rain. Poured concrete and Superior wall systems provide greater protection against moisture penetration but are still vulnerable.

Please note carefully the type of foundation wall system noted here. In all types care must be taken to regularly examine the exterior grading and roof spouting surrounding the foundation to avoid unnecessary water entering the basement or crawlspace.

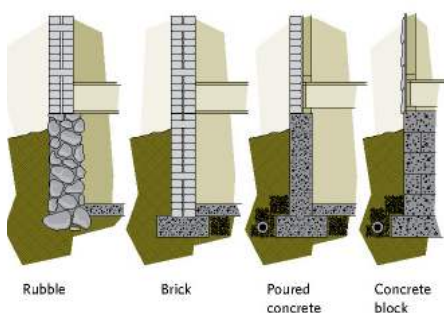


Most common in Pennsylvania

Service Entrance Conductors and Grounding: Entrance

Overhead

At the time of the inspection the service conductors appeared to be in good condition. Any defects will be listed separately in the report.

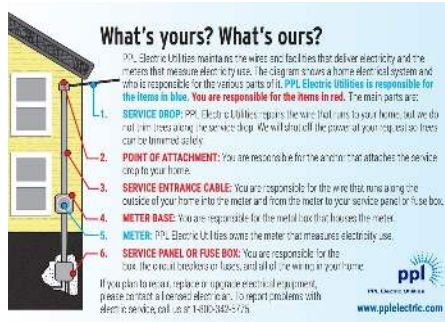

Utility Responsibility



Service Entrance Conductors and Grounding: Grounding method

Ground to Galvanized Steel

Grounding is a method of giving electricity the most effective way to return to the ground through the service panel. When the electricity is on, current flows from the panel to the outlet or device to power it up. The neutral wire is the return path for unused current. The ground wire is an additional path for electrical current to return safely to the ground without danger to anyone in the event of a short circuit.



Exterior Doors: Types

Single Swing

All exterior doors were inspected for proper functioning, safety, and any materials defects. Electric garage door openers were tested for safety features including either electronic eyes or pressure sensitive closures.

Exterior Doors: Material

Wood and glass

At the time of the inspection the exterior entry door appeared to be in good condition. Any recommendations will be listed separately in the report.

Flashing & Trim: Material


Aluminium, Wood

At the time of the inspection, the flashing and trim appeared to be in good condition. Any recommendations will be listed separately in the report.

Eaves, Soffits & Fascia: Material

Aluminium

The **eaves** are the edges of the roof which overhang the face of a wall and, normally, project beyond the side of a building. The eaves form an overhang to throw water clear of the walls. The **soffit** is the underside of the eave whereas the fascia is the outward-facing vertical portion. Under ideal circumstances, the air flow depicted in the diagram below should be present. If not you may want to consider upgrading the ventilation system. The **fascia** is the vertical face of the roof edge that covers the roof rafters. It is usually positioned behind the gutter.

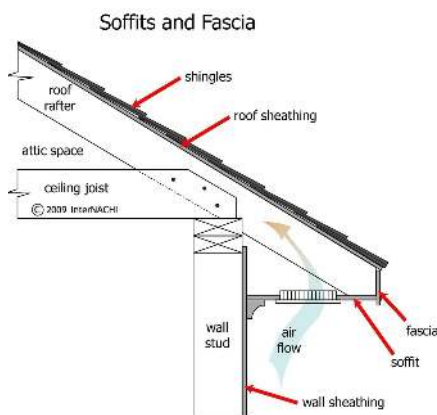

Ideal circumstances

Exterior Venting: Exterior dryer vent

The dryer vent allows for moisture and lint to exit the house. It should be regularly maintained. If not it can become a fire hazard*. In order to prevent a possible fire, I recommend periodic cleaning.

If the dryer vent cap was visible and within reach, I inspected the opening. If it was not visible or within reach (see limitation section), I recommend this be inspected prior to settlement and become part of regular home maintenance afterward.

See limitation comments in this section for further information.

*Dryer vent piping that becomes clogged is a leading cause of house fires.

[How to Clean Dryer Vents](#)



Exterior Paint: Lead Paint

****Safety Concern**** - Any home built before 1978 may have lead paint somewhere unless it was completely gutted and rebuilt. This is not an inspection for lead based paint. See note under environmental concerns.

Vegetation: Trees and shrubs

Present and partially maintained

A home inspection includes making an assessment of vegetation that comes into contact with the home. Plants and branches, even at full growth, should be kept 12-18 inches away from house siding, roof, and windows. Keep the trees and their roots away from the foundation. Plants or trees in contact or in close proximity to the home can provide pathways for wood destroying insects to enter the house and can damage the exterior walls, windows, roofs, and foundations.

Article on [landscaping](#) and your house

Limitations

Foundation Wall Exterior

FOUNDATION WALL NOT COMPLETELY VISIBLE

At the time of inspection the foundation wall was not completely visible from the exterior. Hidden damage may exist. I recommend a qualified professional to evaluate the condition of the exterior foundation wall at this location.

Comments

3.3.1 Porches, Balconies, Steps and Railings

TEMPORARY SUPPORT

FRONT PORCH

At the time of inspection I observed the use of temporary post support used to support the porch. These are an inferior means of supporting the structure because they are considered temporary. I recommend a qualified professional to evaluate and replace.

 


3.3.2 Porches, Balconies, Steps and Railings

PORCH DEFECTS

REAR PORCH

At the time of the inspection, I observed multiple areas of the porch that were deteriorating, worn or not constructed according to best porch standards. These may result in a safety issue or signal an early failure of the deck. See pictures for specific defects. I recommend a qualified professional to evaluate the entire porch and make recommendations for repair or replacement.



Post settlement due to rot



Railing balusters missing



Stair railings and balusters missing

3.4.1 Grading and Drainage

GRADING - LOW SPOT(S)

FRONT LEFT SIDE



At the time of the inspection there was a potential low spot(s) around the foundation wall. The depressed area(s) creates a pathway for water to enter the home causing water damage. I recommend this area(s) be evaluated and re-graded to avoid this potential entry point.



3.5.1 Siding

LOOSE SIDING

LEFT SIDE

At the time of the inspection the siding was loose in one or more locations. Loose siding is vulnerable to high winds and moisture can penetrate these locations. I recommend a qualified professional to evaluate and repair the siding.



Recommendations



3.7.1 Service Entrance Conductors and Grounding

FRAYED SHEATHING

SERVICE ENTRANCE CABLE

Wires on the service entrance are beginning to fray. This can leave the power conductors exposed and vulnerable to damage. I recommend contacting your electric utility company or a qualified electrician to evaluate and repair.



Material Defects



Close up



Jacket worn and frayed

3.7.2 Service Entrance Conductors and Grounding

 Material Defects

METER BASE - LOOSE

METER BASE

At the time of the inspection the service meter box was loosely connected to the house. This presents a safety hazard and also creates a pathway for moisture to enter the house. I recommend a professional to secure the meter base firmly.



Not attached to House

3.13.1 Exterior Paint

PEELING PAINT

REPRESENTATIVE WINDOW

At the time of the inspection the painted exterior surfaces showed signs of peeling/blistering and exposure to weather in numerous locations. I recommend all the exposed surfaces be evaluated and maintained on a regular basis.

 Maintenance



Close up



Peeling paint on some windows

3.14.1 Vegetation

VEGETATION IN CONTACT WITH STRUCTURE

REAR PORCH

Vegetation is overgrown in one or more places around the house. This creates a potential path for insects and moisture to enter the home and can damage the structure of the house. I recommend that all plants, shrubs and trees be trimmed back 12-18" from house.



Maintenance



4: INTERIORS

		IN	NI	NP	C
4.1	Interior Photos	X			
4.2	Ceilings	X			X
4.3	Walls	X			X
4.4	Windows	X			X
4.5	Floors	X			X
4.6	Doors	X			X
4.7	Countertops & Cabinets	X			
4.8	Paint	X			
4.9	Interior trim	X			
4.10	Steps, Stairways & Railings	X			X

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

Information

Ceilings: Ceiling Material

Drywall, Plaster

Floors: Floor Covering

Softwood, Vinyl laminate, Carpet,
Tile

Countertops & Cabinets:

Cabinetry Material
Wood

Countertops & Cabinets:

Countertop Material

Laminate

Interior areas not inspected

****Important Note**** At the time of inspection there were areas such as, but not limited to, walls, ceilings, floors, mechanical components, plumbing fixtures, slabs and other parts of the home that **were not inspected because access and visibility was limited**. See [ASHI SOP Sec.13](#). Prior to settlement and after the area is made accessible Precise Inspecting will return to inspect the area for a fee.

Interior components


Throughout

During the home inspection a representative sample of multiple components will be inspected. The inspector will make every effort to observe all visible components and comment on them, however not every window, door, switch, outlet, valve or faucet will be checked. Furthermore, where stored items, furniture and equipment are present visibility is limited to what can be seen without moving items. As a result, certain components cannot be inspected. It may be prudent to return for a re-inspection after these items are removed.


Interior Photos: 1st Floor Photos
Photos






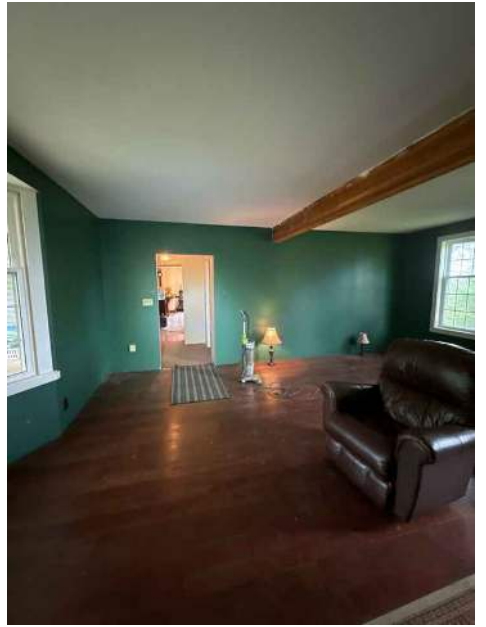


Interior Photos: 2nd Floor Photos
Photos

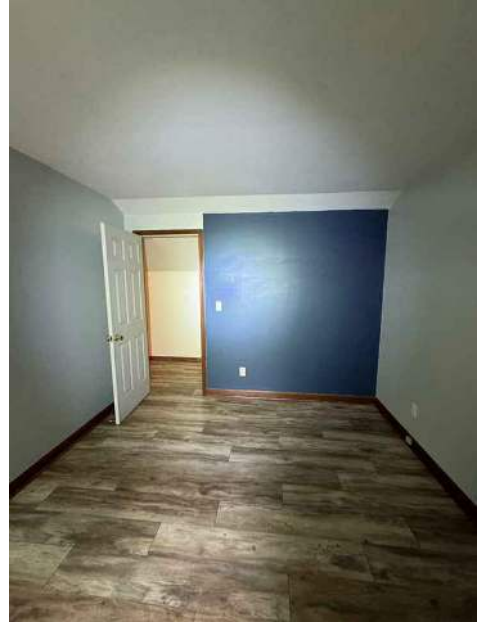


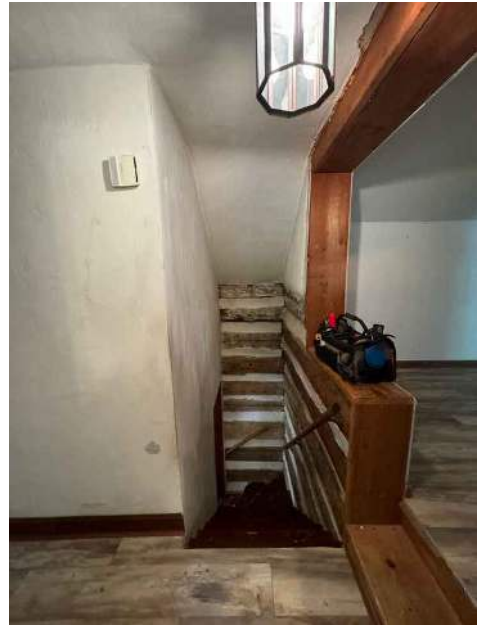




Interior Photos: Basement
Photos

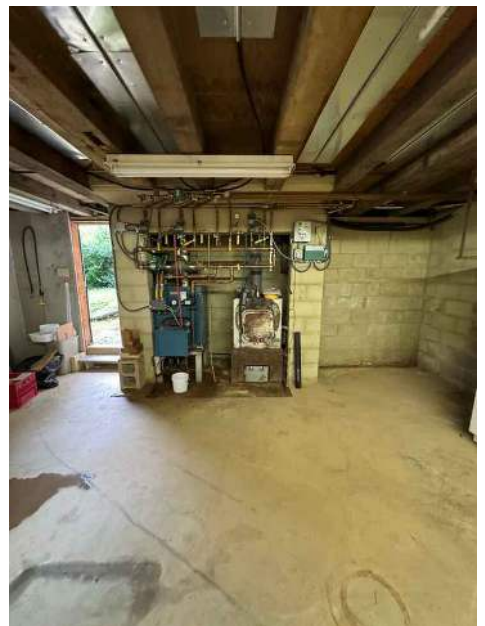

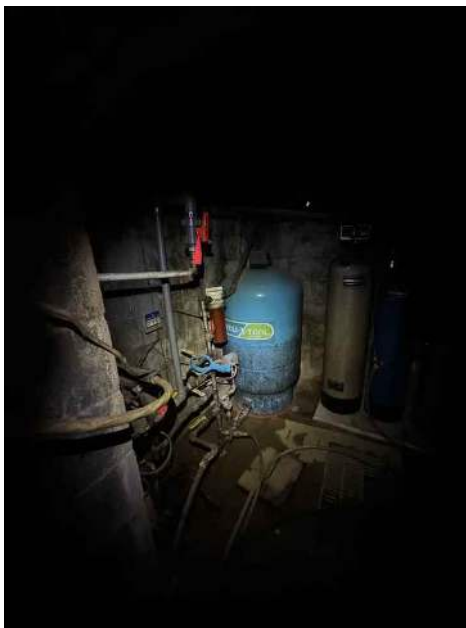

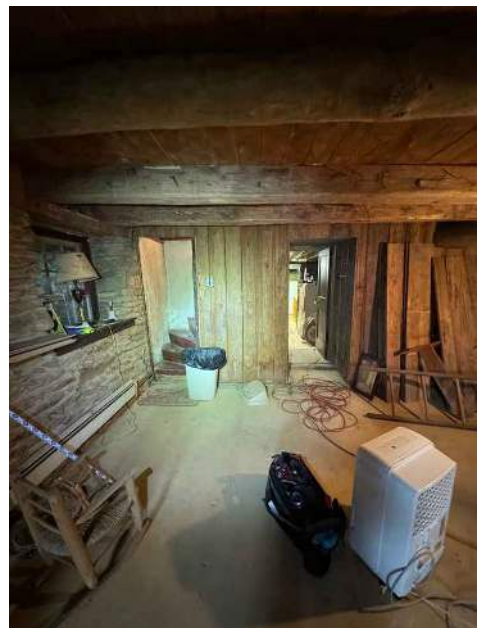



Walls: Wall Material


Drywall, Plaster, Log and chinking

At the time of the inspection the walls appeared to be in good condition. Any defects will be listed separately in the report.

Windows: Window material

Vinyl, Wood

The life expectancy of windows can be 20-40 years depending upon materials, climate conditions and manufacturer. See charts of averages below.

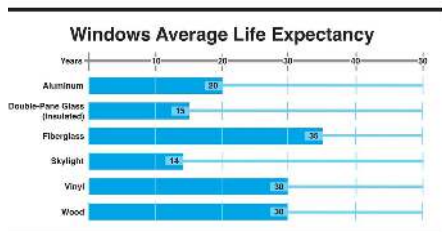

Averages

Windows: Window Type

Thermal, Sliders, Double-hung

At the time of the inspection the windows appeared to be in good condition. Any defects will be listed separately in the report. Any storm windows present were not inspected as they are not included in an ASHI home inspection.

Doors: Type

Solid wood panel, Hollow core panel, Bi-pass

At the time of the inspection the interior doors appeared to be in good condition. Any recommendations will be listed separately in the report.

Paint: Lead Paint

Various possible locations

Any home built before 1978 may have lead paint somewhere unless it was completely gutted and rebuilt. This is not an inspection for lead based paint. See note under environmental concerns.

Limitations

Windows

STORM WINDOWS AND SCREENS NOT INSPECTED

The inspection of storm windows and window screens are not included in an ASHI home inspection. See the ASHI Standards of practice in this section marked "Standards".

Doors

STORM DOORS NOT INSPECTED

The inspection of storm doors are not included in an ASHI home inspection. See the ASHI Standards of practice in this section marked "Standards".

Comments

4.2.1 Ceilings



EVIDENCE OF PAST MOISTURE

1ST FLOOR BATHROOM

I observed a section of the ceiling with evidence of past moisture penetration. There was no moisture evident at the time of the inspection and the area appeared to be dry. I recommend monitoring the spot for any evidence of any future moisture. If moisture occurs, take immediate action to repair.



Close up



Plaster crumbled

4.2.2 Ceilings



CEILING DAMAGE

FRONT RIGHT SIDE BASEMENT

I observed ceiling damage. The area(s) pictured should be repaired. See photo description. I recommend a qualified professional to evaluate and make appropriate repairs.

NOTE: It appears that moisture from the vicinity of the front porch has migrated to this ceiling causing damage.



Insulation panels falling down

4.3.1 Walls

WALL - HOLE(S)

FRONT MIDDLE BEDROOM

At the time of the inspection I observed one or more hole(s) in the wall. This area should be repaired by a qualified professional.

 Recommendations



4.4.1 Windows

OLDER VINYL WINDOWS

13 WINDOWS

 Maintenance

The home had older vinyl windows that are showing signs of age. As vinyl windows age they exhibit one or more of the following defects:

- stiff sash mechanisms
- failed thermal seals
- deteriorated glazing
- broken or missing hardware.

The National Association of Certified Home Inspectors reports that the predicted life expectancy of vinyl/aluminum windows can be 20-40 years depending upon climate conditions, the window manufacturer, and quality of installation.

I recommend a qualified professional to evaluate the condition of all the windows and make recommendations. You may want to consider budgeting for replacement.



4.5.1 Floors

DAMAGED FLOORBOARDS

REAR BASEMENT

I observed damaged floorboards. I recommended a qualify, professional evaluate and repair.



Floorboards deteriorated



Close up

4.6.1 Doors

DOOR(S) - STICKING

2ND FLOOR FRONT LEFT SIDE BEDROOM

I observed a door(s) that was sticking. It was difficult to open and close. I recommend a professional to make adjustments so that it operates smoothly.





4.10.1 Steps, Stairways & Railings

STAIR TREAD SPLIT

2ND FLOOR STAIRS

 Recommendations

At the time of inspection I observed one or more stair treads that were split. This could present a safety hazard. I recommend a qualified professional to evaluate and repair.



Top stair



Bottom stair

5: STRUCTURAL COMPONENTS

		IN	NI	NP	C
5.1	Attic, Roof and Ceiling Structure	X			
5.2	Wall and Ceiling Structure	X			
5.3	Basement	X			
5.4	Floor Structure	X			X
5.5	Foundation Structure	X			X

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

Information

Attic, Roof and Ceiling Structure:

Attic structure and material

Dimensional wood, Wood plank, Plywood

Wall and Ceiling Structure:

Material

Wood

Floor Structure: Material

Wood Beam, Plank, Steel columns, Steel Beam



Foundation Structure: Type

Full basement

Old Home

Older homes like this one are a challenge to inspect and report on. Building techniques and materials are not uniform. In the era that the house was built there was little consideration for energy conservation and were few code requirements and architectural disciplines for residential buildings. Yet these older homes paved the way for some of the conveniences and architectural considerations we take for granted today. I inspect these older homes considering their age and what we know of the building practices at the time. I focus on structural integrity for continued longevity, items that are costly to repair or replace, and factors that affect the occupant's safety. Elements that get less scrutiny than new homes include things like wavy walls, springy floors, squeaky floors, out of plumb or square walls, door and floors, plumbing fittings, installation techniques, venting and insulation, etc. Some things that might be considered defects in new homes are listed as maintenance items here. The point is; I inspect these homes not by today's standards but for what they are relative to their period.


Attic, Roof and Ceiling Structure: Inspection Method

Attic

Attic entered, Knee wall entered

I made a good faith effort to inspect the attic and its structural components (framing, sheathing, and insulation). An inspector is not required to traverse attic load-bearing components that are concealed by insulation or by other materials or to enter areas that are only accessible through an opening less than 16" x 24".

Attic, Roof and Ceiling Structure: Attic Photos

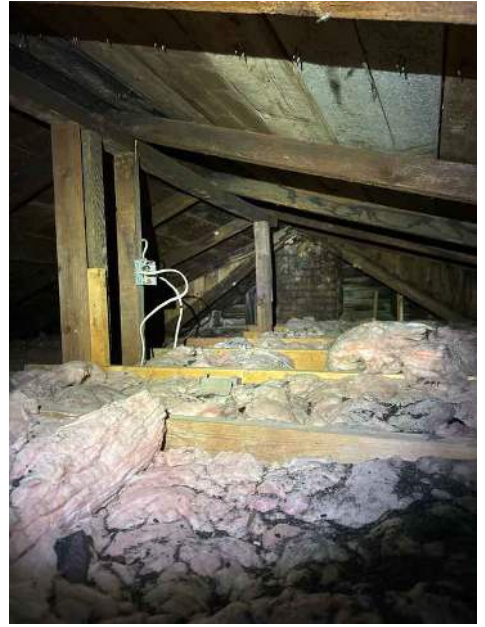

Attic, Roof and Ceiling Structure: Knee Wall Photos



Front



Rear



Rear

Wall and Ceiling Structure: Wall framing inaccessible.

Overall


Walls appeared to be constructed properly, however, the materials used could not be inspected because of interior and exterior coverings. Hidden damage may exist.

Basement: Basements

Basement

Maintaining your basement is the single most important homeowner responsibility. You will want to correct and maintain grading, gutters, downspouts, sump pump discharge and all sources of surface water.

For **safety** reasons, all basement level living spaces should have 2 exits or means of egress. In the event of a fire or other emergency, this allows two escape routes. In some situations, a large window can provide this exit. If you plan on using a basement level as living space you should check with your local fire department for safety precautions.

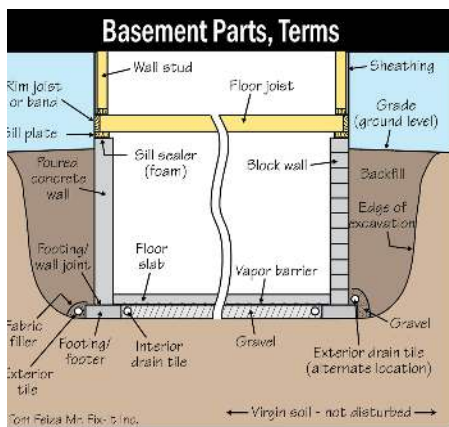


107C

Foundation Structure: Material

Masonry block, Stone

At the time of the inspection the structure of the home appeared to be in good condition. Any defects will be mentioned specifically in the report. It should be noted that stone, brick and concrete block foundations are considered "porous" and will easily allow moisture to pass for the outside to the inside. This is an informational comment. If moisture is visible at the time of inspection it will be noted in a separate comment below with photos.

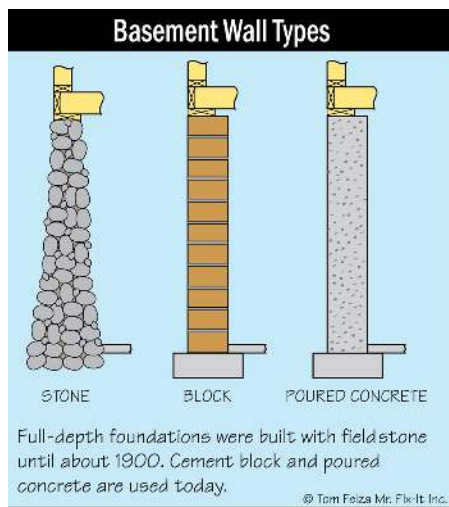

157C

Limitations

Attic, Roof and Ceiling Structure

ATTIC, ACCESS LIMITED

ATTICS AND KNEE WALLS

Access to some parts or all of the attic above the ceiling and knee walls was limited (cathedral ceilings would be one example). As a result, I was not able to fully inspect this area. Hidden material defects may exist including moisture issues. For further information on the limitations of inspecting attics with limited access see [ASHI SOP](#)

Basement

BASEMENT, LIMITED OR NO ACCESS

BASEMENT

Basements are one of the most vulnerable areas of a home or property for several reasons.

1. It's proximity to moisture from both the outside and inside.
2. Important mechanical components are located here such as electrical, HVAC, and especially plumbing.
3. The location of critical structural components.

Although every effort is made to thoroughly inspect the basement, when access is limited or none nonexistent a thorough inspection cannot be made. Some examples would be:

1. Areas blocked by stored items.
2. Generally cluttered conditions.
3. Wall and ceiling coverings including suspended ceilings.
4. Insulation
5. Areas out of reach with limited visibility.

Hidden damage may exist. It is recommended that arrangements be made for access prior to settlement so that a qualified professional can inspect these areas.

Floor Structure

VIEW OF FLOOR STRUCTURE LIMITED OR INACCESSIBLE

When, at the time of the inspection, most or all of the floor structure in the home is inaccessible a complete inspection of the floor structure is not possible. Hidden damage may exist. Some examples are:

1. Slab on grade construction.
2. Ceiling and wall coverings.
3. Inaccessible rooms or crawlspaces.
4. Stored items that obstruct views.

It is recommended that arrangements be made for access prior to settlement so that a qualified professional can inspect these areas.

Foundation Structure

LIMITED OR NO VISIBILITY

Not all of the main structural components of the property's foundation were visible at the time of inspection. A General Home Inspection does not include an evaluation of structural components that are hidden. This includes areas behind insulation, floor, wall, and ceiling coverings or where access is restricted because of stored items. An inspector is not required to enter areas where opening are small or that he deems to be unsafe. Where these conditions are present hidden damage may exist that requires a separate inspection by a qualified professional.

Comments

5.4.1 Floor Structure

SPLIT-JACKS


BASEMENT



At the time of the inspection, I found one or more split-jack posts that were being used to support the main structural components of the home. These support posts were not approved for permanent use in supporting main beams in structures. When used, they represent a temporary support system. I recommend a qualified professional to evaluate and replace.

Some split jacks comply with FHA/HUD specifications, but not all. There must be a label specifying that it complies.

Problems with Split Jacks

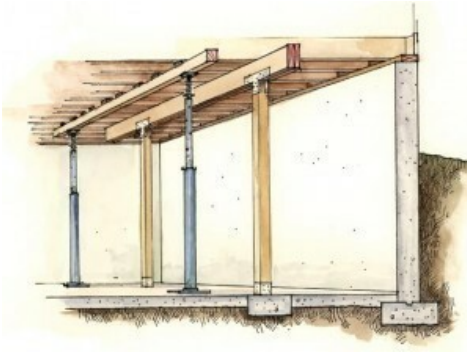

Proper replacement for split jacks



5.5.1 Foundation Structure

MOISTURE PENETRATION

FRONT BASEMENT

Moisture appeared to be entering the foundation. See photos. Most moisture problems originate on the exterior. If the source is not identified, this moisture can cause significant damage. I recommend the exterior be evaluated in order to determine where the water is coming from and so repairs can be made to stop future water penetration.



Material Defects



Mud on floor



Mudflow across floor

6: HEATING

		IN	NI	NP	C
6.1	Heat System	X			
6.2	Heating Equipment	X			
6.3	Distribution Systems	X			X
6.4	Vents, Flues & Chimneys	X			
6.5	Combustion air for fossil fuel utilities	X			

IN = Inspected NI = Not Inspected NP = Not Present C = Comments


Information

Heating Equipment: Heating Unit
Oil

Distribution Systems:
Ductwork/Piping Material
Copper baseboard, Radiant floor heat

Distribution Systems: Filter Type
Oil cannister

Vents, Flues & Chimneys: Type
Metal to masonry

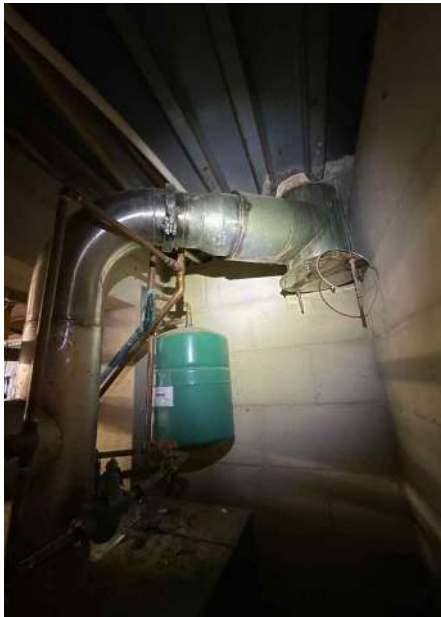

Heat System: Oil Boiler


Basement

The home had an oil boiler heat system. Boilers are special-purpose water heaters that distribute the heat in hot water through radiators or other devices and into rooms throughout the house. The cooler water then returns to the boiler to be reheated. Hot water systems are often called hydronic systems. Residential boilers generally use natural gas or heating oil for fuel.

The average expectancy of a traditional oil boiler is between 15 and 25 years if you keep it well maintained and have it serviced annually. A superior quality boiler, that is the most expensive available, can be maintained so that it lasts for 30+ years or more.

Recommendation - a oil boiler is a complex heating system that requires regular maintenance. Important parts of the system cannot be checked in a visual home inspection. I highly recommend you engage a qualified profession contractor to more thoroughly inspect and service this system upon settlement.

[When is it time to replace your furnace?](#)

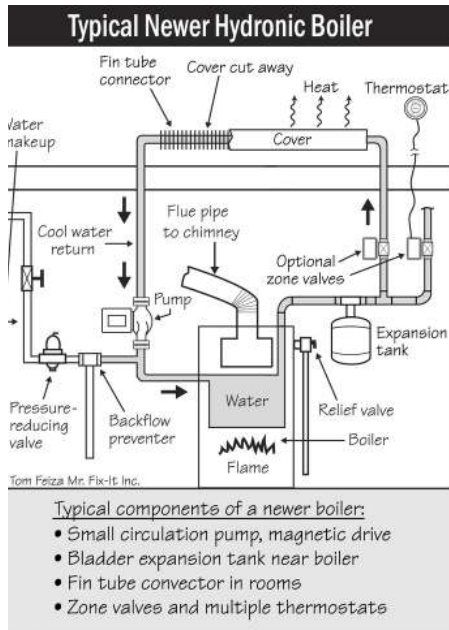

069

Heating Equipment: Age

2002

Furnace age

In cases where the age of the furnace cannot be determined I recommend having an evaluation done by a professional in order to determine the condition of the furnace prior to settlement.



Heating Equipment: Fossil fuel shut off

Present

An electric power emergency-shutoff switch for fossil fuel units should be located in the living space and away from the furnace. This switch is best located at the top of the basement stairs or in the nearby living space, however local municipalities allow for this switch to be located beside the furnace as well.

Heating Equipment: Venting and exhaust type

Interior air intake, Galvanized pipe to chimney

Direct exhaust sends combustion air out of the home. Intake air brings air into the heating system either from the outside or from the inside depending upon the type of system.

Heating Equipment: HVAC maintenance

Important: Heating systems are complex and have many components and they are in need of regular evaluation, repair and replacement in order for the systems to function efficiently. Filters should be changed regularly according to manufactures recommendations. During a home inspection a visual inspection of the heating system is made to confirm its functionality on the day of inspection. Many of the interior, non-visible parts can not be checked. I highly recommend a professional HVAC technician inspect this system prior to settlement or immediately after taking possession, in order to determine the future life expectancy of the system.

Distribution Systems: Distribution Type

Hot water baseboard, Radiant hot water



Baseboard



Radiant floor

Combustion air for fossil fuel utilities: Combustion air

Sufficient

Combustion appliances require 50 cubic feet per 1000 BTU/h aggregate input. "Aggregate" means that if two combustion appliances such as a gas-fired furnace and a gas-fired water heater are installed in the same room, each of their input ratings in BTU/h must be included when calculating adequate combustion air.

[Combustion Air Calculator](#)

Comments

6.3.1 Distribution Systems

RADIATOR(S) NOT WORKING

LEFT SIDE BASEMENT

At the time of the inspection, one or more radiators appeared not to be delivering heat through the system. I initiated readily accessible switches and thermostats, and other radiators were working and the heating system was operational. I recommend a qualified professional to evaluate to determine if this (these) radiator(s) can be repaired or replaced.



Material Defects



6.3.2 Distribution Systems

CORROSION AT FITTINGS

AT BOILER

At the time of the inspection I found corrosion at the fittings of the heat distribution piping. If not repaired this could develop into a leak. I recommend a qualified HVAC contractor to repair.



Material Defects



Close up



Calcification on fitting

7: INSULATION AND VENTILATION

		IN	NI	NP	C
7.1	Insulation Unfinished Areas	X			X
7.2	Attic Ventilation	X			
7.3	Exhaust Systems	X			X
7.4	Vapor Barriers		X		

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

Information

Insulation Unfinished Areas: Type

Fiberglass roll



Attic maintenance

Attic

All attic areas should be reviewed at least twice per year to ensure ventilation openings are clear and to ensure the development of mold is kept in check. Even if there is very little or no evidence of mold build-up in the attic at the time of inspection, it can reproduce and spread rapidly should conditions allow it to. Mold can be potentially hazardous and will spread when moisture enters the attic cavity and is not vented to the exterior. Any area of suspected mold should be reviewed by a qualified contractor for analysis and removal.

Attic Ventilation : Attic Ventilation Types

Thermostatically Controlled Fan

Whenever possible, attics should have ventilation openings high (exhaust) on the ridge and low on the eave (intake). Rising warm air moves from the eaves to the ridge.

Exhaust Systems: Exhaust systems type

Bath Fan, Dryer vent

An inspection of all visible exhaust fans and ducting was made. In cases where the exhaust system is inside walls, covered with insulation or otherwise not visible these components will not be inspected. Hidden damage may exist and a thorough inspection by a qualified professional is recommended.

Exhaust Systems: Ducting material

Not completely visible, Semi-rigid

Ducting material is a key component in moving harmful moisture from the home to the outside. The quality of the material used for this ductwork is important. See more info on [Ducting Material](#) as referenced in the picture below.



Types of exhaust ducting

Exhaust Systems: Radon mitigation system


If the home has a radon mitigation system installed this inspection falls outside the ASHI Standards of Practice, however Precise Inspecting can perform a 24 point mitigation system inspection as recommended by the Pennsylvania EPA for an additional fee.

IMPORTANT - The Environmental Protection Agency recommends radon testing every 2 years for homes that have an installed radon mitigation system present and every 5 years in homes that do not have a mitigation system but have levels below 4.0 Pci/l.

I recommend a PA DEP licensed professional perform a radon test in each separate structural zone per PA DEP guidelines. This test can be performed by [Precise Inspecting](#). We are licensed radon measurement specialists. If high levels of radon exist, mitigation should be performed by a separate licensed radon mitigation company.

PA DEP requires one radon test per [structural zone](#)

Please Read: [EPA's Home Buyers and Sellers Guide to Radon](#)

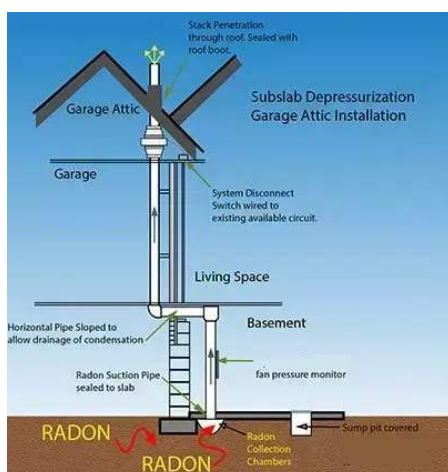

Typical system diagram

Exhaust Systems: Radon Mitigation System

Native

The inspector will identify whether an active, passive or native radon system is in place. An inspection of the system itself is not part of the ASHI home inspection SOP.

Passive refers to a pipe installed below the concrete and vented upwards and out of the house. This does not function as a radon gas removal system. **Active** refers to an active working Radon Mitigation system that is complete with an active fan. **Native** refers to no radon system of any kind present. **It is highly recommended by the EPA to retest radon levels in a home with an existing system every 2 years.**

See Home Buyers and Sellers Guide to Radon

<https://www.epa.gov/sites/production/files/2015-05/documents/hmbuygud.pdf>

Vapor Barriers: Vapor barrier in attic unknown

At the time of the inspection I could not determine if there was a vapor barrier separating the attic from the finished space below. A vapor barrier retards the transfer of moisture and gases into the house.

Limitations

General

INSULATION WILL NOT BE DISTURBED

ATTIC, WALLS, CEILINGS AND BASEMENTS

The visible insulation of the home will be inspected but not disturbed as per the ASHI Standards Of Practice. There may be hidden defects. In-depth inspection of the insulation and areas behind or beneath it should be evaluated by an insulating company or general contractor.

Attic Ventilation

VENTILATION MINIMAL

At the time of the inspection the attic ventilation was minimal. This can result in:

- excessive heat build up in the attic
- significantly reduce the life of the roof shingles.
- allow for excessive mold build up that can result in mold growth.
- cause the 2nd or 3rd floor of the home to be much hotter in the summer months even with air conditioning.

I recommend the attic space be evaluated to determine the cost effectiveness of installing soffit and ridge ventilation to increase air flow especially if a new roof material is installed. Old roof materials like slate or wood shingle tend to breathe better than newer materials and may not need the same type of ventilation. It should be understood that old roof structure makes for unusual challenges in meeting new home construction standards.

Comments


7.1.1 Insulation Unfinished Areas

INSULATION - BELOW CURRENT STANDARDS

ATTIC



At the time of the inspection, the R-value of the insulation in the attic was below current standards. See photo. New construction calls for R-49. Energy savings can be captured by bringing the R-value up to today's standards. I recommend a qualified insulation contractor or DIY install additional insulation where possible.

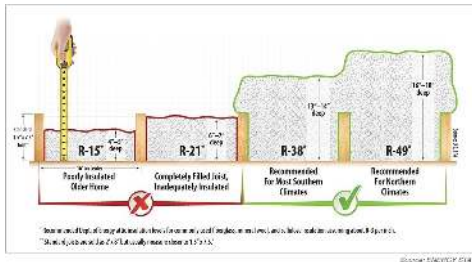

Illustration



7.3.1 Exhaust Systems

RADON - TEST RECOMMENDED

BASEMENT

****Potential Health Hazard**** At the time of inspection a radon test was not performed. Radon is a class A carcinogen and the second leading cause of lung cancer in the USA. Not knowing your radon levels can be hazardous to your health.

The Environmental Protection Agency recommends radon testing


- every 2 years for homes that have an installed radon mitigation system and
- every 5 years in homes that do not have a mitigation system but have levels below 4.0 Pci/l.

I recommend a PA DEP licensed professional perform a radon test in each separate structural zone per PA DEP guidelines. This test can be performed by [Precise Inspecting](#). We are licensed radon measurement specialists. If high levels of radon exist, mitigation should be performed by a separate licensed radon mitigation company.

PA DEP requires one radon test per [structural zone](#)

Please Read: [EPA's Home Buyers and Sellers Guide to Radon](#)



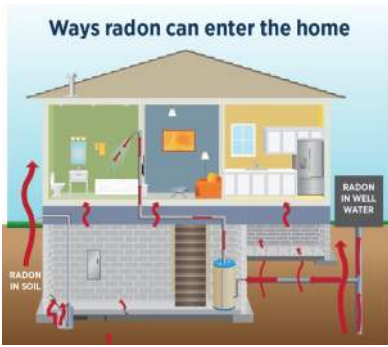

- FLOOR-WALL JOINTS
- FLOOR CRACK AND CRAWL SPACE
- SUMP PIT
- SHOWER WELL WATER



Radon entry points

7.3.2 Exhaust Systems

BATH EXHAUST FAN NOT WORKING

2ND FLOOR HALL BATHROOM

At the time of the inspection the bath exhaust fan was not working. This may indicate that the motor has reached the end of its serviceable life or that there is an electrical problem. I recommend a professional evaluate and repair or replace.

Recommendations



7.3.3 Exhaust Systems

DRYER VENTING TO ATTIC

HALL BATHROOM SHOWER

At the time of the inspection, I found the dryer venting into the attic. A clothes dryer will vent about a gallon of water for each load of laundry. If the dryer vent discharges into an attic, or another building cavity, the potential for moisture-related damage is significant. I recommend a qualified professional evaluate and redirect the dryer venting.

Material Defects



8: PLUMBING

		IN	NI	NP	C
8.1	Water Supply	X			
8.2	Water Distribution lines	X			X
8.3	Toilets, Fixtures, Faucets	X			X
8.4	Sinks, Tubs, Showers	X			X
8.5	Drain, Waste, & Vent Systems	X			
8.6	Water Heater	X			X
8.7	Vents, Flues, & Chimneys	X			
8.8	Sump Pumps	X			
8.9	Fuel Supply, Storage & Distribution Systems	X			

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

Information

Water Heater: Capacity

Tankless, Domestic

Water Heater: Cold water supply valve

Present

Water Heater: Power Source

Oil

Water Supply: Main Water Supply Source

Well

The water supply appeared to be originating from this identified source however I recommend checking with the local municipality and the home owner in order to verify.

Water Supply: Main Water Pressure Regulator

At Main Water Meter

Not installed

A **water pressure regulator** is a specialized type of valve that reduces the incoming water pressure to a manageable level for the home plumbing infrastructure. Water pressure regulators are typically installed where the main water line enters the home, just after the main shutoff valve.


If the water pressure is too high, it can cause significant damage to the valves, faucets, appliances, pipes, and plumbing fittings. Water pressure regulators reduce stress on inner seals and connections within the water supply lines. This includes the inner workings of appliances like dishwashers, clothes washers, ice makers and more.

Most home plumbing fixtures are designed to work best at a pressure of about 50 psi (pounds per square inch), but it is not uncommon for municipal water supplies to enter the home with pressures as high as 150 or 200 psi. If such high pressure is present on a regular basis, the strain can eventually cause joints to fail, faucets and other fixtures to leak, and appliances to break down.

A qualified plumber can be consulted to determine if one should be installed (if one does not already exist).

For more information:

[Water Pressure Regulators](#)

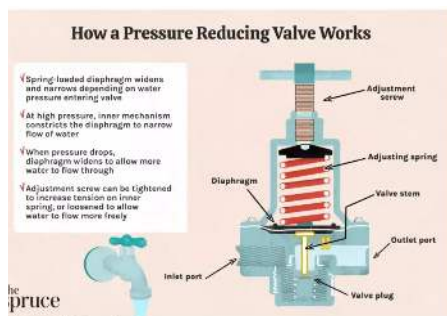

Illustration

Water Supply: Main Water Supply Material

Black plastic

Underground pipes or pipes inside walls cannot be judged for type of material, size, leaks, corrosion or other defects. Hidden damage may exist. I recommend these lines be evaluated by a licensed professional.

Water Supply: Private well

Basement

A private well is a water source that gets you water directly from the earth. To get access to this water source underground, a hole is drilled all the way down to the aquifer which is a permeable layer of rock that contains water. Typical well depths can range from 25-400 feet. Well pumps can either be submersed at the bottom of the well or located above ground. A typical submerged well pump can last 10-15 years. Once the hole reaches that layer of rock, a pump system is installed and connected to the plumbing of your house.


Well water quality is the responsibility of the homeowner to maintain.

Pros: No water bill, healthy source of water (typically no chemicals), control where your water is coming from.

Cons: Uses electricity (to pump water), may contain bacteria, Nitrates etc., wells can go dry or be disturbed by nearby construction.

Components of a well:

- **Well** — A hole dug in the ground to reach the water below the surface.
- **Well pump** — A device that brings water to the surface.
- **Service pipe** — The pipe that carries water between the well and a pressure tank.
- **Main shut-off valve** — The shut-off valve is exactly what it sounds like and is located between the well and pressure tank.
- **Pressure or storage tank** — The tank holds H₂O and is usually located on the lower level of the house or basement. It can also be stored inside a reservoir called a vault.
- **Pressure switch** — A private well system must have a pressure switch that automatically starts and stops the pump at predetermined pressures. Pressures above 60 psi (pounds per square inch) can harm your supply pipe.
- **Pressure gauge** — The pressure gauge, which displays a readout of pressure in the tank, might be located near or on the tank itself.

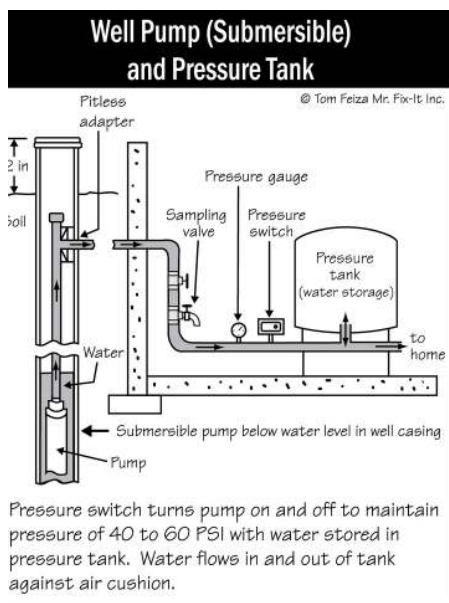

055

Well illustration



Water Supply: Secondary water source

None

The secondary water supply appeared to be originating from this identified source however I recommend this be verified by a qualified professional.

Water Supply: Water Testing Recommendations

Water testing and water treatment equipment was not evaluated as a part of this home inspection unless requested as an additional service. If there are any smells, deposits or quality issues noticed during your inspection, you should have the water tested or evaluated by a specialist. This would also include water treatment equipment.

All private well systems must be routinely maintained and tested for safety. If you have a well system that is used for watering grass only, your local municipality may still require routine checks. All well systems must be actively used or properly abandoned. Consult a professional in these systems for more information.

Water Supply: Auxilliary Water Systems

Sediment Filter, Water Softener

The presence and functionality of auxiliary water systems and are not part of this home inspection's standards of practice and were not evaluated. These systems require periodic maintenance. I recommend a complete evaluation by a licensed water treatment contractor.



Water Supply: Water Sensor Alarms

Consider installing water sensor alarms in areas susceptible to water damage due to plumbing leaks or pump failures (e.g. water heaters, boilers, sump baskets, clothes washers, dishwashers, and HVAC condensate drains). For more information on this topic, click here: [Automatic water leak protection](#)

Water Distribution lines: Water Distribution lines

Copper, Pex, CPVC

Visible water lines with unobstructed views were inspected. Many water lines are hidden in walls and/or inaccessible. These water lines may have damage that is hidden. I recommend a thorough inspection by a licensed professional prior to settlement.

Drain, Waste, & Vent Systems: DWV Type

Basement

See limitations, PVC

An inspection industry's standard drainage test for "functional drainage"* was performed on the drainage system.

The drain pipes appear operational at the time of inspection. I was not able to inspect drain lines that were hidden, nor was I able to confirm the condition of the inside of all drain lines. Hidden damage may exist. Only an invasive inspection or video-scope of the interior of the drain lines can fully confirm their actual condition.

****Caution**** Cast iron typically rusts from the inside out therefore its condition cannot be fully determined by a visual home inspection. Leakage that was not present or visible at the time of the inspection may occur when the home is occupied and water usage increases.


1. If usage (volume of waste water) of these drain lines increases when a new owner moves in, leaks can develop that were not present at the time of inspection.
2. If a home is vacant for several months or more, the inside of the cast iron can dry out and become detached from the drain wall. When water is introduced back into the drain lines the dry cast iron pieces can become detached from the drain line walls and clog the system.

Because of this, and other factors associated with cast iron, I recommend a qualified professional to inspect the cast iron lines prior to settlement and to consider a video scope.

Further problems may exist in homes that

- are vacant
- have older plumbing systems
- that have had past drain problems
- or have large trees on the grounds
- consult the seller for detailed information on these lines

**functional drainage means a drain is functional when it empties in a reasonable amount of time and does not overflow when another fixture is drained simultaneously.*

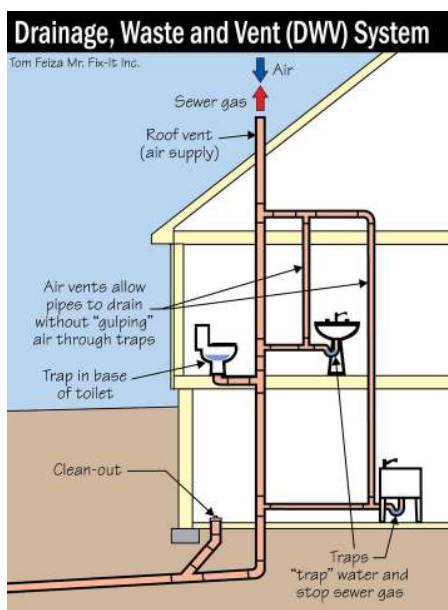

016

Drain, Waste and Vent systems

Drain, Waste, & Vent Systems: Sewer Line is not inspected

Basement

Inspection of the sewer line in the following areas is not within the scope of a home inspection (please see the Scope and Limitations section at the beginning of this report).

- behind walls
- beyond the foundation wall
- below the basement slab

Sewer lines, especially cast iron, clay tile or Orange-burg lateral lines, should be inspected regularly in order to ensure no obstructions are present.

I inspected the visible cast iron drain lines in the home's drain system. Some of these lines may be hidden behind walls or under floors or in crawlspaces. Cast iron typically rusts from the inside out therefore its condition cannot be fully determined by a visual home inspection. Leakage that was not present or visible at the time of the inspection may occur when the home is occupied and water usage increases.

1. If usage (volume of waste water) of these drain lines increases when a new owner moves in, leaks can develop that were not present at the time of inspection.
2. If a home is vacant for 6 months or more, the inside of the cast iron can dry out and become detached from the drain wall. When water is introduced back into the drain lines the dry cast iron pieces can become detached from the drain line walls and clog the system.

Because of this, and other factors associated with cast iron, I recommend a qualified professional to inspect the cast iron lines prior to settlement and to consider a video scope of the entire line all the way to the public connection.

Common Cast Iron Pipe Problems

I highly recommend a video inspection of the main sewer line (from the house to the street) be done by a qualified professional, using professional equipment, prior to settlement.


Sewer Inspections




Middle Basement



Rear Right Side Basement

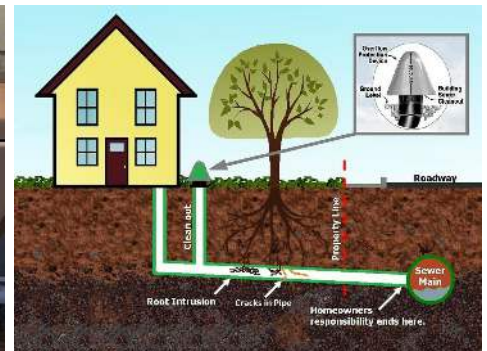

Typical public septic

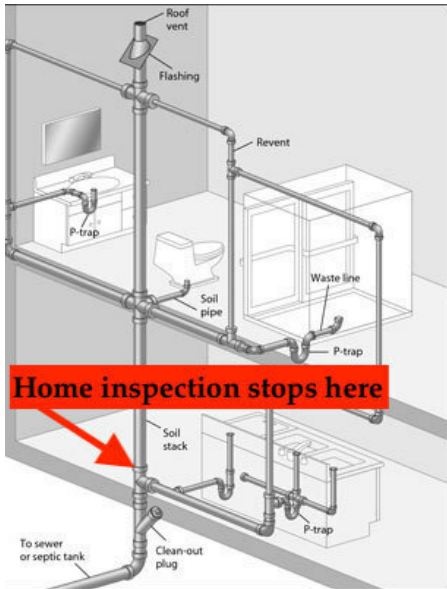

Home owner is responsible for soil line from house to street

Water Heater: Water temperature degree

140° +

It is recommended that residential water temperature be kept between 120F-130F to avoid scalding. In addition, if water temperature is too low it can be a health hazard due to bacteria. Please take the temperature noted in this report under advisement and contact a qualified professional to evaluate and adjust if necessary.

[Water Temperature Settings](#)



Water Heater: Age

2002

Based on the manufacturer's suggested service life, the life expectancy of a gas water heater is about 8 to 14 years and an electric water heater is 10-18 years. I recommend having a qualified professional evaluate the condition of the water heater to best determine its life expectancy.


Average Life of Water Heater



Water Heater: Expansion tank

Present

A pressurized expansion tank is a sealed cylinder divided by a flexible diaphragm. An expansion tank provides space for the water to expand as it is heated and assists in keeping the water pressure in the normal pressure range while the water heater is operating. These have been required in certain areas for new installations or replacement since 2012.

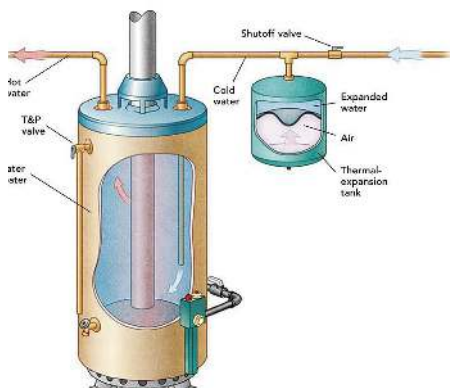

Water Heater: TPR valve

At water heater

Present, Adequate


The TPR valve's job is to vent off excess pressure when water pressure is greater than 150 PSI or water temperature exceeds 210 degrees Fahrenheit. When the valve opens it discharges scalding hot water through the overflow tube. Your homeowner's insurance may cover water damage but that may be negated if the policy requires a licensed plumber to install a water heater, as many policies do.

Furthermore water heater warranties of many manufacturers will be voided if the installation is not done by a licensed plumber. Water heater manufacturers require the installing plumber's license number to register the product warranty. For safety reasons, It is recommended that the installation of this water heater be verified with the seller prior to settlement.

Water Heater: Domestic hot water

At Furnace

The hot water to the home was served through the boiler. This is considered a domestic system. The hot water is heated by the boiler and distributed to the fixtures. Normally by way of copper piping. As long as the boiler is working the hot water should be delivered consistently to the home.

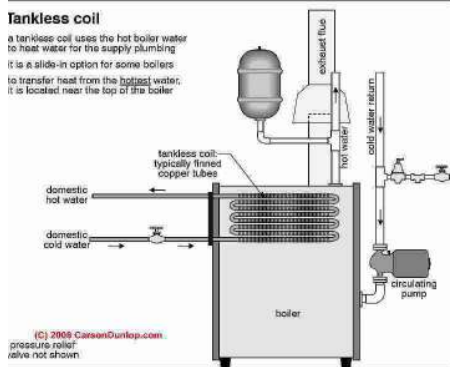

Domestic Hot Water System



Vents, Flues, & Chimneys: Type

Metal and masonry


At the time of the inspection the vent, flue and chimney appeared to be in good condition. Any defects will be listed separately in the report.

Sump Pumps: General

Working

The inspector will report on the condition of a sump pump or sewer ejector present that is readily accessible. He will not open sump or sewage ejector covers that are sealed or bolted shut. He will attempt to operate the sump pump and/or sewage ejector to determine if it is functional at the time of inspection and report the results. If no water is in the sump pit and the pump motor works I recommend a qualified professional to test the motor with water in the pit. Specific visible defects will be commented in this report. The pictures provided below are for informational use.

Sump pump maintenance

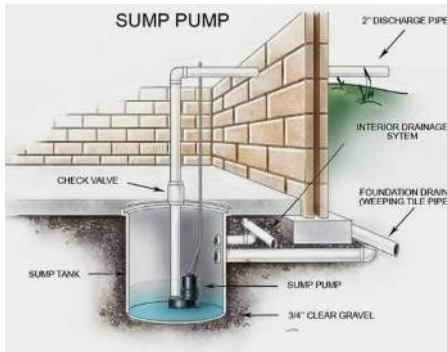

Fuel Supply, Storage & Distribution Systems: Fuel Distribution

Copper

The inspector will call out the type of fuel supply piping. If the system is not properly bonded a comment will be made in this section of the report.

Fuel Supply, Storage & Distribution Systems: Fuel Storage/Supply

Oil Tank, Underground

The condition of the interior gas lines, oil tanks and their supply lines, propane tanks and their supply lines or other forms of fuel storage and supply are not part of the home inspection and was not evaluated.

Limitations

Water Supply

HIDDEN LINES NOT INSPECTED

WHOLE HOUSE

Water distribution, drain, and vent lines that are underground, hidden behind walls or in floors are not visible and will not be inspected.

Water Supply

PLUMBING SYSTEM

The plumbing system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Access panels to plumbing areas were not removed and the inspection was only visual. Any valves or piping not visually accessible were not inspected. For example, bathroom plumbing connections behind fastened access panels were not inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used for your further inspection or repair issues as it relates to the comments in this inspection report.

Water Supply

WELL

If the home was equipped with an on-site well the ASHI Standards of Practice do not include the inspection of a well it's supply, pressure or operation. Since a well is the main source of water for the home it is an important component. I recommend consulting a professional to evaluate and service this component.

If you would like water testing or well flow test Precise Inspecting can perform these tests.

Water Distribution lines

IRRIGATION SYSTEMS

The inspection of an irrigation system, if present, is out of the scope of a home inspection and is not required by the ASHI inspections Standards of Practice.

Water Distribution lines

INACCESSIBLE PIPES AND DRAINS

****Important Note**** At the time of the inspection, some of the water supply lines and drain lines were inaccessible due to stored items and/or wall and ceiling coverings. Especially in areas under sinks and in basement ceilings and crawl spaces. The inspector made an effort to inspect these drains and water lines without moving household items or fixed components. It was not possible to inspect these lines and hidden damage may exist.

Drain, Waste, & Vent Systems

CAST IRON DRAIN CAUTIONBASEMENT

Where visible and invisible cast iron drain lines are present in the home's drain system they present a potential problem. These drains are older and may be hidden behind walls or under floors or in crawlspace.

Cast iron typically rusts from the inside out therefore its condition cannot be fully determined by a visual home inspection. Leakage that was not present or visible at the time of the inspection may occur when the home is occupied and water usage increases.

1. If usage (volume of waste water) of these drain lines increases when a new owner moves in, leaks can develop that were not present at the time of inspection.
2. If a home is vacant for 6 months or more, the inside of the cast iron can dry out and become detached from the drain wall. When water is introduced back into the drain lines the dry cast iron pieces can become detached from the drain line walls and clog the system.

Because of this, and other factors associated with cast iron, I recommend a qualified professional to inspect the cast iron lines prior to settlement and to consider a video scope of the entire line all the way to the public connection.

[Common Cast Iron Pipe Problems](#)

Drain, Waste, & Vent Systems

PRIVATE SEPTIC SYSTEMS

Private waste systems should always be pumped and inspected by a specialist prior to home purchase. As a minimum, the internal tank components, vents, pumps, piping and the drainage system should be evaluated. You should ask the owner for the maintenance records for routine pumping and inspection. The system should have been pumped at least every other year. You can obtain information on septic systems from the state, DNR, County and City health officials.

Fuel Supply, Storage & Distribution Systems

UNDERGROUND OIL TANK

Present

The presence or absence of an abandoned or underground oil tank is beyond the scope of this inspection. If there is an abandoned tank or signs that one is buried underground I recommend speaking with the seller about its location or having a qualified professional locate and inspect this tank prior to settlement.

Fuel Supply, Storage & Distribution Systems

UNDERGROUND OIL TANK

FRONT LEFT SIDE

At the time of inspection I observed that the oil tank was underground. Underground oil tanks like this, are not part of the home inspection. I recommend a qualified professional evaluate if it exists and if it has been abandoned correctly.



Comments

8.2.1 Water Distribution lines

ACTIVE LEAK

AT BOILER

At the time of the inspection, I observed an active leak in a water line. If not repaired this can cause significant damage. I recommend a qualified professional to evaluate and repair.



Close up



Domestic line leaking

8.3.1 Toilets, Fixtures, Faucets

URINAL - NO WATER

BASEMENT

I observed a urinal that did not have water running to it. A qualified plumber should evaluate and repair.





8.4.1 Sinks, Tubs, Showers

LOOSE OR MISSING GROUT

2ND FLOOR BATHROOM

I found portions of tile grout that was loose or missing. I recommend a qualified professional to repair with grout or caulk.

 Recommendations



Close up



Grout repair needed


8.6.1 Water Heater

HOT WATER TEMP HIGH

REPRESENTATIVE SINK

 Maintenance

**** Safety issue**** I observed that the hot water supply temperature was too high. This can lead to scalding and burns. I recommend reducing the hot water temperature.

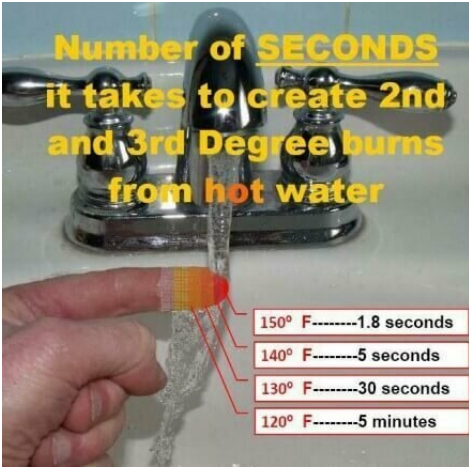

Illustration



9: ELECTRICAL

		IN	NI	NP	C
9.1	General	X			
9.2	Main Distribution Panel	X			X
9.3	Sub Panel	X			X
9.4	Branch Wiring	X			X
9.5	Connected Devices and Fixtures	X			
9.6	Receptacles	X			X
9.7	Switches	X			
9.8	Fire/CO Safety	X			X

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

Information

Main Distribution Panel: Over-current Protection
Breakers

Main Distribution Panel: Panel Capacity
150 AMP

Main Distribution Panel: Panel Disconnect
150 amp breaker at panel



Sub Panel: Panel Location

Basement

**Sub Panel: Visible Branch Wiring**Copper, Non-metallic sheathed
cable**Sub Panel: Disconnect**

One 100 amp breaker at panel

General: Electrical system

Whole house

The electrical system of the home was inspected and reported on with the above information. While the inspector will make every effort to find all areas of concern, some areas may go unnoticed. Outlets and switches were not opened. The inspection was only visual. For example, any outlets, switches or fixtures not readily accessible (behind the refrigerator for example) was not inspected. Please be aware that the inspector has your best interest in mind and is seeking to provide an accurate assessment of the electrical system on the day of the inspection.

Any repair items mentioned in this report should be considered before settlement. As a home inspector, we do not inspect according to specific local or national codes as they differ between municipalities. It is recommended that the advice of a qualified electrician be used to supplement this inspection and to address any repair issues.

General: Life expectancy of residential electric systems

The electrical system of your home has a limited life span. Electricity delivers constant load (heat) to its component parts. This constant use will cause even the most quality materials to eventually fail. The NAHB (National Association of Home Builders) has published the following life expectancy estimates for the important parts of your home's electrical system.

- Main Panel - 60 years
- Wiring (copper) - 100 years
- Breakers - 30-40 years
- Receptacles/Switches - 30 years

For more info read: [Your home electrical system: how long can it last?](#)

Main Distribution Panel: Main Panel

Basement

Electrical panels are considered continuous-use appliances because they are always on. They experience daily heating and cooling of their components. As such, they should be replaced periodically. The average life of a panel is 30-50 years depending upon many factors. I recommend a qualified professional to evaluate this panel to determine if this panel should be updated to a newer panel.



Main Distribution Panel: Testing circuit breakers


When inspecting an electrical panel in an occupied house the inspector will not turn on any breakers that are in the off position.

When inspecting an electric panel in an unoccupied house the inspector will test some circuit breakers that are marked with the word test on the breaker.

Branch Wiring: Visible Branch Wiring

Copper, Non-metallic sheathed (Romex), Armored cable

At the time of the inspection, the predominant, visible branch wiring appeared to be in good condition. Any visible defects will be listed separately in the report.

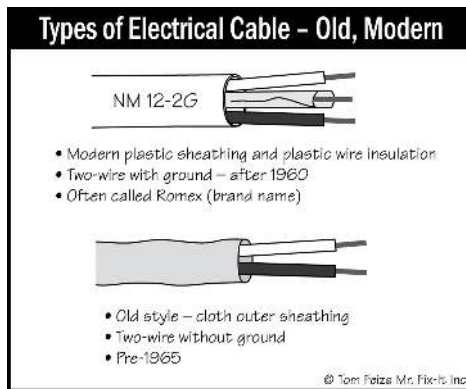

F043

Receptacles : AFCI protection

As of **2014**, AFCI protection is required on all branch circuits supplying outlets or devices installed in dwelling unit kitchens, family rooms, dining rooms, living rooms, parlors, libraries, dens, bedrooms, sunrooms, recreation rooms, closets, hallways, laundry areas, and similar rooms and areas.

Although AFCI protection may not have been required at the time the home was originally constructed, as general knowledge of safe building practices has improved with the passage of time, building standards have changed to reflect current understanding. The inspector recommends updating receptacles to provide AFCI protection where required. All work should be performed by a qualified professional.

Word of caution: it is not always possible to simply replace old breakers with new AFCI breakers in an older home due to original wire constraints.

Receptacles : GFCI protection

Ground Fault Circuit Interrupters or GFCI is a safety device that quickly breaks an electrical circuit to protect equipment and to reduce the risk of serious harm from an ongoing electric shock. Since 1973 these receptacles have slowly been introduced to the NEC (National Electric Code) as requirements in certain areas of the home.

[Here is a link](#) to read about how GFCI receptacles keep you safe.

In most municipalities, the GFCI requirement came about in the following time frame. (These dates represent approximate estimates based on all of the codes used nationally)

- 1973: exterior receptacles (less than 6 feet from the ground)
- 1976: bathroom receptacles
- 1980: garage receptacles*
- 1986: basements and kitchen receptacles within 6 feet of the sink.
- 1990: bath lighting, pools, and spas, crawl spaces, boat houses, hot tub equipment, all kitchen receptacles.

*It is not recommended that a refrigerator outlet in a garage be on a GFCI outlet

Fire/CO Safety: Smoke and CO detectors

Smoke detectors and CO detectors are a small but vital element in your home. They should be placed on every level of the home. Check with your municipality for specific locations. Batteries should be regularly checked and units should be replaced every 10 years.


Recommended reading: [Smoke Alarms](#)

Recommended reading: [Carbon Monoxide Detectors](#)

Recommended reading [NFPA - Smoke Alarm types](#)

The ASHI Standard of Practice requires the reporting of the presence or absence of smoke alarms and carbon monoxide alarms. The inspector will report on the presence or absence of these units. **There is no ASHI requirement to inspect, identify or test these alarms individually therefore I recommend a licensed professional to evaluate the floor plan and confirm that all necessary alarms are in working condition and confirm that they comply with the requirements of local municipalities.**

See limitations in this section

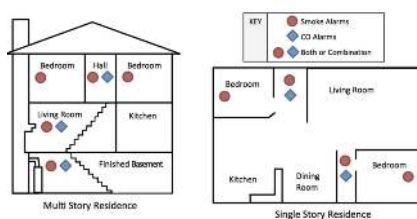

Illustration

Fire/CO Safety: Smoke Alarms

in 4 bedrooms, Missing smoke alarms, In basement

Safety -- The inspector shall comment on the presence or absence of smoke detectors in all required areas. To be effective, these detectors should be permanently mounted according to local codes and with appropriately operational batteries or hard wiring. I recommend the whole house be equipped with smoke detectors in the areas that are required by local municipality codes. A home inspection does not include testing the functionality of smoke or carbon monoxide detectors. Smoke Alarms



Fire/CO Safety: CO detectors

Missing CO detector, Basement

Safety -- At the time of the inspection, carbon monoxide detectors were missing in areas most often recommended by municipalities. To be effective, these detectors should be permanently mounted according to local codes with appropriately operational batteries, or, hard wired. I recommend the local municipalities be consulted and carbon monoxide detectors be installed the recommended areas. CO Detectors



Suggested locations

Limitations

Branch Wiring

NOT COMPLETELY VISIBLE

At the time of inspection not all of the branch wiring was able to be inspected due to lack of visibility. This could be because of wall/floor coverings, lack of access to main panel or stored items. I recommend a qualified professional to evaluate this wiring where access is provided, prior to settlement.

Comments

9.2.1 Main Distribution Panel

SHARED NEUTRAL/GROUND WIRES

MAIN PANEL - 9 LOCATIONS



I observed one of the following:

- Neutrals and grounds under the same terminal.
- Multiple neutrals under the same terminal.
- More than 3 grounds under the same screw (or multiple gauge sizes).

Panel manufacturers typically require only 1 neutral or no more than 2-3 ground wires of the same gauge size under a single connection terminal. For the circuits to be worked on safely, neutrals and grounds need to be separated in the panel.

Multiple Neutrals:


Safe trouble shooting requires that neutrals be separately terminated. The goal is to isolate each neutral for diagnosis. Disconnecting one neutral (for trouble shooting) could leave the other neutral live and produce an over-voltage event.

Neutral/ground: Similar to multiple neutrals, grounds and neutrals should also be separated for safe trouble shooting.

Multiple grounds: Many panel manufacturers DO allow for multiple ground wires under certain parameters. Typically 2-3 of the same gauge size are allowed.

The current installation may not meet the panel manufacturer's installation requirements. I recommend a professional to evaluate this panel to determine if changes need to be made to the neutral bar connections. Also reference NEC 408.41.

Shared neutral and ground wires

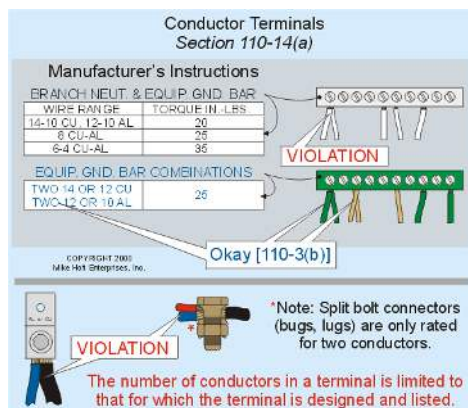

Code specifications



9.2.2 Main Distribution Panel


IMPROPER DOUBLE TAPPED BREAKER(S)

MAIN PANEL



****Safety issue**** - Most circuit breakers are only designed for 1 conductor (wire) to be connected at the lug. This condition prevents a reliable connection which can lead to arcing (and fire) or an intermittent or overdrawn circuit. In some cases double taps are allowed but must be installed in a manner in keeping with the panel's manufactures' instructions. I recommend an evaluation by a qualified professional.

How To Correct Double Tapped Circuit Breakers

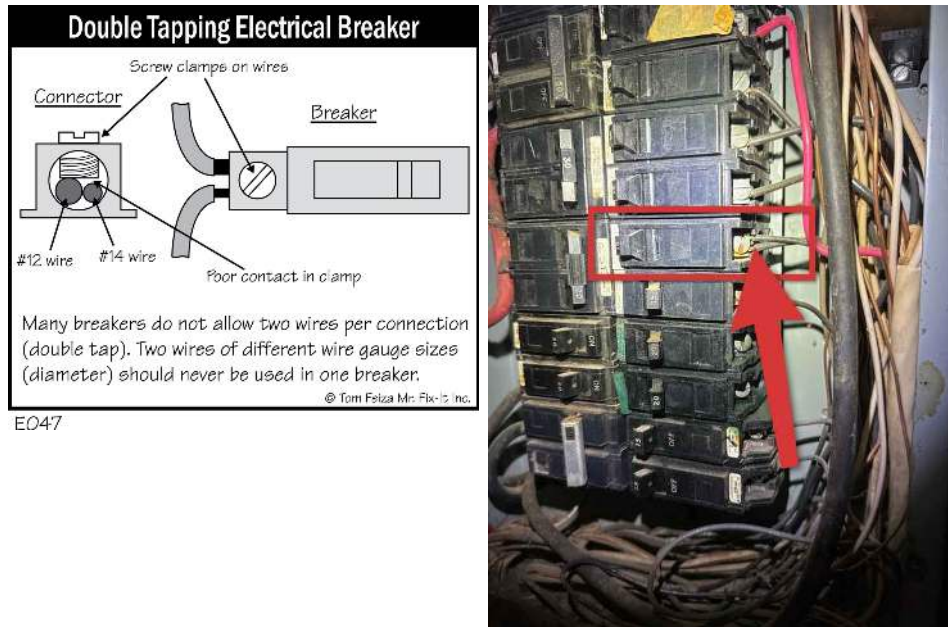

9.2.3 Main Distribution Panel

PANEL SCREWS WITH POINTED TIPS

MAIN ELECTRICAL PANEL

****Safety issue**** - At the time of the inspection I noted that the electrical panel cover screws had pointed tips instead of blunt tips. These can cause electrical shock or arcing if the screw perforated a wire in the panel. I recommend a qualified professional to evaluate and replace with standard electrical panel screws.

 Material Defects



9.2.4 Main Distribution Panel

ELECTRIC PANEL - CORROSION AT MAIN LUG

MAIN PANEL

 Material Defects

At the time of the inspection the main power supply lugs showed signs of corrosion. This is evidence that moisture has probably entered the panel and could be a fire hazard. I recommend a qualified professional to evaluate the condition of the panel prior to settlement and recommend repair.





9.3.1 Sub Panel

 Material Defects

SUB PANEL INCORRECTLY WIRED

SUBPANEL

I observed a sub panel that appeared to be incorrectly wired. In a sub panel neutral and ground wires should not share the same ground bar. In this situation, the current will flow on both the neutral AND on the ground wire. If you do not keep the ground wires separate from the neutral wires, you will be allowing return currents to flow on the ground wires back to the main. A sub panel acts as a pathway between the main service panel and branch circuits down the line. It needs separate ground bars for neutral and ground wires and typically has no main breaker. I recommend a qualified professional to evaluate in order to determine if the panel is not wired properly and if reconfiguration is necessary.

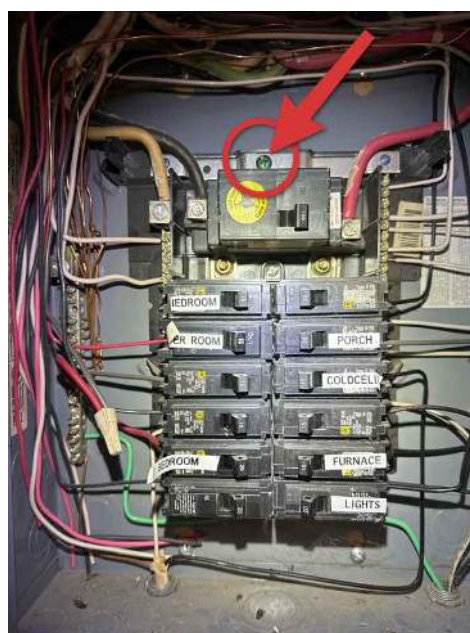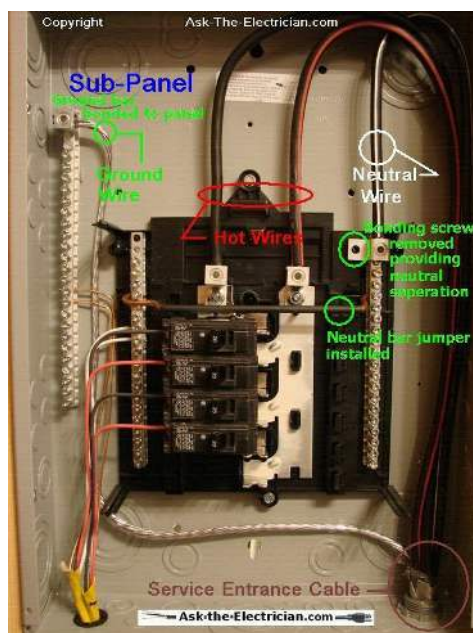


Illustration


9.3.2 Sub Panel

DOUBLE TAP

SUBPANEL

I observed one or more double tapped breakers at the main panel. This style electric panel and breakers is only designed for one wire. If you add a second wire then the connection will not be as it was designed to be with just one wire. One wire will be held tighter and have a better connection than the other. This can cause heat and arcing and a possible fire if the wire becomes loose. I recommend evaluation by a qualified electrician.

 Material Defects

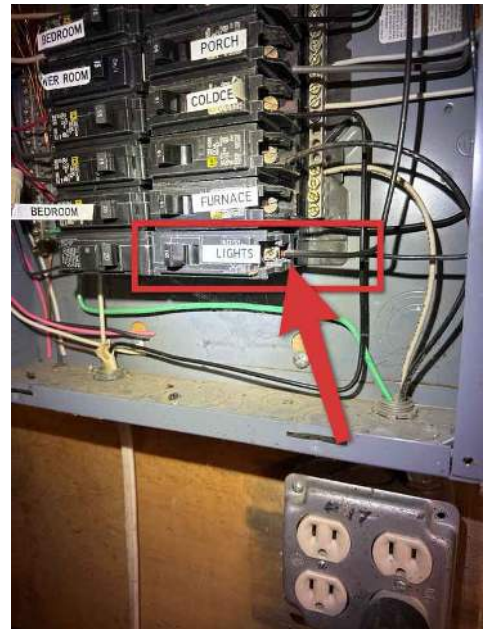

9.4.1 Branch Wiring

JUNCTION BOX COVER(S) MISSING

5 LOCATIONS

At the time of the inspection one or more junction boxes were without covers. This presents a potential shock hazard. I recommend a qualified professional evaluate and install cover plates where absent.

 Recommendations



Attic - 2 locations



2nd Floor Hall Bathroom



2nd Floor Right Side Bedroom Closet



2nd Floor Hall

9.4.2 Branch Wiring

 Recommendations**BRANCH WIRING NOT SUPPORTED**

MIDDLE BASEMENT

I observed places where the branch wiring was not fastened according to standard electrical installation practices. This presents a shock/fire hazard because wires can easily be damaged. I recommend a qualified professional to evaluate and fasten properly.



9.6.1 Receptacles

GFCI OUTLET(S) PROTECTION MISSING

KITCHEN

 Recommendations


••**Safety Issue**•• GFCI protection was missing in one or more locations where Ground Fault protected outlets should be installed. A GFCI device protects against electric shocks from electrical devices used in damp areas of the home. Electrical Code may not have required these outlets at the time the house was constructed, however I recommend a licensed electrician upgrade these and other outlets to current standards. The pictured outlet(s) may only be representative. The inspector tested a representative number of receptacles.

[Here is a link](#) to read about how GFCI receptacles keep you safe.

In most municipalities, the GFCI requirement came about in the following time frame. (These dates represent approximate estimates based on all of the codes used nationally)

- 1973: exterior receptacles (less than 6 feet from the ground)
- 1976: bathroom receptacles
- 1980: garage receptacles*
- 1986: basements and kitchen receptacles within 6 feet of the sink.
- 1990: bath lighting, pools, and spas, crawl spaces, boat houses, hot tub equipment, all kitchen receptacles.
- Later code included laundry rooms

*It is not recommended that a refrigerator outlet in a garage be on a GFCI outlet

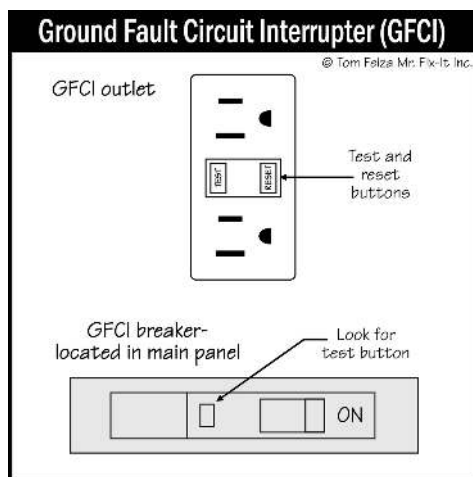

E016
Illustration



9.6.2 Receptacles

RECEPTACLE NOT WORKING

KITCHEN MICROWAVE



Material Defects

At the time of the inspection, I observed one or more receptacles that were not working. I was unable to trace its power source or the root cause. There are various reasons why receptacles fail or don't work (see typical causes below). I recommend a qualified professional to evaluate and repair.

- Tripped circuit breaker
- Tripped GFCI outlet
- Burned out receptacle
- Faulty or worn out
- Wiring defects
- Switch faulty in a switched receptacle circuit




9.6.3 Receptacles

GFCI NOT TRIPPING

3 LOCATIONS



****Safety issue**** - At the time of the inspection one or more GFCI receptacles were not tripping. In this condition the safety features of the GFCI are ineffective. Typically GFCI outlets have a limited lifespan. I recommend replacing this receptacle with a new one.

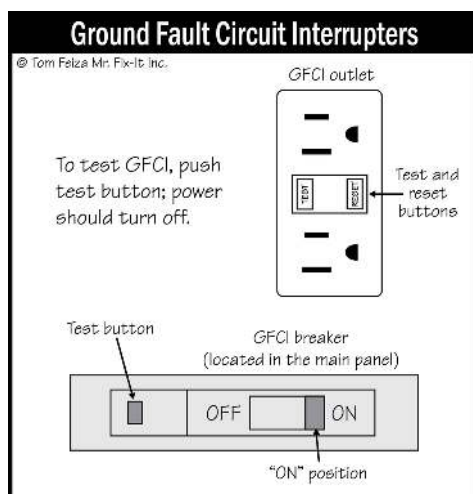

F078



Kitchen



1st Floor Bathroom

9.6.4 Receptacles

RECEPTACLE - COVER PLATE MISSING

DINING ROOM



Safety issue -- I observed an electrical box(es) that had missing cover plate(s). If completely missing, this presents a shock hazard. In the case of exterior outlets water may get into the outlet causing a short. I recommend replacing all missing cover plates.



9.8.1 Fire/CO Safety

RECOMMEND REPLACE ALL FIRE/CO SAFETY DEVICES

THROUGHOUT HOME



****Safety Issue**** The American Society of Home Inspectors (ASHI) Standard of Practice (SOP) states 7.2 The inspector is NOT required to: A. inspect: 1. remote control devices. 2. or test smoke and carbon monoxide alarms, security systems, and other signaling and warning devices.

The actual testing of smoke and carbon monoxide alarms is beyond the scope of a general home inspection (see ASHI SOP above). Therefore, to ensure the safety of the occupants of the home, we recommend that all smoke alarms and carbon monoxide alarms are evaluated or replaced by a professional upon taking possession of the home.

Your home inspector will report on the presence or absence of smoke alarms and carbon monoxide alarms in their proper places throughout the home. We recommend upgrading to the recommended house map included below.



Because actual testing of smoke and CO alarms will not be performed I recommend that all smoke alarms and CO alarms present or absent **be professionally replaced or evaluated upon taking possession of the home.**

Why your home inspector does not test:

1. A simple test of the device's alarm button does not ensure it will operate properly in a fire. The button test will only confirm the alarm sound is working. Testing the alarm test button will not confirm its response to actual smoke. A smoke test is required to confirm the safe operation of each individual smoke alarm.
2. There are many differing types of smoke and CO Alarms with differing expiration dates. Unless installation records exist, it can be impossible to determine when devices were installed and therefore when they are required to be replaced. Manufacturers of these alarms require that they be replaced at regular intervals.
3. Battery-operated devices are rarely charged. Even if the batteries have some charge left, it can be very difficult to determine when they were installed and in need of replacement.
4. Newer WiFi-connected alarms cannot be verified without a connected app.
5. Some alarms are connected to a security system that alerts the fire company. If the fire company responds to a false alarm, they may charge a fee for the mishap.

Upon replacement, I recommend regular maintenance and testing to confirm ongoing operation.

The interconnectivity of smoke and CO alarms is an important feature that may or may not be enforced by local code compliance municipalities. I recommend consulting the advice of a professional.

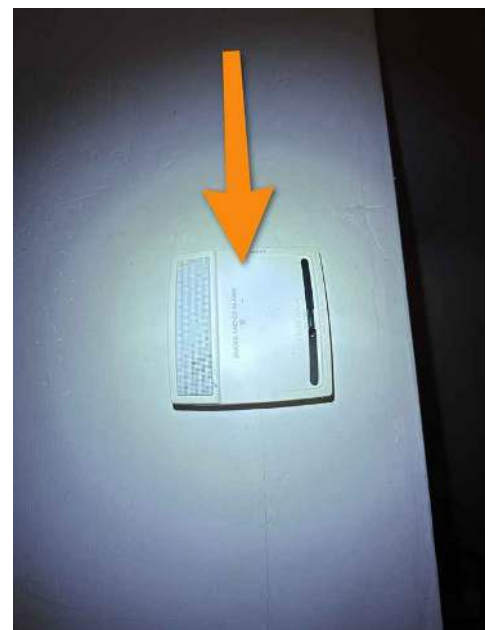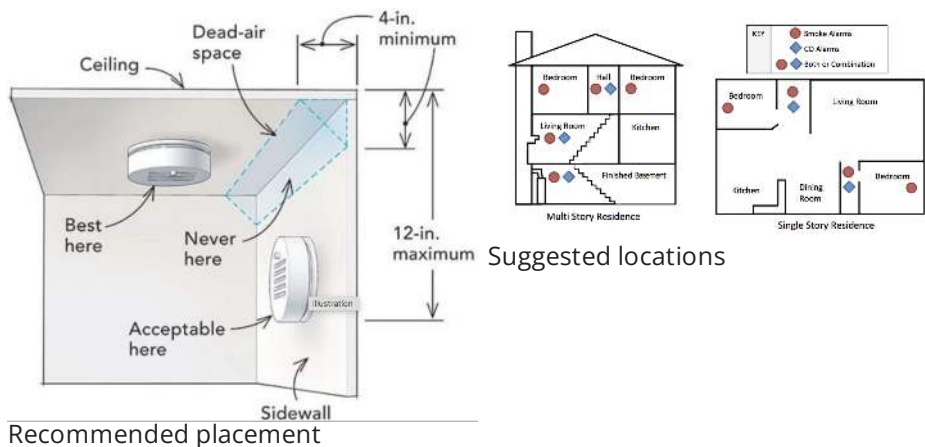

10: UTILITY LOCATIONS AND SHUT-OFFS


		IN	NI	NP	C
10.1	Electric	X			
10.2	Water	X			

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

Information

Electric: Electric shut off


Basement

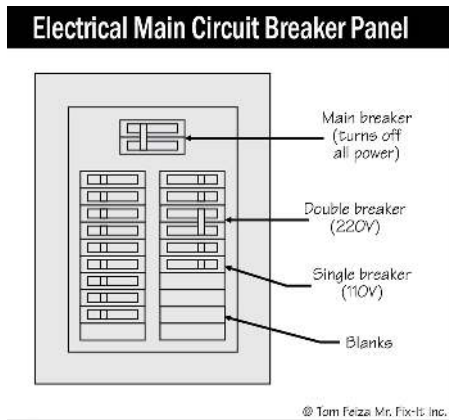

002

Water: Water Shut-off

Basement

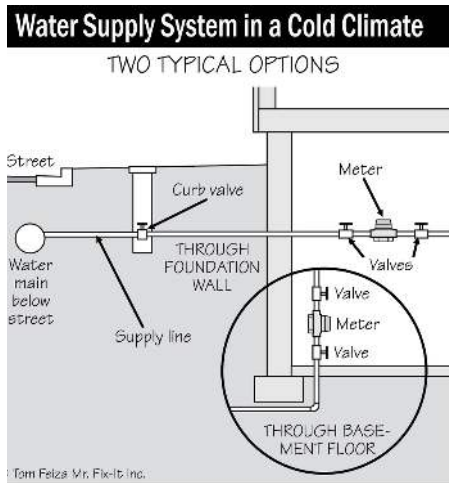

005

11: FIREPLACES AND FUEL-BURNING APPLIANCES

		IN	NI	NP	C
11.1	Fireplaces, Stoves & Inserts	X			X
11.2	Chimney & Vent Systems	X			

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

Information

Fireplaces, Stoves & Inserts:

Damper(s)

Not working

Fireplaces, Stoves & Inserts:

Fuel/power

Wood

No fuel burning accessories present

At the time of the inspection, other than the furnace, there were no fuel burning accessories present.

Fireplaces, Stoves & Inserts: Type

Masonry fireplace, Woodstove



Family Room fireplace



Basement woodstove

Chimney & Vent Systems: General

Appears Acceptable

The inspector will inspect the visible condition of the fireplace chimneys which includes the visible parts of the hearth and the chimney cap. A complete chimney inspection, including the interior flu falls outside of the ASHI Standards of Practice. I recommend a National Fire Protection Agency Type II chimney inspection be performed by a qualified professional prior to using the fireplace or stove.

Chimney & Vent Systems: Type

Wood fireplace chimney

Inspecting the fireplace chimney itself falls outside the scope of an ASHI home inspection. Fossil fuel chimneys require routine maintenance for safe efficient use. I recommend a qualified professional inspect the chimney prior to settlement.

Limitations

Fireplaces, Stoves & Inserts

WOOD FIREPLACE

FAMILY ROOM

A full inspection of wood fireplaces lies beyond the scope of a home inspection. For a full inspection to more accurately determine the condition of the fireplace and to ensure that safe conditions exist, I recommend that you have the fireplace inspected by an inspector certified by the Chimney Safety Institute of America (CSIA) prior to settlement

Do not use without understanding the proper and safe use of a fireplace.

Gas Fireplaces and Gas Logs



Fireplaces, Stoves & Inserts

WOODSTOVE

BASEMENT

At the time of the inspection a wood stove was present. A full inspection of the stove and internal chimney lies beyond the scope of a home inspection. For a full inspection to more accurately determine the condition of the fireplace and to ensure that safe conditions exist, I recommend that you have the fireplace inspected by an inspector certified by the Chimney Safety Institute of America (CSIA).



Comments

11.1.1 Fireplaces, Stoves & Inserts

DAMPER NOT WORKING

FAMILY ROOM FIREPLACE

At the time inspection I observed at the fireplace damper was not working. Using this fireplace without a working damper is a fire hazard. I recommend a qualified professional evaluate and repair.





Close up



Damper not working

12: BUILT-IN APPLIANCES

		IN	NI	NP	C
12.1	Dishwasher	X			X
12.2	Refrigerator	X			
12.3	Garbage Disposal	X			X
12.4	Range/Oven	X			
12.5	Cooktop	X			X
12.6	Microwave	X			
12.7	Washer/Dryer	X			X

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

Information

Range/Oven: Energy Source

Electric

Range/Oven: Exhaust Hood Type

Re-circulate

Cooktop: Cooktop Exhaust Hood Type

Re-circulate

Cooktop: Cooktop Energy Source Washer/Dryer: Dryer power

Propane

source

110 Volt, 220 Electric

Life Expectancy of built-in appliances

Kitchen

Note: Life expectancy of built-in appliances varies with usage, installation, maintenance, and quality of materials. Appliances that are not built in (refrigerators, washers, dryers countertop microwaves etc) are not part of a standard home inspection. The link below includes a general guideline for life expectancy for common house appliances.

[InterNACHI's Standard Estimated Life Expectancy Chart for Homes](#)

Limits of built-in appliance inspection

Kitchen

A standard home inspection will inspect built-in appliances for basic fundamental operation. We do not inspect for performance. For example, we will not put garbage in the garbage disposal, dishes in the dishwasher, food in the oven or liquid in the microwave. For complete inspection limitations see Section 10 Interiors of the ASHI Standards of Practice.

Dishwasher: Dishwasher

The inspector will test the operation of the dishwasher using normal controls and report on its condition. Defects will be commented on separately.

Over time, a heavy film build-up from hard water minerals can become deposited on the inside walls and heating element of the dishwasher. After removing all of dishes, pans, silverware etc. and with no detergent in your dishwasher, the following should be done to remove the type of scale shown:

Mold: Place one tablespoon of bleach in your dishwasher and then run it for a full cycle.

Rust: Place about half of a small container of Tang brand orange-flavored drink mix and then run it for a regular cycle. The citric acid in the Tang helps to loosen hard water deposits and cleans the scale from your dishwasher.

Stains: Place a cupful of white vinegar in your dishwasher and then run it for a full cycle. An alternative to vinegar is baking soda.



Refrigerator: Refrigerator

Kitchen

Present

Refrigerators fall outside the parameters of a home inspection (See [ASHI SOP](#)) because they are considered an appliance that is not permanently installed (like a washer/dryer). Therefore, it was not inspected. The inspector will, however, address defects in plumbing or electricity that are related to the unit itself.

Important Note: refrigerators require adequate ventilation on the sides, top and rear.

[Refrigerator Ventilation](#)



Refrigerator: Water/Ice Supply Line

None

Certain material (i.e. plastic) is subject to early failure which could result in significant water damage.

Range/Oven: Range/Oven

The inspector will test the operation of the range/oven using normal controls and report on its condition. Defects will be commented on separately.



Cooktop: Cooktop

The inspector will test the operation of the cooktop using normal controls and report on its condition. Defects will be commented on separately.



Microwave: Microwave

The inspector will test the operation of the microwave using normal controls and report on its condition. Defects will be commented on separately.



Washer/Dryer: W/D present, not inspected

At the time of the inspection there was a washer and dryer present. Inspecting washer and dryer operation is not within the scope of a home inspection.



Comments

12.1.1 Dishwasher

Recommendations

AIR GAP MISSING

KITCHEN SINK

The dishwasher drain pipe was installed improperly. Without a high drain line loop or air gap, risk of a potential back-flow of water into the dishwasher and incomplete drainage of water is increased. Manufacturer's instructions typically require the line loop up to a point 32 inches from the floor. Some local codes require air gaps to be installed.

I recommend a qualified plumber evaluate and repair as necessary.



12.3.1 Garbage Disposal

Material Defects

GARBAGE DISPOSAL NOT WORKING

KITCHEN

Garbage disposal was inoperable (or not easily operable) at the time of inspection. The reset button may be tripped, the motor may need to be reset, or it may need to be replaced. I recommend that a qualified handyman repair or replace it.

[Here is a DIY resource for troubleshooting.](#)



12.3.2 Garbage Disposal

Material Defects

ACTIVE LEAK

GARBAGE DISPOSAL

At the time of the inspection, the garbage disposal was leaking. I recommend a qualified professional to evaluate and repair or replace.



12.5.1 Cooktop

BURNER(S) NOT WORKING

KITCHEN

****Safety issue**** - One or more burners were not functioning when turned on. Gas burners are often slow to light or will not light at all because the burner or burners are wet or dirty, the electrode is not seated properly, or because the burner head and cap are not matched up properly. I recommend a qualified professional to evaluate & repair.

[Typical reasons burners don't light](#)

 Material Defects



12.7.1 Washer/Dryer

3-PRONG DRYER OUTLET


AT DRYER

****Shock Hazard**** - At the time of the inspection, there was a 220v three-pronged outlet present. Industry safety standards now call for four-pronged outlets at washers and dryers and ranges in order to prevent potential electrical shock. Important: This allows for the neutral wire and the ground wire to move on separate lines, thus removing the potential shock hazard. I recommend a licensed professional to evaluate and to bring the outlet up to current standards. A proper installation will require a new four wire to be installed from the electric panel to the appliance and terminated in a four wire plug.

Article on [Three vs. Four prong outlets](#)

[What's the Difference between 3-prong and 4-prong?](#)

 Material Defects

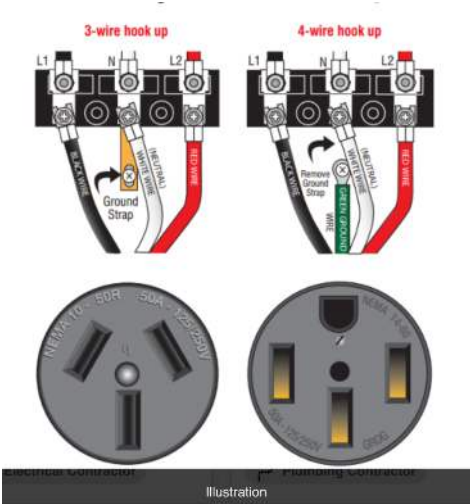

Illustration

13: SCOPE AND LIMITATIONS

Information

KEYS TO THE HOME INSPECTION

The home inspection or any portion thereof, was performed in accordance with the Standard of Practice and Code of Ethics of the American Society of Home Inspectors (ASHI). These standards are included in the report under each section summary. An earnest effort was made on your behalf to discover all visible defects, however, in the event of an oversight, maximum liability must be limited to two times the price of the home inspection. This inspection is an evaluation of the condition of the home in a period of time that is limited to several hours of investigation. It would take days to comprehensively evaluate the condition of a home.

Any areas that are not safe, readily accessible and/or visible to the inspector will not be included in the home inspection report. **The home inspection is not intended as a substitute for a Sellers Disclosure. This home inspection is not a compliance inspection or certification of any kind. It simply is an inspection of the condition of the home at the time of the inspection.** This inspection does not cover items or conditions that may be only discovered by invasive methods. No removal of materials or dismantling of systems shall be performed under this inspection. This is not a technically exhaustive inspection. The inspection report lists the systems and components inspected by Precise Inspecting, LLC. Items not found in this report are considered beyond the scope of the inspection and should not be considered inspected at this time.

Your home inspection is a snapshot in time. The defects found by Precise Inspecting during your inspection are the ones that were present at the time of the inspection. **All defects and recommendations in this report should be evaluated by a licensed professional prior to settlement so that repairs can be made. If this is not done existing defects may persist and increased damage may result.**

While we do your best to identify potential future problems and suggest preventive measures, you will experience future issues in the house that cannot be predicted by your inspection. Furthermore, your home inspection will only cover a representative sample. That means not every outlet or window or faucet will be checked.

This report contains technical information that may not be readily understandable to the lay person. Therefore, a verbal consultation with the inspector is an important part of this inspection. If you choose not to consult with your inspector, Precise Inspecting, LLC cannot be held liable for your understanding or misunderstanding of this reports contents. If you were not present during this inspection, please call the office at (717-808-5997) to arrange for your verbal consultation.

INSPECTION CATEGORIES

1) Maintenance Items - Primarily comprised of small cosmetic items and handyman maintenance items. These observations are more informational in nature and function as a future to-do list rather than something you might use as a negotiation or seller-repair item.

2) Recommendations - Most items typically fall into this category. These observations usually require a qualified contractor to evaluate further, in order to determine if repairs or replacements are necessary. Also included in this category are mechanical and structural systems that are nearing the end of their useful life but are still working. Items in this category may or may not enter into negotiations. Please consult your real estate agent.

3) Defects - This category is composed of "material defects" (as defined by the state of Pennsylvania). These defects normally enter into the negotiation phase of the home sale. They consist of systems, structures or components that are broken, not working as intended, not installed properly, of immediate safety concern or have a significant adverse impact on the value of the property. These items should be addressed by a qualified contractor as soon as possible.

Limitations - This section is not a category. It is a "**tabbed heading**" within each general section which describes any limiting factors that may be present on the day of the inspection. These can best be described as a circumstance or condition that makes it difficult or impossible to conduct a normal inspection of the area, component or system. For example: snow on the roof. The specific limitation will be described and in some cases pictures will be added. These limitations are in addition to the standard limitations that affect all home inspections and are described in the [ASHI SOP](#).

NOTICE: CODES AND REGULATIONS

Home inspections are not code inspections. The report is based on an examination of the visible portion of the structure at the time of the inspection with a focus on safety and function, not on current building or municipality codes.

While many home defects have roots in code compliance, we are not qualified to inspect to specific building codes. It is always recommended to check with the Building and Codes Department of your local township or municipality for permit information and code requirements when there is a question regarding the proper construction methods or code requirements for a particular defect present in the home.

NOTICE TO THIRD PARTIES OR OTHER PURCHASERS

Receipt of this report by any purchasers of this property other than the party(ies) identified on the cover page of this report, as the buyer, is not authorized by the inspector. Liability under this report is limited to the party identified on the cover page of this report as the buyer.

THIS REPORT IS NOT A WARRANTY

This report is not a home warranty. It is recommended that a home warranty be purchased prior to the purchase of the home in the event that any defects arise after the inspection and purchase. The report is based on an examination of the visible portion of the structure at the time of the inspection with a focus on safety and function, not on current building or municipality codes. Structure and mechanical parts of the house can and will change after the inspection and Precise Inspecting is not responsible for these changes or their effects. Any and all evaluations and recommendations made by Precise Inspecting, LLC should be carried out prior to closing. We recommend that you and/or your representative carry out a final walk-through inspection immediately before closing to check the condition of the property.

Furthermore, receipt of this report by any purchasers of this property other than the party(ies) identified on the cover page of this report is not authorized by the inspector. The inspector strongly advises against any reliance on this report by such party(ies). We recommend that you retain a qualified home inspector to provide you with your own inspection and report on this property. Liability under this report is limited to the party identified on the cover page of this report. The Home Inspection and the Inspection Report do not constitute and shall not be considered to be a warranty, either expressed or implied, concerning the present or future condition of the Property, the presence or absence of latent or hidden defects that are not reasonably ascertainable in a competently performed home inspection, or the remaining useful life of any system or component of the property. This report is not binding unless the pre-inspection agreement has been signed by the client and returned to Precise Inspecting, LLC along with payment of the inspection fee.

THE LIMITS OF A HOME INSPECTION

A home inspection is a visual examination of the home's physical structure and systems. Because we can only inspect what we can see, we cannot account for anything hidden from view. Such things include but are not limited to those that are obstructed by furniture or personal belongings, including things behind walls or below ground.

Some examples of note would be any and all interior and exterior plumbing drain lines and roof, gutter and perimeter drainage systems that are underground or otherwise hidden. I recommend these systems and lines be evaluated by a qualified professional prior to settlement in the event that hidden damage may exist.

In addition, there are numerous items, systems, and areas that are **not included** in the scope of this inspection as provided by the [ASHI Standards of Practice](#). It is **important** that you take time to **read** and understand these limitations as they will affect the completed inspection report.

PER PENNSYLVANIA STATE ACT 2000-114:

A home inspection as defined by Pennsylvania law is "A non-invasive, visual examination of some combination of the mechanical, electrical or plumbing systems or the structural and essential components of a residential dwelling designed to identify material defects in those systems and components, and performed for a fee in connection with or preparation for a proposed or possible residential real estate transfer. The term also includes any consultation regarding the property that is represented to be a home inspection or that is described by any confusingly similar term. The term does not include an examination of a single system or component of a residential dwelling such as, for example, its electrical or plumbing system or its roof. The term also does not include an examination that is limited to inspection for, or of, one or more of the following; wood destroying insects, underground tanks and wells, septic systems, swimming pools and spas, alarm systems, air and water quality, tennis courts and playground equipment, pollutants, toxic chemicals and environmental hazards." A home inspection is intended to assist in evaluation based on observation of the visible and apparent condition of the structure and its components on the date of inspection. The results of this home inspection are not intended to make any representation regarding the presence or absence of latent or concealed defects that are not reasonably ascertainable in a competently performed home inspection. No warranty or guaranty is expressed or implied. If the person conducting your home inspection is not a licensed structural engineer of the overall condition of the dwelling. The inspection is not a professional whose license authorizes the rendering of opinion as to the structural integrity of a building or its other component parts, you may be advised to seek a professional opinion as to any defects or concerns mentioned in the report. This home inspection report is not to be construed as an appraisal and may not be used as such for any purpose.

14: ENVIRONMENTAL CONCERNS

Information

Asbestos

Asbestos is a fibrous material that was used in many building materials. The asbestos fibers can cause cancer and other types of lung disease if inhaled. Asbestos can only be identified by laboratory analysis, therefore its identification is beyond the scope of the inspection. Asbestos was banned entirely in the United States in 1978. For further information regarding asbestos please visit www.epa.gov/asbestos.

Lead Paint (prior to 1978):

Lead-based paint was common in use until about 1974. According to the Federal Department of Housing and Urban Development, a lead hazard can be present in a house built on or before 1978. It is believed that the primary danger would be to small children who may somehow ingest chips of lead-based paint. For further information regarding lead-based paint please visit www.hud.gov/offices/lead.

Mold

This inspection is not an inspection for mold. Mold, mildew and indoor or outdoor air quality concerns can be found in many environments and may be especially prevalent in the home. If the home inspection report discloses evidence of moisture or water penetration, whether active or inactive, mold may be present within the property. The identification or detection of any mold, mildew and/or indoor/outdoor air quality is beyond the scope of the inspection **unless a specific request for IAQ or mold screening is requested, a contract signed and a fee paid to Precise Inspecting, LLC**. This company cannot and will not offer any representations, guarantees or warranties of any kind, written or oral, that the property is free from any mold, mildew and/or indoor/outdoor air quality concerns. Inspection for mold, mildew and/or indoor/outdoor air quality should be performed, detected and evaluated by a specialist of the customer's choice or by Precise Inspecting, LLC. For further information regarding mold please visit www.epa.gov/mold.

Radon Gas

Radon gas naturally occurs in our environment. Radon gas is a class A carcinogen and is the second leading cause of lung cancer, after smoking. The U.S. Environmental Protection Agency (EPA) and the Surgeon General strongly recommend taking further action when the home's radon test results are 4.0 pCi/L or greater. The national average indoor radon level is about 1.3 pCi/L. The higher the home's radon level the greater the health risk to you and your family. Reducing your radon levels can be done easily, effectively and fairly inexpensively. Even homes with very high radon levels can be reduced below 4.0 pCi/L. For further information about radon please visit www.epa.gov/radon. The EPA and Precise Inspecting LLC strongly recommends testing all homes for the presence of radon gas.

Urea Formaldehyde (Foam Insulation)

U.F.I. became popular as a residential retrofit insulation in the mid-1970's. It was banned in the U.S.A. in 1982, then the ban was lifted. Formaldehyde gas usually dissipates with time and proper ventilation. However, this gas is known to be a respiratory irritant, particularly to younger and older people. The EPA has not adopted any standards as to harmful levels of formaldehyde gas, however it does caution exposure. Note: various other countries consider exposure to this gas harmful in concentrations of one-fiftieth of the amounts considered safe by the EPA. Consult with your inspection service for additional information.

15: CHECKLIST

		IN	NI	NP	C
--	--	----	----	----	---

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

Information

Key in lockbox?

Owner present

Doors locked?

Owner present

Lights off except those that were on?

Yes

Dishwasher off?

Yes

Oven off?

Yes

Water main off?

On when arrived



Electric panel cover replaced?

Yes

Furnace cover replaced?

Not removed

Business card on counter?

Yes

Reset Thermostat?

Yes, See photo



Fridge/Freezer On

Confirmed on



STANDARDS OF PRACTICE

Inspection Details

2.2 The *inspector* shall:

A. *inspect readily accessible*, visually observable, *installed systems and components* listed in this Standard. B. provide the client with a written report, using a format and medium selected by the *inspector*, that states: 1. those *systems and components* inspected that, in the professional judgment of the *inspector*, are not functioning properly, significantly deficient, *unsafe*, or are near the end of their service lives, 2. recommendations to correct, or monitor for future correction, the deficiencies reported in 2.2.B.1, or items needing *further evaluation* (Per Exclusion 13.2.A.5, the *inspector* is NOT required to determine methods, materials, or costs of corrections.), 3. reasoning or explanation as to the nature of the deficiencies reported in 2.2.B.1, that are not self-evident, 4. those *systems and components* designated for inspection in this Standard that were present at the time of the *home inspection* but were not inspected and the reason(s) they were not inspected.

C. adhere to the ASHI Code of Ethics for the Home Inspection Profession.

2.3 This Standard is not intended to limit the *inspector* from:

A. including other services or *systems and components* in addition to those required in Section 2.2.A. B. designing or specifying repairs provided the *inspector* is appropriately qualified and willing to do so. C. excluding *systems and components* from the *inspection* if requested or agreed to by the client.

Roofing

5.1 The inspector shall: A. inspect: 1. roofing materials. 2. roof drainage systems. 3. flashing. 4. skylights, chimneys, and roof penetrations. B. describe: 1. roofing materials. 2. methods used to inspect the roofing.

5.2 The inspector is NOT required to inspect: A. antennas. B. interiors of vent systems, flues, and chimneys that are not readily accessible. C. other installed accessories.

Exterior

4.1 The inspector shall: A. inspect: 1. wall coverings, flashing, and trim. 2. exterior doors. 3. attached and adjacent decks, balconies, stoops, steps, porches, and their associated railings. 4. eaves, soffits, and fascias where accessible from the ground level. 5. vegetation, grading, surface drainage, and retaining walls that are likely to adversely affect the building. 6. adjacent and entryway walkways, patios, and drive-ways. B. describe wall coverings.

4.2 The inspector is NOT required to inspect: A. screening, shutters, awnings, and similar seasonal accessories. B. fences, boundary walls, and similar structures. C. geological and soil conditions. D. recreational facilities. E. outbuildings other than garages and carports. F. seawalls, break-walls, and docks. G. erosion control and earth stabilization measures.

Interiors

10.1 The inspector shall inspect: A. walls, ceilings, and floors. B. steps, stairways, and railings. C. countertops and a representative number of installed cabinets. D. a representative number of doors and windows. E. garage vehicle doors and garage vehicle door operators. F. installed ovens, ranges, surface cooking appliances, microwave ovens, dishwashing machines, and food waste grinders by using normal operating controls to activate the primary function.

10.2 The inspector is NOT required to inspect: A. paint, wallpaper, and other finish treatments. B. floor coverings. C. window treatments. D. coatings on and the hermetic seals between panes of window glass. E. central vacuum systems. F. recreational facilities. G. installed and free-standing kitchen and laundry appliances not listed in Section 10.1.F. H. appliance thermostats including their calibration, adequacy of heating elements, self cleaning oven cycles, indicator lights, door seals, timers, clocks, timed features, and other specialized features of the appliance. I. operate, or confirm the operation of every control and feature of an inspected appliance.

Structural Components

3. STRUCTURAL COMPONENTS 3.1 The inspector shall: A. inspect structural components including the foundation and framing. B. describe: 1. the methods used to inspect under floor crawlspaces and attics. 2. the foundation. 3. the floor structure. 4. the wall structure. 5. the ceiling structure. 6. the roof structure.

3.2 The inspector is NOT required to: A. provide engineering or architectural services or analysis. B. offer an opinion about the adequacy of structural systems and components. C. enter under floor crawlspace areas that have less than 24 inches of vertical clearance between components and the ground or that have an access opening smaller than 16 inches by 24 inches. D. traverse attic load-bearing components that are concealed by insulation or by other materials.

Heating

8.1 The inspector shall: A. open readily openable access panels. B. inspect: 1. installed heating equipment. 2. vent systems, flues, and chimneys. 3. distribution systems. C. describe: 1. energy source(s). 2. heating systems.

8.2 The inspector is NOT required to: A. inspect: 1. interiors of vent systems, flues, and chimneys that are not readily accessible. 2. heat exchangers. 3. humidifiers and dehumidifiers. 4. electric air cleaning and sanitizing devices. 5. heating systems using ground-source, water-source, solar, and renewable energy technologies. 6. heat-recovery and similar whole-house mechanical ventilation systems. B. determine: 1. heat supply adequacy and distribution balance. 2. the adequacy of combustion air components.

Insulation and Ventilation

11.1 The inspector shall: A. inspect: 1. insulation and vapor retarders in un-finished spaces. 2. ventilation of attics and foundation areas. 3. kitchen, bathroom, laundry, and similar exhaust systems. 4. clothes dryer exhaust systems. B. describe: 1. insulation and vapor retarders in unfinished spaces. 2. absence of insulation in unfinished spaces at conditioned surfaces.

11.2 The inspector is NOT required to disturb insulation.

Plumbing

6.1 The inspector shall: A. inspect: 1. interior water supply and distribution systems including fixtures and faucets. 2. interior drain, waste, and vent systems including fixtures. 3. water heating equipment and hot water supply systems. 4. vent systems, flues, and chimneys. 5. fuel storage and fuel distribution systems. 6. sewage ejectors, sump pumps, and related piping. B. describe: 1. interior water supply, drain, waste, and vent piping materials. 2. water heating equipment including energy source(s). 3. location of main water and fuel shut-off valves. 6.2 The inspector is NOT required to: A. inspect: 1. clothes washing machine connections. 2. interiors of vent systems, flues, and chimneys that are not readily accessible. 3. wells, well pumps, and water storage related equipment. 4. water conditioning systems. 5. solar, geothermal, and other renewable energy water heating systems. 6. manual and automatic re-extinguishing and sprinkler systems and landscape irrigation systems. 7. septic and other sewage disposal systems. B. determine: 1. whether water supply and sewage disposal are public or private. 2. water quality. 3. the adequacy of combustion air components. C. measure water supply flow and pressure, and well water quantity. D. fill shower pans and fixtures to test for leaks.

Electrical

7.1 The inspector shall: A. inspect: 1. service drop. 2. service entrance conductors, cables, and raceways. 3. service equipment and main disconnects. 4. service grounding. 5. interior components of service panels and subpanels. 6. conductors. 7. overcurrent protection devices. 8. a representative number of installed lighting fixtures, switches, and receptacles. 9. ground fault circuit interrupters and arc fault circuit interrupters. B. describe: 1. amperage rating of the service. 2. location of main disconnect(s) and subpanels. 3. presence or absence of smoke alarms and carbon monoxide alarms. 4. the predominant branch circuit wiring method.

7.2 The inspector is NOT required to: A. inspect: 1. remote control devices. 2. or test smoke and carbon monoxide alarms, security systems, and other signaling and warning devices. 3. low voltage wiring systems and components. 4. ancillary wiring systems and components not a part of the primary electrical power distribution system. 5. solar, geothermal, wind, and other renewable energy systems. B. measure amperage, voltage, and impedance. C. determine the age and type of smoke alarms and carbon monoxide alarms.

Fireplaces and Fuel-Burning Appliances

12.1 The inspector shall: A. inspect: 1. fuel-burning fireplaces, stoves, and fireplace inserts. 2. fuel-burning accessories installed in fireplaces. 3. chimneys and vent systems. B. describe systems and components listed in 12.1.A.1 and .2. 12.2

The inspector is NOT required to: A. inspect: 1. interiors of vent systems, flues, and chimneys that are not readily accessible. 2. fire screens and doors. 3. seals and gaskets. 4. automatic fuel feed devices. 5. mantles and fireplace surrounds. 6. combustion air components and to determine their adequacy. 7. heat distribution assists (gravity fed and fan assisted). 8. fuel-burning fireplaces and appliances located outside the inspected structures. B. determine draft characteristics. C. move fireplace inserts and stoves or firebox contents.

Built-in Appliances

13.1 The inspector shall inspect: F. **installed** ovens, ranges, surface cooking appliances, microwave ovens, dishwashing machines, and food waste grinders by using normal operating controls to activate the primary function.

13.2 The inspector is NOT required to inspect:

- installed and free standing kitchen and laundry appliances not listed in Section 13.1.
- appliance thermostats including their calibration,
- adequacy of heating elements,
- self-cleaning oven cycles,
- indicator lights,
- door seals,
- timers, clocks, timed features, and other specialized features of the appliance.
- operate, or control the operation of every control and feature of an inspected appliance.

Scope and Limitations

General limitations

- A. The inspector is NOT required to perform actions, or to make determinations, or to make recommendations not specifically stated in this Standard.
- B. Inspections performed using this Standard:
 - 1. are not technically exhaustive.
 - 2. are not required to identify and to report:
 - a. concealed conditions, latent defects, consequential damages, and
 - b. cosmetic imperfections that do not significantly affect a components performance of its intended function.
- C. This Standard applies to buildings with four or fewer dwelling units and their attached and detached garages and carports.
- D. This Standard shall not limit or prevent the inspector from meeting state statutes which license professional home inspection and home inspectors.
- E. Redundancy in the description of the requirements, limitations, and exclusions regarding the scope of the home inspection is provided for emphasis only.

13.2 General exclusions

- A. The inspector is NOT required to determine:
 - 1. the condition of systems and components that are not readily accessible.
 - 2. the remaining life expectancy of systems and components.
 - 3. the strength, adequacy, effectiveness, and efficiency of systems and components.
 - 4. the causes of conditions and deficiencies.
 - 5. methods, materials, and costs of corrections.
 - 6. future conditions including but not limited to failure of systems and components.
 - 7. the suitability of the property for specialized uses.

ASHI Standard of Practice for Home Inspections Effective March 1, 2014

This supersedes all previous ASHI Standard of Practice for Home Inspections versions.

Copyright 2014 American Society of Home Inspectors, Inc. All rights reserved. 5.

The Standard of Practice for Home Inspections and Code of Ethics of the American Society of Home Inspectors

8. compliance of systems and components with past and present requirements and guidelines (codes, regulations, laws, ordinances, specifications, installation and maintenance instructions, use and care guides, etc.).

9. the market value of the property and its marketability.

10. the advisability of purchasing the property.

11. the presence of plants, animals, and other life forms and substances that may be hazardous or harmful to humans including, but not limited to, wood destroying organisms, molds and mold-like substances.

12. the presence of environmental hazards including, but not limited to, allergens, toxins, carcinogens, electromagnetic radiation, noise, radioactive substances, and contaminants in building materials, soil, water, and air.

13. the effectiveness of systems installed and methods used to control or remove suspected hazardous plants, animals, and environmental hazards.

14. operating costs of systems and components.

15. acoustical properties of systems and components.

16. soil conditions relating to geotechnical or hydrologic specialties.

17. whether items, materials, conditions and components are subject to recall, controversy, litigation, product liability, and other adverse claims and conditions.

B. The inspector is NOT required to offer:

1. or to perform acts or services contrary to law or to government regulations.

2. or to perform architectural, engineering, contracting, or surveying services or to confirm or to evaluate such services performed by others.

3. or to perform trades or professional services other than home inspection.

4. warranties or guarantees.

C. The inspector is NOT required to operate:

1. systems and components that are shut down or otherwise inoperable.

2. systems and components that do not respond to normal operating controls.

3. shut-off valves and manual stop valves. 4. automatic safety controls.

6. ASHI Standard of Practice for Home Inspections Effective March 1, 2014

This supersedes all previous ASHI Standard of Practice for Home Inspections versions.

D. The inspector is NOT required to enter:

1. areas that will, in the professional judgment of the inspector, likely be dangerous to the inspector or to other persons, or to damage the property or its systems and components.

2. under-floor crawlspaces and attics that are not readily accessible.

E. The inspector is NOT required to inspect:

1. underground items including, but not limited to, underground storage tanks and other underground indications of their presence, whether abandoned or active.

2. items that are not installed.

3. installed decorative items.

4. items in areas that are not entered in accordance with 13.2.D.

5. detached structures other than garages and carports.

6. common elements and common areas in multi-unit housing, such as condominium properties and cooperative

housing.

7. every occurrence of multiple similar components.

8. outdoor cooking appliances.

F. The inspector is NOT required to:

1. perform procedures or operations that will, in the professional judgment of the inspector, likely be dangerous to the inspector or to other persons, or to damage the property or its systems or components.

2. describe or report on systems and components that are not included in this Standard and that were not inspected.

3. move personal property, furniture, equipment, plants, soil, snow, ice, and debris.

4. dismantle systems and components, except as explicitly required by this Standard.

5. reset, reprogram, or otherwise adjust devices, systems, and components affected by inspection required by this Standard.

6. ignite or extinguish fires, pilot lights, burners, and other open flames that require manual ignition.

7. probe surfaces that would be damaged or where no deterioration is visible or presumed to exist.