# PRECISE INSPECTING 717-808-5997 Bill@PreciseInspecting.com http://www.PreciseInspecting.com





# **INSPECTION REPORT**

# 85 Vera Cruz Rd Reinholds, PA 17569

09/26/2024



Inspector Matthew Haughery Mutthew Manghery ASHI, #267507

717-808-5997 Bill@PreciseInspecting.com



Agent Renee Weaver HK Keller

# TABLE OF CONTENTS

1: Inspection Details	6
2: Roofing	8
3: Exterior	13
4: Interiors	26
5: Structural Components	41
6: Insulation and Ventilation	45
7: Heating	49
8: Air Conditioning - Abandoned	52
9: Air Conditioning	53
10: Plumbing	57
11: Electrical	70
12: Fireplaces and Fuel-Burning Appliances	80
13: Utility Locations and Shut-offs	82
14: Built-in Appliances	84
15: Scope and Limitations	89
16: Environmental Concerns	92
17: Checklist	93
Standards of Practice	95

# NAVIGATING THE REPORT

Thank you for choosing **Precise Inspecting** to inspect your home! Please carefully read your entire Inspection Report. If you have any questions throughout the closing process please don't hesitate to ask. I am here to help make your home purchase as pleasant as possible. Happy reading!

OVERVIEW	INFORMATION	LIMITATIONS	STANDARDS

**OVERVIEW - This tab** gives a quick summation of the areas inspected, not inspected, not present, or defective.

**INFORMATION** - This tab is the descriptive section of the report in which you will find all the general information required by the ASHI Standards of Practice. It includes all the general photos of the property, including roofs, attics, crawlspaces and any thermal images.

**LIMITATIONS** - This tab is an important section that highlights the areas of the home that could not be inspected because they were not visible or accessible at the time of inspection. Please read in full the limitations sections. In most instances, there are important recommendations that should be followed in order to protect you from unseen defects in the home.

**STANDARDS** - This tab consists of the ASHI Standards of Practice broken down by its general category.

It is important that you act on the defects, safety issues and recommendations of this entire report, including the Summary and the Limitations sections. Furthermore is important that you do this prior to the end of your inspection contingency period so that you can be fully aware of the nature and cause of the issues noted in this report. The evaluation by a professional may discover additional problems that are not visible at the time of the inspection and that require repairs. The opinions of these professionals are an important supplement to this report.

# SUMMARY







# SUMMARY

1) Material Defects - This category is composed of "material defects" as defined by the state of Pennsylvania. Specifically it refers to "a problem with a residential real property or any portion of it that would have a significant adverse impact on the value of the property or that involves an unreasonable risk to people on the property." They consist of systems, structures, or components that are broken, not working as intended, not installed properly, of immediate safety concern, or have a significant adverse impact on the property's value. It is important that these items should be addressed by a qualified contractor prior to the end of your contingency agreement.

2) Recommendations - Recommendations refer to components that are functional at the time of the inspection but require a qualified contractor to evaluate further, in order to determine life expectancy or if repairs or replacements are necessary. Also included in this category are mechanical and structural systems nearing the end of their useful life but still in working condition. Because these items are not insignificant, I recommend that they be addressed by a qualified contractor prior to the end of your contingency agreement.

**3)** Maintenance - These observations are primarily comprised of maintenance items and are provided in order to draw attention to items that need attention or repair by a professional or homeowner before they develop into significant problems.

- ⊖ 3.2.1 Exterior Walkways: Concrete cracking moderate
- O 3.2.2 Exterior Walkways: Walkway Loose boards
- ⊖ 3.4.1 Exterior Grading and Drainage: Grading Potential Low spot
- O 3.8.1 Exterior Porches, Balconies, Steps and Railings: Concrete cracking moderate
- ⊖ 3.12.1 Exterior Exterior Doors: Keyed deadbolt
- (1) 3.12.2 Exterior Exterior Doors: Rotten door, sill and trim
- 3.12.3 Exterior Exterior Doors: Garage door safety stop missing
- O 3.12.4 Exterior Exterior Doors: Moisture entering at door sill

A

- 3.15.1 Exterior Exterior Paint: Peeling paint
- 4.2.1 Interiors Ceilings: Ceiling damage from past leak
- ⊖ 4.6.1 Interiors Doors: Bi-fold Door off track
- § 5.5.1 Structural Components Foundation Structure: Efflorescence
- O 6.3.1 Insulation and Ventilation Exhaust Systems: Radon Test recommended
- 8.1.1 Air Conditioning Abandoned Cooling Equipment: Abandoned HVAC system
- 10.2.1 Plumbing Water Distribution lines: Polybutylene piping
- 10.8.1 Plumbing Sewage Ejectors: Sewer ejector drain defect
- 10.10.1 Plumbing Whirlpool tub: Whirlpool not inspected
- 11.4.1 Electrical Branch Wiring: Service cable not properly supported
- 11.5.1 Electrical Connected Devices and Fixtures: Fixtures not working
- O 11.6.1 Electrical Receptacles : Exterior weather covers missing
- O 11.8.1 Electrical Fire/CO Safety: Recommend replace all fire/CO safety devices
- 12.2.1 Fireplaces and Fuel-Burning Appliances Fireplaces, Stoves & Inserts: Propane fireplace not working
- 14.5.1 Built-in Appliances Washer/Dryer: 3-prong dryer outlet
- O 14.5.2 Built-in Appliances Washer/Dryer: Drain pan recommended

# 1: INSPECTION DETAILS

# Information

## **Front Elevation**



**Right Side Elevation** 



**Rear Elevation** 



**Left Side Elevation** 



Temperature and Weather



Alerts

企

Year built 1989

Square Footage 2621

#### Style

One-story, Ranch

Туре

(NR)

Detached, Single Family

9 Day

## In Attendance No one present

## Your home's life expectancy



Home Material Life Expectancy

## Occupancy

Unfurnished, Unoccupied

Where the home is furnished there will be certain limitations to the home inspection. These limitations are spelled out in the ASHI Standard of Practice which provides the guide for this home inspection.

# 2: ROOFING

					IN	NI	NP	С
2.1	Coverings				Х			
2.2	Flashings				Х			
2.3	Roof Drainage Systems				Х			
2.4	Venting				Х			
2.5	Skylights, Chimneys & Roof Penetrations				Х			
		IN = Inspected	NI = Not Inspected	NP = Not Pre	esent	: C	= Com	ments

# Information

# Venting: Type

Ridge vent, Gable vent



## **Coverings: Type**

#### Corrugated metal

At the time of the inspection, it was not possible to determine the life expectancy of the entire roof because I was not able to determine 1) the roof material manufacturer, 2) the exact installation method, or 3) the date of installation. Climate and regular maintenance also affect longevity. In addition, some roofs with multiple coverings have been installed at different times meaning leaks can occur as the coverings age differently over time.

All of these are factors in determining a roof's life expectancy. It is important to have a qualified professional regularly inspect the roof in order to more accurately anticipate a roof replacement. I highly recommend you research the roof material of your roof in order to better determine it condition and serviceable life. This is the only way to obtain an accurate assessment of a roof's life expectancy.

#### How Long Does a Roof Last?



# **Coverings:** Roof inspection method

#### View from ladder

The inspector will make every effort to inspect all accessible roof surfaces and materials. The inspector is not required to access roofs that, in his judgment, are unsafe to traverse or may result in damage to the roofing materials (i.e. slate, tile, etc.)

In other cases, conditions on the day of inspection may make certain areas of the roof inaccessible, not visible, or obstructed from view. When these conditions are present the roof will not be fully inspected. Hidden damage may exist. In these cases, a qualified roofing contractor should evaluate the roof prior to settlement.

At times a drone can be used to visually inspect the roof. It is not required. The preferred method of inspecting a roof is to physically access the roof but if the roof is too steep or the materials are brittle and susceptible to breaking when walked on a drone may be used. While drones are good at accessing difficult-to-reach portions of the roof (like tops of chimneys) they are not able to feel brittle surfaces or spongy roof conditions. Drone photography falls outside the requirements of a home inspection and its inclusion has limitations as stated above. Where these limitations exist it is recommended that a licensed, professional roofing contractor be contacted to evaluate the overall condition of the roof prior to settlement.

# **Coverings: Roof Photos**



## Flashings: Material

#### Steel

At the time of the inspection the roof flashings appeared to be functional. Not all flashing is visible due to the siding and shingles that cover it. Any defects will be listed separately in the report.



arious Types of Roof Flashing

## **Roof Drainage Systems: Gutter and Downspout material**

K style, Aluminium, w/ gutter guards

At the time of the inspection the gutter and downspouts appeared to be functional. I recommend periodic cleaning to maintain open flow of water.



## Skylights, Chimneys & Roof Penetrations: Roof Penetrations

#### Plumbing vent ABS

Rubber boots systems have a limited life expectancy and can fail without warning. I recommend a qualified professional to evaluate these connections yearly to check for deterioration and to replace before a roof leak develops.

## Skylights, Chimneys & Roof Penetrations: Chimney Type

#### Veneer stone chimney

Masonry products, including stucco and adhered masonry, tend to absorb and hold moisture. This moisture will then dry inwards and can carry that moisture into the interior structure. I recommend periodic examination of the structure on the inside in order to verify that moisture intrusion is not occurring.



### Skylights, Chimneys & Roof Penetrations: Skylights

#### Glass

Skylights are popular architectural features in homes, on both flat (low-sloped) and sloped (steep) roofs. They may be single-, double- or triple-glazed, and they may have flat or curved glazing. Skylights may be installed on curbs, or they may be flush mounted. Most templates are manufactured units, but they also may be site-built.\*

Older and less expensive skylights were often installed without a curb and step flashing. These skylights are often acrylic and sealed to the roof with a mastic/adhesive. Because this type of skylight cannot accommodate seasonal expansion and contraction, the mastic often fails and leaks result.

#### \*See Skylights



# **3: EXTERIOR**

		IN	NI	NP	С
3.1	General	Х			
3.2	Walkways	Х			Х
3.3	Driveways	Х			
3.4	Grading and Drainage	Х			Х
3.5	Siding	Х			
3.6	Flashing & Trim	Х			
3.7	Eaves, Soffits & Fascia	Х			
3.8	Porches, Balconies, Steps and Railings	Х			Х
3.9	Foundation Wall Exterior	Х			
3.10	Stucco/Masonry/Veneer	Х			
3.11	Service Entrance Conductors and Grounding	Х			
3.12	Exterior Doors	Х			Х
3.13	Exterior Venting	Х			
3.14	Exterior Hose Bibs	Х			
3.15	Exterior Paint	Х			Х
3.16	Vegetation	Х			
3.17	Other items present		Х		
	IN = Inspected NI = Not Inspected NP = Not F	resent	t C	= Com	ments

# Information

Walkways: Material Concrete, Treated wood

Siding: Siding Style Veneer, Vertical panels

Service Entrance Conductors and Exterior Hose Bibs: Type Grounding: Type and Voltage Conduit, Aluminium, 200 amp

**Driveways:** Material Asphalt

Porches, Balconies, Steps and **Railings: Type** Front porch, Rear patio

Freeze protection

Siding: Material Adhered Masonry Veener, Vinyl

Porches, Balconies, Steps and **Railings: Material** Concrete

## **General:** Out buildings

Multiple Locations

Buildings on site that are not attached to the home are not included in this home inspection unless paid for separately. Examples of such buildings: detached garages, barns, pool houses, sheds, gazebos, covered patios or similar structures.



## General: Life expectancy of exterior components

Note: Life expectancy of exterior building materials varies with installation, maintenance, and quality of materials. The link below includes a general guideline for life expectancy for common building materials. Standard Estimated Life Expectancy Chart for Homes

## Grading and Drainage: Drainage Type

Exterior Foundation

#### Underground pipe

The proper diverging of rain water away from the house is a crucial aspect of keeping foundations and basements dry. It is recommended that all surface drains be directed at least 4 feet away from the foundation any underground drainage pipes are not within the scope of this home inspection I recommend their non-visible sections and all outlets be investigated prior to settlement by a qualified professional.

<u>New homes</u>: during the first year after construction, it is recommended that attention be given to any settlement around the foundation of the home, and that low areas be filled in order to maintain runoff.

Important note: the interior of downspouts and underground drains cannot be visually inspected and may contain hidden defects such as clogged gutters or holes not visible. I highly recommend a though inspection of the downspouts prior to settlement. Consider a video scope inspection.

# Article on Proper Drainage



## Grading and Drainage: Direction

Neutral

Definitions:

**Positive** - At the time of the inspection, the grading around the house appeared to be sloped away from the house to allow for proper drainage of rainwater. Any specific recommendations will be mentioned in the report below.

**Neutral** - At the time of the inspection, I observed grading against the house that could potentially collect water and create an avenue for moisture to enter the home. Neutral grades should be inspected regularly in order to access if they are adequate in directing water away from the house. Any specific recommendation will be mentioned in the report below.

**Negative** - At the time of the inspection, I observed a negative grading against the house that could potentially collect water and create an avenue for moisture to enter the foundation. Negative grading should be addressed ASAP as damage to the structure can result quickly. Specific conditions and recommendations are mentioned in comments below.

#### Prevent basement water problems



## Flashing & Trim: Material

#### Wood, Aluminium

At the time of the inspection, the flashing and trim appeared to be in good condition. Any recommendations will be listed separately in the report.

### Eaves, Soffits & Fascia: Material

#### Aluminium, Vinyl

The **eaves** are the edges of the roof which overhang the face of a wall and, normally, project beyond the side of a building. The eaves form an overhang to throw water clear of the walls. The **soffit** is the underside of the eave whereas the fascia is the outward-facing vertical portion. Under ideal circumstances, the air flow depicted in the diagram below should be present. If not you may want to consider upgrading the ventilation system. The **fascia** is the vertical face of the roof edge that covers the roof rafters. It is usually positioned behind the gutter.



## Foundation Wall Exterior: Type

#### Concrete block

Foundation walls are an important structural component of a home. However they are vulnerable to water penetration at all times. It is important to know that not all walls perform the same with regards to moisture penetration into the basement or crawlspace. Even if a wall is structurally sound it may transfer moisture into the interior. Older hand laid stone walls can be very porous and will allow water to enter the interior space easily. Brick or concrete block wall are less porous but still are vulnerable to moisture penetration, especially during heavy rail. Poured concrete and Superior wall systems provide greater protection against moisture penetration but are still vunerable.

Please note carefully the type of foundation wall system noted here. In all types care must be taken to regularly examine the exterior grading and roof spouting surrounding the foundation to avoid unnecessary water entering the basement or crawlspace.



Most common in Pennsylvania

#### Stucco/Masonry/Veneer: Types

#### **Overall Exterior**

Adhered masonry over frame wall

Hard/coat transitional stucco EIFS and an adhered manufactured stone veneer [identify the side(s)]. This type of material has been known to allow moisture to pass behind it and become trapped inside the wall potentially causing mold to form. We recommend having an invasive evaluation performed prior to closing to determine if there is any trapped moisture and/or damage at the substrate/sheathing. This type of inspection is beyond the scope the scope of a home inspections.

## Stucco/Masonry/Veneer: Definitions

Exterior

**STUCCO\*** - Traditional "stucco" or hard coat stucco is used to describe a type of exterior plaster applied as a two- or three-part coating directly onto masonry, or applied over wood or metal lath to a log or wood frame structure. Stucco is found in many forms on historic structures throughout the United States. More info on STUCCO here

**EIFS\*** - Exterior Insulation and Finish Systems is an acronym for a product that is also called synthetic stucco, or soft coat stucco, and refers to a multi-layered exterior finish that includes foam insulation board installed as an exterior finish to residential, mostly wood frame house.

#### More info on EIFS here

**\*Note:** Generally speaking stucco can appear in two forms: <u>hard coat stucco</u> and synthetic stucco or <u>soft coat stucco</u>. Both forms have a reputation of failure because of improper installation techniques; however, synthetic stucco is worse than hard coat stucco in the sense that once moisture gets trapped, synthetic stucco holds the moisture, which then rots the structure. <u>Because it is difficult to confirm from only a visual inspection I will refer to both types</u> as "**Stucco-like**".

**AMSV** - Adhered Manufactured Stone Veneer is a lightweight, architectural, non load-bearing product that is manufactured by wet cast blending cementitious materials and aggregates, with or without pigments, admixtures, or other materials to simulate the appearance of natural stone and other masonry materials.

More info on AMV here



## Service Entrance Conductors and Grounding: Entrance

#### Below Ground

At the time of the inspection the service conductors appeared to be in good condition. Any defects will be listed separately in the report.



Utility Responsibility



## Service Entrance Conductors and Grounding: Grounding method

Not visible outside

Grounding is a method of giving electricity the most effective way to return to the ground through the service panel. When the electricity is on, current flows from the panel to the outlet or device to power it up. The <u>neutral</u> wire is the return path for unused current. The <u>ground</u> wire is an additional path for electrical current to return safely to the ground without danger to anyone in the event of a short circuit.

#### **Exterior Doors: Types**

Garage door, Single Swing, Sliding Glass, Basement access steel

All exterior doors were inspected for proper functioning, safety, and any materials defects. Electric garage door openers were tested for safety features including either electronic eyes or pressure sensitive closures.



#### **Exterior Doors: Material**

Steel, Vinyl, Glass

At the time of the inspection the exterior entry door appeared to be in good condition. Any recommendations will be listed separately in the report.

## **Exterior Venting: Exterior dryer vent**

Rear

The dryer vent allows for moisture and lint to exit the house. It should be regularly maintained. If not it can become a fire hazard\*. In order to prevent a possible fire, I recommend periodic cleaning.

If the dryer vent cap was visible and within reach, I inspected the opening. If it was not visible or within reach (see limitation section), I recommend this be inspected prior to settlement and become part of regular home maintenance afterward.

See limitation comments in this section for further information.

\*Dryer vent piping that becomes clogged is a leading cause of house fires.

#### How to Clean Dryer Vents



#### **Vegetation:** Trees and shrubs

#### Present and maintained

A home inspection includes making an assessment of vegetation that comes into contact with the home. Plants and branches, even at full growth, should be kept 12-18 inches away from house siding, roof, and windows. Keep the trees and their roots away from the foundation. Plants or trees in contact or in close proximity to the home can provide pathways for wood destroying insects to enter the house and can damage the exterior walls, windows, roofs, and foundations.

Article on landscaping and your house

#### **Other items present: Detached structures**

#### 3 Locations

At the time of inspection the detached structure pictured here was not inspected. Detached structures such and sheds and garages and pool houses are priced separately from a home inspection and are not included in this inspection unless specifically requested and added to the invoice.



## Other items present: Pool pump and plumbing

Rear

At the time of the inspection, there was a swimming pool present with its pump and plumbing system. Inspection of these plumbing systems fall outside the scope of a home inspection performed by Precise Inspecting. I recommend hiring a qualified pool and spa professional to inspect the pool prior to settlement.



## Other items present: Back up Generator

At the time of inspection, I observed a backup generator. These appliances are not within the scope of the home inspection. I recommend a qualified professional to evaluate this unit and it's connections for safety and proper installation.

#### How a generator works



# Limitations

## Grading and Drainage UNDERGROUND DRAINAGE

REPRESENTATIVE LOCATIONS

At the time of inspection I observed downspout drainage that entered underground piping in one or more places. In certain municipalities storm drains are connected to the public sewer system. It is not always possible to determine where these underground pipes deposit their water. I recommend a qualified professional to investigate with a video scope where these underground pipes empty and to confirm that adequate drainage is taking place away from the house.



# Foundation Wall Exterior FOUNDATION WALL NOT COMPLETELY VISIBLE

At the time of inspection the foundation wall was not completely visible from the exterior. Hidden damage may exist. I recommend a qualified professional to evaluate the condition of the exterior foundation wall at this location.

Stucco/Masonry/Veneer

# ADHERED MASONRY

I observed the home to have adhered masonry veneer surfaces. This product is an attractive and economic advance in masonry home construction when installed properly. Because the installation materials and processes (water resistive barrier, metal lath, and base coat) of this product are almost completely concealed behind the veneer, they cannot be evaluated fully by a visual inspection. All cracks and perforations should be caulked, sealed and maintained in order to a house envelope to perform well.

Adhered masonry needs to be installed to specific installation requirements of the stone manufacturer and/or the Masonry Veneer Manufacturers Association (MVMA).



# Comments

3.2.1 Walkways

# **CONCRETE CRACKING - MODERATE**

FRONT WALK

At the time of the inspection the walkway showed signs of moderate cracking. In order to maintain a safe and serviceable surface and to avoid water penetration, walks and steps should be maintained free from cracking. I recommend evaluation and repair of this section of walkway.



3.2.2 Walkways

# WALKWAY - LOOSE BOARDS

**\*\*Safety issue\*\*** - At the time of the inspection I observed several loose boards on the wooden walkway. This presents a tripping

loose boards on the wooden walkway. This presents a tripping hazard. I recommend the walkway be evaluated and repaired professionally.





## 3.4.1 Grading and Drainage GRADING - POTENTIAL LOW SPOT



RIGHT SIDE

At the time of the inspection there was a potential low spot or area against the foundation that could hold water. This area could allow water to trap and not drain away properly. I recommend this area(s) be evaluated and re-graded to avoid the pooling of water in the yard.



3.8.1 Porches, Balconies, Steps and Railings

# **CONCRETE CRACKING - MODERATE**

#### REAR PATIO

At the time of the inspection I observed an area(s) where the concrete surface was cracking. The size of this particular crack is small. There does not appear to be any underlying structural problems, however this area should be evaluated by a professional to determine if the problem will continue to degrade so that repairs can be made.



Settlement cracks in concrete

3.12.1 Exterior Doors

**KEYED DEADBOLT** 

EXTERIOR BASEMENT DOOR

**\*\*\*Safety Hazard \*\*\*** I observed doors with keyed dead bolts that could only be unlocked with a key. In the event of a fire, the doors could not be quickly and easily unlocked. A qualified professional should replace the dead bolts with a turn knob style dead bolt.



# 3.12.2 Exterior Doors ROTTEN DOOR, SILL AND TRIM

GARAGE SIDE DOOR

At the time of the inspection I observed a door(s) in which the **door**, **sill**, **jamb or all three** were rotted in one or more locations. See photo descriptions. The apparent cause is moisture. I recommend a qualified professional to evaluate and repair or replace.



Close up

Threshold and trim rot





# 3.12.3 Exterior Doors GARAGE DOOR SAFETY STOP MISSING

GARAGE - 3 DOORS

The safety stop mechanism was missing at the garage door pictured here. This mechanism is a crucial safety feature that helps to protect against potential injury and even death. I recommend a a proper safety stop feature be installed.

MOISTURE ENTERING AT DOOR SILL

EXTERIOR BASEMENT DOOR

3.12.4 Exterior Doors

At the time of inspection one of the exterior doors showed signs of moisture penetration. I recommend a qualified professional to evaluate and repair.

Material Defects

door

3.15.1 Exterior Paint

**PEELING PAINT** 

GARAGE

At the time of the inspection the painted exterior surfaces showed signs of peeling/blistering and exposure to weather in numerous locations. I recommend all the exposed surfaces be evaluated and maintained on a regular basis.









Page 24 of 98





Close up Garage doors

Peeling paint at base of door frames

# 4: INTERIORS

		IN	NI	NP	С
4.1	Interior Photos	Х			
4.2	Ceilings	Х			Х
4.3	Walls	Х			
4.4	Windows	Х			
4.5	Floors	Х			
4.6	Doors	Х			Х
4.7	Countertops & Cabinets	Х			
4.8	Paint	Х			
4.9	Interior trim	Х			
4.10	Steps, Stairways & Railings	Х			
4.11	Fire Separation	Х			
4.12	Emergency Egress	Х			

IN = Inspected NI = Not Inspected NP = Not Present C = Comments

# Information

# Floors: Floor Covering Vinyl, Carpet

Countertops & Cabinets: Cabinetry Material Wood Countertops & Cabinets: Countertop Material Laminate

# **Emergency Egress: Status**

Present and functional



## Interior areas not inspected

**\*\*Important Note**\*\* At the time of inspection there were areas such as, but not limited to, walls, ceilings, floors, mechanical components, plumbing fixtures, slabs and other parts of the home that **were not inspected because access and visibility was limited.** See ASHI SOP Sec.13. Prior to settlement and after the area is made accessible Precise Inspecting will return to inspect the area for a fee.

#### **Interior components**

Throughout

During the home inspection a representative sample of multiple components will be inspected. The inspector will make every effort to observe all visible components and comment on them, however not every window, door, switch, outlet, valve or faucet will be checked. Furthermore, where stored items, furniture and equipment are present visibility is limited to what can be seen without moving items. As a result, certain components cannot be inspected. It may be prudent to return for a re-inspection after these items are removed.

# Interior Photos: 1st Floor Photos

Photos



85 Vera Cruz Rd











# **Interior Photos: Basement**

Photos



Precise Inspecting




### **Interior Photos: Garage Photos** Photos



Precise Inspecting

#### **Ceilings:** Ceiling Material

Drywall

Ceilings will be inspected for structural defects and significant damage. Most cracks and defects are considered cosmetic when it comes to ceiling surfaces and are not considered a part of a home inspection.

#### Walls: Wall Material

Drywall

At the time of the inspection the walls appeared to be in serviceable condition. Any defects will be listed separately in the report.

Walls will be inspected for structural defects and significant damage. Most cracks and defects are considered cosmetic when it comes to ceiling surfaces and are not considered a part of a home inspection.

#### Windows: Window material

Vinyl, Wood

The life expectancy of windows can be 20-40 years depending upon materials, climate conditions and manufacturer. See charts of averages below.



#### Averages

#### Windows: Window Type

#### Casement

At the time of the inspection the windows appeared to be in good condition. Any defects will be listed separately in the report. Any storm windows present were not inspected as they are not included in an ASHI home inspection.

#### Doors: Type

Solid core panel, Bi-fold, Hollow core panel

At the time of the inspection the interior doors appeared to be in good condition. Any recommendations will be listed separately in the report.

#### Fire Separation: Between Garage and House

Garage

Adequate

For fire safety all walls, ceilings, doors and hatches should be rated for 1 hour separation between the garage and living space.

## Limitations

Windows

## STORM WINDOWS AND SCREENS NOT INSPECTED

The inspection of storm windows and window screens are not included in an ASHI home inspection. See the ASHI Standards of practice in this section marked "Standards".

#### Doors

## STORM DOORS NOT INSPECTED

The inspection of storm doors are not included in an ASHI home inspection. See the ASHI Standards of practice in this section marked "Standards".

## Comments

## 4.2.1 Ceilings CEILING - DAMAGE FROM PAST LEAK



FAMILY ROOM

I observed ceiling damage that appears to be the result of a past leak above. There was no moisture evident at the time of the inspection. I recommend the ceiling be repaired.



Minor drywall damage

Staining dry on Meter

Minor drywall damage before skylights were replaced

#### 4.6.1 Doors

## **BI-FOLD DOOR OFF TRACK**

FRONT RIGHT SIDE BEDROOM CLOSET

Recommendations

I observed one or more bi-fold doors where the operating hardware was off track or was in need of replacement. I recommend a handyman or DIY repair this so that the door operates properly.



## 5: STRUCTURAL COMPONENTS

		IN	NI	NP	С
5.1	Attic, Roof and Ceiling Structure	Х			
5.2	Wall and Ceiling Structure	Х			
5.3	Basement	Х			
5.4	Floor Structure	Х			
5.5	Foundation Structure	Х			Х
	IN = Inspected NI = Not Inspected NP = Not F	resen	t C	= Com	ments

## Information

#### Attic, Roof and Ceiling Structure: Wall and Ceiling Structure:

Attic structure and material Wood truss, Plywood Material

Wood

Floor Structure: Material Wood dimensional, Plywood, Steel Beam, Steel columns



#### Foundation Structure: Type

Full basement

#### Attic, Roof and Ceiling Structure: Inspection Method

Attic

Attic entered

I made a good faith effort to inspect the attic and its structural components (framing, sheathing, and insulation). An inspector is not required to traverse attic load-bearing components that are concealed by insulation or by other materials or to enter areas that are only accessible through an opening less than 16" x 24".

#### Attic, Roof and Ceiling Structure: Attic Photos



#### Wall and Ceiling Structure: Wall framing inaccessable.

Overall

Walls appeared to be constructed properly, however, the materials used could not be inspected because of interior and exterior coverings. Hidden damage may exist.

#### **Basement: Basements**

Basement

Maintaining your basement is the single most important homeowner responsibility. You will want to correct and maintain grading, gutters, downspouts, sump pump discharge and all sources of surface water.

For safety reasons, all basement level living spaces should have 2 exits or means of egress. In the event of a fire or other emergency, this allows two escape routes. In some situations, a large window can provide this exit. If you plan on using a basement level as living space you should check with your local fire department for safety precautions.



#### **Foundation Structure: Material**

#### Masonry block

At the time of the inspection the structure of the home appeared to be in good condition. Any defects will be mentioned specifically in the report. it should be noted that stone, brick and concrete block foundations are considered "pourous" and will easily allow moisture to pass for the outside to the inside. This is an informational comment. If moisture is visible at the time of inspection it will be noted in a separate comment below with photos.



## Limitations

Attic, Roof and Ceiling Structure

### ATTIC, ACCESS LIMITED

#### ATTICS AND KNEE WALLS

Access to some parts or all of the attic above the ceiling and knee walls was limited (cathedral ceilings would be one example). As a result, I was not able to fully inspect this area. Hidden material defects may exist including moisture issues. For further information on the limitations of inspecting attics with limited access see ASHI SOP

#### Basement

## **BASEMENT, LIMITED OR NO ACCESS**

BASEMENT

Basements are one of the most vulnerable areas of a home or property for several reasons.

- 1. It's proximity to moisture from both the outside and inside.
- 2. Important mechanical components are located here such as electrical, HVAC, and especially plumbing.
- 3. The location of critical structural components.

Although every effort is made to thoroughly inspect the basement, when access is limited or none nonexistent a thorough inspection cannot be made. Some examples would be:

- 1. Areas blocked by stored items.
- 2. Generally cluttered conditions.
- 3. Wall and ceiling coverings including suspended ceilings.
- 4. Insulation
- 5. Areas out of reach with limited visibility.

Hidden damage may exist. It is recommended that arrangements be made for access prior to settlement so that a qualified professional can inspect these areas.

#### Floor Structure

### VIEW OF FLOOR STRUCTURE LIMITED OR INACCESSIBLE BASEMENT

When, at the time of the inspection, most or all of the floor structure in the home is inaccessible a complete inspection of the floor structure is not possible. Hidden damage may exist. Some examples are:

- 1. Slab on grade construction.
- 2. Ceiling and wall coverings.
- 3. Inaccessible rooms or crawlspaces.
- 4. Stored items that obstruct views.

It is recommended that arrangements be made for access prior to settlement so that a qualified professional can inspect these areas.



## Foundation Structure

## LIMITED OR NO VISIBILITY

BASEMENT

Not all of the main structural components of the property's foundation were visible at the time of inspection. A General Home Inspection does not include an evaluation of structural components that are hidden. This includes areas behind insulation, floor, wall, and ceiling coverings or where access is restricted because of stored items. An inspector is not required to enter areas where opening are small or that he deems to be unsafe. Where these conditions are present hidden damage may exist that requires a separate inspection by a qualified professional.



### Comments

5.5.1 Foundation Structure

**EFFLORESCENCE** FRONT RIGHT SIDE BASEMENT Aaintenance

At the time of the inspection, I observed the presence of efflorescence on the foundation walls. Efflorescence is the term most commonly used to describe the deposit of crusty white mineral salts that appear on a masonry surface (concrete, render, brick or mortar) that have leached out from within the substrate when moisture migrates through it.

It is important to distinguish between "moisture" penetration and "water" penetration. Efflorescence result from moisture transfer. This problem should be evaluated by a professional because there are multiple reasons why it occurs.

#### Efflorescence



Signs of fluorescent on block wall

Close up

## 6: INSULATION AND VENTILATION

		IN	NI	NP	С
6.1	Insulation Unfinished Areas	Х			
6.2	Attic Ventilation	Х			
6.3	Exhaust Systems	Х			Х
6.4	Vapor Barriers		Х		
	IN = Inspected NI = Not Inspected NP = Not P	resent	t C	= Com	ments

## Information

#### Attic maintenance

Attic

All attic areas should be reviewed at least twice per year to ensure ventilation openings are clear and to ensure the development of mold is kept in check. Even if there is very little or no evidence of mold build-up in the attic at the time of inspection, it can reproduce and spread rapidly should conditions allow it to. Mold can be potentially hazardous and will spread when moisture enters the attic cavity and is not vented to the exterior. Any area of suspected mold should be reviewed by a qualified contractor for analysis and removal.

#### Insulation Unfinished Areas: Type

Fiberglass, Blown, Loose fill, Fiberglass roll



#### **Attic Ventilation : Attic Ventilation Types**

Ridge Vents, Gable Vents

Whenever possible, attics should have ventilation openings high (exhaust) on the ridge and low on the eave (intake). Rising warm air moves from the eaves to the ridge.

#### Exhaust Systems: Exhaust systems type

#### Bath Fan, Dryer vent

An inspection of all visible exhaust fans and ducting was made. In cases where the exhaust system is inside walls, covered with insulation or otherwise not visible these components will not be inspected. Hidden damage may exist and a thorough inspection by a qualified professional is recommended.

#### **Exhaust Systems: Ducting material**

#### Not completely visible

Ducting material is a key component in moving harmful moisture from the home to the outside. The quality of the material used for this ductwork is important. See more info on Ducting Material as referenced in the picture below.



Types of exhaust ducting

#### **Exhaust Systems: Radon mitigation system**

If the home has a radon mitigation system installed this inspection falls outside the ASHI Standards of Practice, however Precise Inspecting can perform a 24 point mitigation system inspection as recommended by the Pennsylvania EPA for an additional fee.

# **IMPORTANT** - The Environmental Protection Agency recommends radon testing every 2 years for homes that have an installed radon mitigation system present and every 5 years in homes that do not have a mitigation system but have levels below 4.0 Pci/l.

I recommend a PA DEP licensed professional perform a radon test in each separate structural zone per PA DEP guidelines. This test can be performed by **Precise Inspecting**. We are licensed radon measurement specialists. If high levels of radon exist, mitigation should be performed by a separate licensed radon mitigation company.

PA DEP requires one radon test per structural zone

#### Please Read: EPA's Home Buyers and Sellers Guide to Radon



#### **Exhaust Systems: Radon Mitigation System**

#### Native

The inspector will identify whether an active, passive or native radon system is in place. An inspection of the system itself is not part of the ASHI home inspection SOP.

**Passive** refers to a pipe installed below the concrete and vented upwards and out of the house. This does not functon as a radon gas removal system. **Active** refers to an active working Radon Mitigation system that is complete with an active fan. **Native** refers to no radon system of any kind present. **It is highly recommended by the EPA to retest radon levels in a home with an existing system every 2 years.** 

See Home Buyers and Sellers Guide to Radon

https://www.epa.gov/sites/production/files/2015-05/documents/hmbuygud.pdf

#### Vapor Barriers: Vapor barrier in attic unknown

At the time of the inspection I could not determine if there was a vapor barrier separating the attic from the finished space below. A vapor barrier retards the transfer of moisture and gases into the house.

## Limitations

#### General

### **INSULATION WILL NOT BE DISTURBED**

ATTIC, WALLS, CEILINGS AND BASEMENTS

The visible insulation of the home will be inspected but not disturbed as per the ASHI Standards Of Practice. There may be hidden defects. In-depth inspection of the insulation and areas behind or beneath it should be evaluated by an insulating company or general contractor.

### Comments

6.3.1 Exhaust Systems **RADON - TEST RECOMMENDED** 



#### BASEMENT

**\*\*Potential Health Hazard\*\*** At the time of inspection a radon test was not performed. Radon is a class A carcinogen and the second leading cause of lung cancer in the USA. Not knowing your radon levels can be hazardous to your health.

#### The Environmental Protection Agency recommends radon testing

- every 2 years for homes that have an installed radon mitigation system and
- every 5 years in homes that do not have a mitigation system but have levels below 4.0 Pci/l.

I recommend a PA DEP licensed professional perform the required radon test in each separate structural zone\* per PA DEP guidelines. This test can be performed by **Precise Inspecting**. We are licensed radon measurement specialists. If high levels of radon exist, mitigation should be performed by a separate licensed radon mitigation company. \*basements, crawlspaces and concrete slabs are separate structural zones.

PA DEP requires one radon test per structural zone

Please Read: EPA's Home Buyers and Sellers Guide to Radon



Radon entry points

## 7: HEATING

		IN	NI	NP	С
7.1	Heat System	Х			
7.2	Heating Equipment	Х			
7.3	Electric Heat	Х			
7.4	Distribution Systems	Х			
	IN = Inspected NI = Not Inspected NP = Not	t Presen	it C	= Com	ments

## Information

## Heating Equipment: Heating Unit Electric Heat: Heat Type

Geothermal, Heat pump

Baseboard



**Distribution Systems: Distribution Type** Forced air



Distribution Systems: Ductwork/Piping Material Insulated ductboard, Flex, Metal

#### **Distribution Systems: Filter Type**

Disposable



#### Heat System: Geothermal Heat Pump

Basement

The house was equipped with a geothermal HVAC system. A geothermal heat pump or ground source heat pump (GSHP) is a central heating and/or cooling system that transfers heat to or from the ground. It uses the earth all the time, without any intermittency, as a heat source (in the winter) or a heat sink (in the summer). This design takes advantage of the moderate temperatures in the ground to boost efficiency and reduce the operational costs of heating and cooling systems. An average life expectancy is from 20-25 years.

The ASHI Standards of Practice do not include inspection of these systems. I recommend an HVAC mechanic skilled with these systems to evaluate and recommend proper care.

Recommendation - a geothermal system requires regular maintenance. Important parts of the system cannot be checked in a visual home inspection. I highly recommend you engage a qualified profession contractor to more thoroughly inspect and service this system upon settlement.

#### Information: Geo-Thermal



Typical geothermal heat pump system



#### Heating Equipment: Age

2014

Furnace age

In cases where the age of the furnace cannot be determined I recommend having an evaluation done by a professional in order to determine the condition of the furnace prior to settlement.



#### Heating Equipment: HVAC maintenace

**Important:** Heating systems are complex and have many components and they are in need of regular evaluation, repair and replacement in order for the systems to function efficiently. Filters should be changed regularly according to manufactures recommendations. During a home inspection a <u>visual</u> inspection of the heating system is made to confirm its functionality on the day of inspection. Many of the interior, non-visible parts can not be checked. <u>Lhighly</u> recommend a professional HVAC technician inspect this system prior to settlement or immediately after taking possession, in order to determine the future life expectancy of the system.

## Limitations

#### Heating Equipment

## HEAT PUMP RUN IN EMERGENCY HEAT MODE

I was not able to inspect the heating equipment due to high exterior temperatures. However, I did test the system in emergency heat mode and found it to be functioning properly. I recommend a qualified HVAC contractor examine the heating portion of the HVAC system prior to settlement.

## 8: AIR CONDITIONING - ABANDONED

			11	JN	1	NP	С
8.1	Cooling Equipment		Х				Х
	IN = Inspecte	ed NI = Not Inspected	NP = Not Pres	ent	t C = Comme		

## Information

#### **Cooling Equipment: AC Interior**

Unit

Electric

#### **Cooling Equipment: Age**

1987

Air conditioning systems require proper and regular maintenance in order to work efficiently. With proper care most components will last 15 to 20 years. If the unit is approaching the later end of its life, I recommend budgeting for a new unit.

#### **Cooling Equipment: Regular maintenance recommended**

At interior AC unit

**Important:** Cooling systems are complex and have many components and they are in need of regular service, repair and replacement in order for the systems to function efficiently. Filters should be changed regularly according to manufactures recommendations. During the home inspection a <u>visual</u> inspection was made of the cooling system (if the temperature was above 65°) to confirm its functionality. Many of the interior, non-visible parts will not be checked. <u>I highly recommend a professional HVAC technician inspect this system prior to settlement or immediately after</u> taking possession, in order to determine the future life expectancy of the system.

## Comments

8.1.1 Cooling Equipment

## **ABANDONED HVAC SYSTEM**

ATTIC UNIT

I observed an abandoned HVAC system. The system appears to not be functioning and should be evaluated by a qualified professional to determine if it should be removed.





## 9: AIR CONDITIONING

		IN	NI	NP	С
9.1	Cooling Equipment	Х			
9.2	Distribution System	Х			
9.3	AC Differential	Х			
	IN = Inspected NI = Not Inspected NP = Not	t Presen	t C	= Com	ments

## Information

#### Cooling Equipment: AC Interior

**Distribution System: Air Filter** Disposable

Geothermal

Unit

### How an A/C system works

In its most basic description, the air conditioning process involves two actions that occur simultaneously, one inside the home and one outside the home.

Inside the home (sometimes referred to as the "cold side" of the system), warm indoor air is cooled as it blows across a cold cooling coil full of refrigerant. Heat from indoor air is absorbed into the refrigerant as the refrigerant turns from liquid to gas. The cooled air is distributed back to the house.

Outside the home (sometimes referred to as the "hot side" of the system), the refrigerant gas is compressed before entering a large coil in the outdoor unit. Heat is released outside as the refrigerant turns back to a liquid and a large fan pulls outdoor air through the outdoor coil rejecting the heat absorbed from the house.

The result is a continuous cycle of heat and humidity being removed from indoor air, cool air returning to the home, and heat and humidity exiting the home. ... read more



#### A/C system working

At the time of the inspection the A/C system was working. Any defects are mentioned separately in the report.

#### **Cooling Equipment: Age**

#### 2014

Air conditioning systems require proper and regular maintenance in order to work efficiently. With proper care most components will last 15 to 20 years. If the unit is approaching the later end of its life, I recommend budgeting for a new unit.



#### **Cooling Equipment: Regular maintenance recommended**

At interior AC unit

**Important:** Cooling systems are complex and have many components and they are in need of regular service, repair and replacement in order for the systems to function efficiently. Filters should be changed regularly according to manufactures recommendations. During the home inspection a <u>visual</u> inspection was made of the cooling system (if the temperature was above 65°) to confirm its functionality. Many of the interior, non-visible parts will not be checked. <u>I highly recommend a professional HVAC technician inspect this system prior to settlement or immediately after</u> <u>taking possession, in order to determine the future life expectancy of the system.</u>

#### **Distribution System: Type**

#### Forced Air

At the time of the inspection, the ducting system appeared to be in good condition. All accessible supply ducts were checked for flow. Representative photos are show below. Any defects will be listed separately in the report.



#### AC Differential: Delta T

Delta T

Delta T - 17º

The cooling differential\*, in an efficiently running AC air handler, is normally between 14° and 22°. There are many factors that influence this temperature differential. At times a working AC unit will be slightly higher or lower. In either case, I highly recommend engaging an HVAC contractor to service the AC unit regularly to maintain its efficiency.

\*In simple terms the differential (or Delta T) refers to the difference between the return air temperature and the supply air temperature.

Note 1: Mini-Split and High Velocity systems often run cooler with higher differentials.

Note 2: temperature differential runs outside these averages when the outdoor temperature is closer to the indoor temperature during cooler days.

\*there is a 5-10% margin of error with the instruments used in measuring the Delta T differences therefore it is recommended they be verified by a qualified professional.

easure temperature drop across inside coil



#### **AC Differential:** Supply temp

Supply temp refers to the temperature of the conditioned air after it has passed through the cooling coil of the AC unit on it's way to cooling the home.



#### **AC Differential: Return temp**

Return temp refers to the temperature of the warmer air as it returns to the AC unit to me cooled again.



## Limitations

#### **Cooling Equipment**

## **GEOTHERMAL**

The house was equipped with a geothermal HVAC system. Geothermal systems are home heating and cooling systems that gather heat from the earth. Geothermal heat pumps (GHPs) use the relatively constant temperature of sub-surface soil as the exchange medium. I examined the system for basic functionality and found that it appeared to be functioning properly.

The ASHI Standards of Practice do not include inspection of these systems. These systems have important components that are not visible (i.e. underground). I recommend an HVAC mechanic skilled with these systems to inspect and recommend how to properly care for this unit.

Information: Geo-Thermal

Life Expectancy



Illustration

## 10: PLUMBING

		IN	NI	NP	С
10.1	Water Supply	Х			
10.2	Water Distribution lines	Х			Х
10.3	Toilets, Fixtures, Faucets	Х			
10.4	Sinks, Tubs, Showers	Х			
10.5	Water Heater	Х			
10.6	Drain, Waste, & Vent Systems	Х			
10.7	Sump Pumps	Х			
10.8	Sewage Ejectors	Х			Х
10.9	Fuel Supply, Storage & Distribution Systems	Х			
10.10	Whirlpool tub		Х		Х
	IN = Inspected NI = Not Inspected NP = Not F	resent	C	= Com	ments

## Information

Water Heater: Capacity 50 gal

#### Water Heater: Cold water supply Water Heater: Power Source valve Electric Present

#### Water Supply: Main Water Supply Source

Well

The water supply appeared to be originating from this identified source however I recommend checking with the local municipality and the home owner in order to verify.

#### Water Supply: Main Water Pressure Regulator

At Main Water Meter

Not present

A **water pressure regulator** is a specialized type of valve that reduces the incoming water pressure to a manageable level for the home plumbing infrastructure. Water pressure regulators are typically installed where the main water line enters the home, just after the main shutoff valve.

## If the water pressure is too high, it can cause significant damage to the valves, faucets, appliances, pipes,

and plumbing fittings. Water pressure regulators reduce stress on inner seals and connections within the water supply lines. This includes the inner workings of appliances like dishwashers, clothes washers, ice makers and more.

Most home plumbing fixtures are designed to work best at a pressure of about 50 psi (pounds per square inch), but it is not uncommon for municipal water supplies to enter the home with pressures as high as 150 or 200 psi. If such high pressure is present on a regular basis, the strain can eventually cause joints to fail, faucets and other fixtures to leak, and appliances to break down.

#### A qualified plumber can be consulted to determine if one should be installed (if one does not already exist).

#### For more information:

#### Water Pressure Regulators



Illustration

#### Water Supply: Main Water Supply Material

#### Black plastic

Underground pipes or pipes inside walls cannot be judged for type of material, size, leaks, corrosion or other defects. Hidden damage may exist. I recommend these lines be evaluated by a licensed professional.

#### Water Supply: Private well

Basement / Exterior Rear

A private well is a water source that gets you water directly from the earth. To get access to this water source underground, a hole is drilled all the way down to the aquifer which is a permeable layer of rock that contains water. Typical well depths can range from 25-400 feet. Well pumps can either be submersed at the bottom of the well or located above ground. A typical submerged well pump can last 10-15 years.

Once the hole reaches that layer of rock, a pump system is installed and connected to the plumbing of your house.

#### Well water quality is the responsibility of the homeowner to maintain.

**Pros:** No water bill, healthy source of water (typically no chemicals), control where your water is coming from.

**Cons:** Uses electricity (to pump water), may contain bacteria, Nitrates etc., wells can go dry or be disturbed by near by construction.

#### Components of a well:

- Well A hole dug in the ground to reach the water below the surface.
- Well pump A device that brings water to the surface.
- **Service pipe** The pipe that carries water between the well and a pressure tank.
- **Main shut-off valve** The shut-off valve is exactly what it sounds like and is located between the well and pressure tank.

• **Pressure or storage tank** — The tank holds H2O and is usually located on the lower level of the house or basement. It can also be stored inside a reservoir called a vault.

• **Pressure switch** — A private well system must have a pressure switch that automatically starts and stops the pump at predetermined pressures. Pressures above 60 psi (pounds per square inch) can harm your supply pipe.

• **Pressure gauge** — The pressure gauge, which displays a readout of pressure in the tank, might be located near or on the tank itself.



Well illustration

#### Water Supply: Secondary water source

#### None

The secondary water supply appeared to be originating from this identified source however I recommend this be verified by a qualified professional.

#### Water Supply: Water Testing Recommendations

Water testing and water treatment equipment was not evaluated as a part of this home inspection unless requested as an additional service. If there are any smells, deposits or quality issues noticed during your inspection, you should have the water tested or evaluated by a specialist. This would also include water treatment equipment.

All private well systems must be routinely maintained and tested for safety. If you have a well system that is used for watering grass only, your local municipality may still require routine checks. All well systems must be actively used or properly abandoned. Consult a professional in these systems for more information.

Precise Inspecting

#### Water Supply: Auxilliary Water Systems

#### Sediment Filter

The presence and functionality of auxiliary water systems and are not part of this home inspection's standards of practice and were not evaluated. These systems require periodic maintenance. I recommend a complete evaluation by a licensed water treatment contractor.



#### Water Supply: Water Sensor Alarms

Consider installing water sensor alarms in areas susceptible to water damage due to plumbing leaks or pump failures (e.g. water heaters, boilers, sump baskets, clothes washers, dishwashers, and HVAC condensate drains). For more information on this topic, click here: Automatic water leak protection

#### Water Distribution lines: Water Distribution lines

#### Polybutlene, Pex

Visible water lines with unobstructed views were inspected. Many water lines are hidden in walls and/or inaccessible. These water lines may have damage that is hidden. I recommend a thorough inspection by a licensed professional prior to settlement.

#### Water Heater: Water temperature degree

#### 110-120°

It is recommended that residential water temperature be kept between 120F-130F to avoid scalding. In addition, if water temperature is too low it can be a health hazard due to bacteria. Please take the temperature noted in this report under advisement and contact a qualified professional to evaluate and adjust if necessary.

Water Temperature Settings



#### Water Heater: Age

#### 2022

Based on the manufacturer's suggested service life, the life expectancy of a gas water heater is about 8 to 14 years and an electric water heater is 10-18 years. I recommend having a qualified professional evaluate the condition of the water heater to best determine its life expectancy.

#### Average Life of Water Heater



#### Water Heater: Expansion tank

#### Not present, Not needed

A pressurized expansion tank is a sealed cylinder divided by a flexible diaphragm. An expansion tank provides space for the water to expand as it is heated and assists in keeping the water pressure in the normal pressure range while the water heater is operating. These have been required in certain areas for new installations or replacement since 2012.



#### Water Heater: TPR valve

At water heater

#### Present, Adequate

The TPR valve's job is to vent off excess pressure when water pressure is greater than 150 PSI or water temperature exceeds 210 degrees Fahrenheit. When the valve opens it discharges scalding hot water through the overflow tube. Your homeowner's insurance may cover water damage but that may be negated if the policy requires a licensed plumber to install a water heater, as many policies do.

Furthermore water heater warranties of many manufacturers will be voided if the installation is not done by a licensed plumber. Water heater manufacturers require the installing plumber's license number to register the product warranty. For safety reasons, It is recommended that the installation of this water heater be verified with the seller prior to settlement.

#### Water Heater: Water Heater Maintenance

Water Heater

The serviceable life of most water heaters is 15-20 years. They should be flushed annually to prevent sediment buildup and maintain efficiency. I recommend a qualified plumber service and flush.

#### Here is a DIY link to help

#### Water Heater Tanks



#### Drain, Waste, & Vent Systems: DWV Type

Basement

See limitations, ABS, PVC

An inspection industry's standard drainage test for "functional drainage"\* was performed on the drainage system.

The drain pipes appear operational at the time of inspection. I was not able to inspect drain lines that were hidden, nor was I able to confirm the condition of the inside of all drain lines. Hidden damage may exist. Only an invasive inspection or video-scope of the interior of the drain lines can fully confirm their actual condition.

**\*\*Caution\*\*** Cast iron typically rusts from the inside out therefore its condition cannot be fully determined by a visual home inspection. Leakage that was not present or visible at the time of the inspection may occur when the home is occupied and water usage increases.

1. If usage (volume of waste water) of these drain lines increases when a new owner moves in, leaks can develop that were not present at the time of inspection.

2. If a home is vacant for several months or more, the inside of the cast iron can dry out and become detached from the drain wall. When water is introduced back into the drain lines the dry cast iron pieces can become detached from the drain line walls and clog the system.

Because of this, and other factors associated with cast iron, I recommend a qualified professional to inspect the cast iron lines prior to settlement and to consider a video scope.

Further problems may exist in homes that

- are vacant
- have older plumbing systems
- that have had past drain problems
- or have large trees on the grounds
- consult the seller for detailed information on these lines

\*functional drainage means a drain is functional when it empties in a reasonable amount of time and does not overflow when another fixture is drained simultaneously.



<sup>The Content</sup> Drain, Waste and Vent systems

#### Drain, Waste, & Vent Systems: Sewer Line is not inspected

Front Basement

Inspection of the sewer line in the following areas is not within the scope of a home inspection (please see the Scope and Limitations section at the beginning of this report).

- behind walls
- beyond the foundation wall
- below the basement slab

Sewer lines, especially cast iron, clay tile or Orange-burg lateral lines, should be inspected regularly in order to ensure no obstructions are present.

I inspected the visible cast iron drain lines in the home's drain system. Some of these lines may be hidden behind walls or under floors or in crawlspaces. Cast iron typically rusts from the inside out therefore its condition cannot be fully determined by a visual home inspection. Leakage that was not present or visible at the time of the inspection may occur when the home is occupied and water usage increases.

1. If usage (volume of waste water) of these drain lines increases when a new owner moves in, leaks can develop that were not present at the time of inspection.

2. If a home is vacant for 6 months or more, the inside of the cast iron can dry out and become detached from the drain wall. When water is introduced back into the drain lines the dry cast iron pieces can become detached from the drain line walls and clog the system.

Because of this, and other factors associated with cast iron, I recommend a qualified professional to inspect the cast iron lines prior to settlement and to consider a video scope of the entire line all the way to the public connection.

#### **Common Cast Iron Pipe Problems**

I highly recommend a video inspection of the main sewer line (from the house to the street) be done by a qualified professional, using professional equipment, prior to settlement.

Sewer Inspections



#### Sump Pumps: General

#### Pump - working

The inspector will report on the condition of a sump pump or sewer ejector present that is readily accessible. He will not open sump or sewage ejector covers that are sealed or bolted shut. He will attempt to operate the sump pump and/or sewage ejector to determine if it is functional at the time of inspection and report the results. If no water is in the sump pit and the pump motor works I recommend a qualified professional to test the motor with water in the pit. Specific visible defects will be commented in this report. The pictures provided below are for informational use.

#### Sump pump maintenance



#### Sewage Ejectors: General

#### Sewage grinder pump

The inspector will report on the condition of a sump pump or sewer ejector present that is readily accessible. He will not open sump or sewage ejector covers that are sealed or bolted shut. He will attempt to operate the sump pump and/or sewage ejector to determine if it is function at the time of inspection and report the results. Specific defects will be commented in this report. The pictures provided below are for informational use.

#### Sewage ejector maintenance



Typical sewage ejector

#### Fuel Supply, Storage & Distribution Systems: Fuel Distribution

Copper

The inspector will call out the type of fuel supple piping. If the system is not properly bonded a comment will be made in this section of the report.

#### Fuel Supply, Storage & Distribution Systems: Fuel Storage/Supply

Propane Tank

The condition of the interior gas lines, oil tanks and their supply lines, propane tanks and their supply lines or other forms of fuel storage and supply are not part of the home inspection and was not evaluated.



#### Whirlpool tub: Whirlpool tub

Master Bath

At the time of the inspection, the whirlpool tub was inspected and found to be operational and properly installed. Any specific defects will be included in this section of the report.

Whirlpools and hot tubs require special precautions, treatment and cleaning to prevent bacteria, fungus and related contamination and health risks. Contact the manufacturer for cleaning and maintenance requirements.



## Limitations

#### Water Supply

### **HIDDEN LINES NOT INSPECTED**

WHOLE HOUSE

Water distribution, drain, and vent lines that are underground, hidden behind walls or in floors are not visible and will not be inspected.

#### Water Supply

#### **PLUMBING SYSTEM**

The plumbing system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Access panels to plumbing areas were not removed and the inspection was only visual. Any valves or piping not visually accessible were not inspected. For example, bathroom plumbing connections behind fastened access panels were not inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used for your further inspection or repair issues as it relates to the comments in this inspection report.

#### Water Supply

#### WELL

If the home was equipped with an on-site well the ASHI Standards of Practice do not include the inspection of a well it's supply, pressure or operation. Since a well is the main source of water for the home it is an important component. I recommend consulting a professional to evaluate and service this component.

If you would like water testing or well flow test Precise Inspecting can perform these tests.

Water Distribution lines

## **IRRIGATION SYSTEMS**

The inspection of an irrigation system, if present, is out of the scope of a home inspection and is not required by the ASHI inspections Standards of Practice.

## Water Distribution lines INACCESSIBLE PIPES AND DRAINS

\*\*Important Note\*\* At the time of the inspection, some of the water supply lines and drain lines were inaccessible due to stored items and/or wall and ceiling coverings. Especially in areas under sinks and in basement ceilings and crawl spaces. The inspector made and effort to inspect these drains and water lines without moving household items or fixed components. It was not possible to inspect these lines and hidden damage may exist.

Drain, Waste, & Vent Systems

### **PRIVATE SEPTIC SYSTEMS**

Private waste systems should always be pumped and inspected by a specialist prior to home purchase. As a minimum, the internal tank components, vents, pumps, piping and the drainage system should be evaluated. You should ask the owner for the maintenance records for routine pumping and inspection. The system should have been pumped at least every other year. You can obtain information on septic systems from the state, DNR, County and City health officials.

## **Comments**

10.2.1 Water Distribution lines

## POLYBUTYLENE PIPING

VARIOUS LOCATIONS

At the time of inspection, I found polybutylene water supply lines. The Uniform Plumbing Code removed PB as an acceptable water distribution material in 1991 because these water lines were prone to leakage. Some insurance companies may not insure the home or will ask that a plumber come and inspect all the lines before they will insure the home. I recommend checking with your insurance company prior to settlement.

There are differences of opinion regarding polybutylene. I recommend not making a decision based on one source but to read various perspectives **and** consult your agent about how to proceed. **Concern over problems with PB** can be mitigated when we encounter PB in homes that has been has been installed for years with no leakage. Recommended reading:

http://www.ashireporter.org/HomeInspection/Articles/Take-Another-Look-at-Polybutylene-Plumbing/955

https://www.nachi.org/pb.htm

http://boiseinspector.com/resources-polybutylene.php





## 10.8.1 Sewage Ejectors SEWER EJECTOR DRAIN DEFECT

#### BASEMENT

**\*\*Health Hazard\*\*** The bathroom sewer ejector appeared to drain into an exterior roof downspout drainage system. This is not a sanitary way to dispose of toilet waste. A qualified professional should evaluate and repair.



Exterior gutter drainage

Sewage grinder appears to drain to exterior gutter system

10.10.1 Whirlpool tub

## WHIRLPOOL NOT INSPECTED

BASEMENT

At the time of the inspection I could not inspect the whirlpool because I was unable to fill the tub. The reason is noted in the photo. I recommend a qualified professional to evaluate in or to repair so that the unit can be inspected.



Unable to fill whirlpool

Drain line Disconnected



## 11: ELECTRICAL

		IN	NI	NP	С
11.1	General	Х			
11.2	Main Distribution Panel	Х			
11.3	Sub Panel	Х			
11.4	Branch Wiring	Х			Х
11.5	Connected Devices and Fixtures	Х			Х
11.6	Receptacles	Х			Х
11.7	Switches	Х			
11.8	Fire/CO Safety	Х			Х
11.9	Other electronic systems		Х		
	IN = Inspected NI = Not Inspected NP = Not F	resen	t C	= Com	ments

## Information

Main Distribution Panel: Overcurrent Protection Breakers, GFCI's

#### Main Distribution Panel: Panel

Capacity 200 AMP

### Main Distribution Panel: Panel Disconnect 200 amp breaker at panel

#### Sub Panel: Panel Location Basement



#### General: Electrical system

Whole house

## Sub Panel: Visible Branch Wiring

Copper, Non-metalic sheathed cable

Sub Panel: Disconnect Main panel - 60 amp

The electrical system of the home was inspected and reported on with the above information. While the inspector will make every effort to find all areas of concern, some areas may go unnoticed. Outlets and switches were not opened. The inspection was only visual. For example, any outlets, switches or fixtures not readily accessible (behind the refrigerator for example) was not inspected. Please be aware that the inspector has your best interest in mind and is seeking to provide an accurate assessment of the electrical system on the day of the inspection.

Any repair items mentioned in this report should be considered before settlement. As a home inspector, we do not inspect according to specific local or national codes as they differ between municipalities. It is recommended that the advice of a qualified electrician be used to supplement this inspection and to address any repair issues.

#### General: Life expectancy of residential electric systems

The electrical system of your home has a limited life span. Electricity delivers constant load (heat) to its component parts. This constant use will cause even the most quality materials to eventually fail. The NAHB (National Association of Home Builders) has published the following life expectancy estimates for the important parts of your home's electrical system.

- Main Panel 60 years
- Wiring (copper) 100 years
- Breakers 30-40 years
- Receptacles/Switches 30 years

For more info read: Your home electrical system: how long can it last?

#### Main Distribution Panel: Main Panel

Basement

Electrical panels are considered continuous-use appliances because they are always on. They experience daily heating and cooling of their components. As such, they should be replaced periodically. The average life of a panel is 30-50 years depending upon many factors. I recommend a qualified professional to evaluate this panel to determine if this panel should be updated to a newer panel.



#### Main Distribution Panel: Testing circuit breakers

When inspecting an electrical panel in an occupied house the inspector will not turn on any breakers that are in the off position.

When inspecting an electric panel in an unoccupied house the inspector will test some circuit breakers that are marked with the word <u>test</u> on the breaker.

#### Main Distribution Panel: Main Panel wired as a sub panel

I observed a main panel that was wired as a sub-panel because there was a service disconnect located in another part of the building. This is the proper way to wire a main panel under the circumstances.
## Branch Wiring: Visible Branch Wiring

Copper, Non-metalic sheathed (Romex), Aluminum

At the time of the inspection, the predominant, visible branch wiring appeared to be in good condition. Any visible defects will be listed separately in the report.



## **Receptacles : AFCI protection**

As of **2014,** AFCI protection is required on all branch circuits supplying outlets or devices installed in dwelling unit kitchens, family rooms, dining rooms, living rooms, parlors, libraries, dens, bedrooms, sunrooms, recreation rooms, closets, hallways, laundry areas, and similar rooms and areas.

Although AFCI protection may not have been required at the time the home was originally constructed, as general knowledge of safe building practices has improved with the passage of time, building standards have changed to reflect current understanding. The inspector recommends updating receptacles to provide AFCI protection where required. All work should be performed by a qualified professional.

Word of caution: it is not always possible to simply replace old breakers with new AFCI breakers in an older home due to original wire constraints.

## **Receptacles : GFCI** protection

Ground Fault Circuit Interrupters or GFCI is a safety device that quickly breaks an electrical circuit to protect equipment and to reduce the risk of serious harm from an ongoing electric shock. Since 1973 these receptacles have slowly been introduced to the NEC (National Electric Code) as requirements in certain areas of the home.

Here is a link to read about how GFCI receptacles keep you safe.

**In most municipalities, the GFCI requirement came about in the following time frame.** (These dates represent approximate estimates based on all of the codes used nationally)

- 1973: exterior receptacles (less than 6 feet from the ground)
- 1976: bathroom receptacles
- 1980: garage receptacles\*
- 1986: basements and kitchen receptacles within 6 feet of the sink.
- 1990: bath lighting, pools, and spas, crawl spaces, boat houses, hot tub equipment, all kitchen receptacles.

\*It is not recommended that a refrigerator outlet in a garage be on a GFCI outlet

## Fire/CO Safety: Smoke and CO detectors

Smoke detectors and CO detectors are a small but vital element in your home. They should be placed on every level of the home. Check with your municipality for specific locations. Batteries should be regularly checked and units should be replaced every 10 years.

Recommended reading: Smoke Alarms

Recommended reading: Carbon Monoxide Detectors

Recommended reading NPFA - Smoke Alarm types

The ASHI Standard of Practice requires the reporting of the presence or absence of smoke alarms and carbon monoxide alarms. The inspector will report on the presence or absence of these units. **There is no ASHI requirement to inspect, identify or test these alarms individually therefore I recommend a licensed professional to evaluate the floor plan and confirm that all necessary alarms are in working condition and confirm that they comply with the requirements of local municipalities.** 

#### See limitations in this section



Illustration

## Fire/CO Safety: Smoke Alarms

Present in appropriate locations

\*Safety\* -- The inspector shall comment on the presence or absence of smoke detectors in all required areas. To be effective, these detectors should be permanently mounted according to local codes and with appropriately operational batteries or hard wiring. I recommend the whole house be equipped with smoke detectors in the areas that are required by local municipality codes. A home inspection does not include testing the functionality of smoke or carbon monoxide detectors. Smoke Alarms



## Fire/CO Safety: CO detectors

Missing CO detector, Outside bedrooms

\*Safety\* -- At the time of the inspection, carbon monoxide detectors were missing in areas most often recommended by municipalities. To be effective, these detectors should be permanently mounted according to local codes with appropriately operational batteries, or, hard wired. I recommend the local municipalities be consulted and carbon monoxide detectors be installed the recommended areas. CO Detectors



Suggested locations

## Other electronic systems: Central Vacuum System

At the time of inspection I observed a central vacuum system. Inspecting a central vacum system is not within the scope of a home inspection. I recommend having the system inspected by a qualified professional prior to settlement.



## Other electronic systems: Generator system

I observed a generator system with associated panels and plugs. ASHI standards of practice do not include inspecting these systems. I recommend having a qualified specialist evaluate this system to confirm that it is functional and safe.



## Limitations

### Main Distribution Panel

## **GENERATOR SUBPANEL NOT INSPECTED**

At the time of the inspection there was an electrical sub-panel that appeared to be a specilized panel that was associated with a back up power supply. These panels fall outside the bounds of a home inspection. I recommend a qualified professional to evaluate this panel in order to fully understand its function.

### Branch Wiring

## NOT COMPLETELY VISIBLE

At the time of inspection not all of the branch wiring was able to be inspected due to lack of visibility. This could be because of wall/floor coverings, lack of access to main panel or stored items. I recommend a qualified professional to evaluate this wiring where access is provided, prior to settlement.

## Comments

# 11.4.1 Branch Wiring SERVICE CABLE NOT PROPERLY SUPPORTED



POWER TO SHEDS

I observed a power feed that was not fastened according to standard electrical installation practices. This presents a shock/fire hazard because wires can easily be damaged. I recommend a qualified professional to evaluate and fasten properly.



Power to shed should be evaluated by an electrician

Power to sheds

11.5.1 Connected Devices and Fixtures

## **FIXTURES NOT WORKING**

Maintenance

### **3 LOCATIONS**

I observed one or more light fixture(s) and/or switche(s) that did not appear to be working. They did not respond to normal switching. The bulb may need to be replaced. There may also be a photocell connected to the light (if exterior). If that does not work, I recommend a gualified professional to evaluate.



Front Right Side Bedroom Closet

Front Middle Bedroom

Patio

## 11.6.1 Receptacles **EXTERIOR WEATHER COVERS MISSING**



2 LOCATIONS

I observe an exterior receptacle that did not have an appropriate weather cover. This receptacle is exposed to moisture damage. A qualified electrician should evaluate and repair.

THROUGHOUT HOME



11.8.1 Fire/CO Safety RECOMMEND REPLACE ALL FIRE/CO SAFETY DEVICES



**\*\*Safety Issue\*\*** The American Society of Home Inspectors (ASHI) Standard of Practice (SOP) states 7.2 The inspector is NOT required to: A. inspect: 1. remote control devices. 2. or test smoke and carbon monoxide alarms, security systems, and other signaling and warning devices.

The actual testing of smoke and carbon monoxide alarms is beyond the scope of a general home inspection (see ASHI SOP above). Therefore, to ensure the safety of the occupants of the home, we recommend that all smoke alarms and carbon monoxide alarms are evaluated or replaced by a professional upon taking possession of the home.

Your home inspector will report on the <u>presence or absence</u> of smoke alarms and carbon monoxide alarms in their proper places throughout the home. We recommend upgrading to the recommended house map included below.

Because actual testing of smoke and CO alarms will not be performed I recommend that all smoke alarms and CO alarms present or absent **be professionally replaced or evaluated upon taking possession of the home.** 

Why your home inspector does not test:

1. A simple test of the device's alarm button does not ensure it will operate properly in a fire. The button test will only confirm the alarm sound is working. Testing the alarm test button will not confirm its response to actual smoke. A smoke test is required to confirm the safe operation of each individual smoke alarm.

2. There are many differing types of smoke and CO Alarms with differing expiration dates. Unless installation records exist, it can be impossible to determine when devices were installed and therefore when they are required to be replaced. Manufacturers of these alarms require that they be replaced at regular intervals.

3. Battery-operated devices are rarely charged. Even if the batteries have some charge left, it can be very difficult to determine when they were installed and in need of replacement.

4. Newer WiFi-connected alarms cannot be verified without a connected app.

5. Some alarms are connected to a security system that alerts the fire company. If the fire company responds to a false alarm, they may charge a fee for the mishap.

Upon replacement, I recommend regular maintenance and testing to confirm ongoing operation.

The interconnectivity of smoke and CO alarms is an important feature that may or may not be enforced by local code compliance municipalities. I recommend consulting the advice of a professional.



# 12: FIREPLACES AND FUEL-BURNING APPLIANCES

		IN	NI	NP	С
12.1	Fuel-burning Accessories	Х			
12.2	Fireplaces, Stoves & Inserts	Х			Х
12.3	Chimney & Vent Systems	Х			
	IN = Inspected NI = Not Inspected NP = Not P	resen	t C	= Com	ments

## Information

Fuel-burning Accessories: Fuel Propane **Fuel-burning Accessories: Type** Garage Wall mount gas

Fireplaces, Stoves & Inserts: Damper(s) Working

## Fireplaces, Stoves & Inserts: Fuel/power Propane

Fireplaces, Stoves & Inserts: Type Propane fireplace



## Chimney & Vent Systems: General

Appears Acceptable

The inspector will inspect the visible condition of the fireplace chimneys which includes the visible parts of the hearth and the chimney cap. A complete chimney inspection, including the interior flu falls outside of the ASHI Standards of Practice. I recommend a National Fire Protection Agency Type II chimney inspection be performed by a qualified professional prior to using the fireplace or stove.

## Chimney & Vent Systems: Type

Gas fireplace vented to masonry chimney

Inspecting the fireplace chimney itself falls outside the scope of an ASHI home inspection. Fossil fuel chimneys require routine maintenance for safe efficient use. I recommend a qualified professional inspect the chimney prior to settlement.

# Limitations

## Fireplaces, Stoves & Inserts

## **GAS/PROPANE FIREPLACE**

At the time of the inspection, no visual deficiencies were observed in the condition of the gas or propane fueled fireplace. A full inspection of fuel burning fireplaces lies beyond the scope of a home inspection. For a full inspection to more accurately determine the condition of the fireplace and to ensure that safe conditions exist, I recommend the fireplace be inspected by an inspector certified by the Chimney Safety Institute of America (CSIA) prior to settlement.



Do not use without understanding the proper and safe use of a fireplace.

Gas Fireplaces and Gas Logs

## Comments

12.2.1 Fireplaces, Stoves & Inserts

**PROPANE FIREPLACE NOT WORKING** 

FAMILY ROOM

At the time of inspection the gas fireplace was not working. I attempted to operate the unit using the normal components present (pilot, striker, gas on)

A full inspection of gas-burning fireplaces lies beyond the scope of a home inspection. For a full inspection to more accurately determine the condition of the fireplace and to ensure that safe conditions exist, I recommend that you have the fireplace inspected by an inspector certified by the Chimney Safety Institute of America (CSIA) prior to settlement

Recommendation: Do not use without understanding the proper and safe use of a fireplace.

Gas Fireplaces and Gas Logs



Not able to inspect propane fireplace

No fuel for fireplace



# 13: UTILITY LOCATIONS AND SHUT-OFFS

		IN	NI	NP	С
13.1	Electric	Х			
13.2	Water	Х			
13.3	Propane	Х			
	IN = Inspected NI = Not Inspected NP = Not P	resent	t C	= Com	ments

# Information

# **Propane: Propane shut-off** Exterior Left Side



#### **Electric: Electric shut off** Basement





002

## Water: Water Shut-off

Basement



# 14: BUILT-IN APPLIANCES

		IN	NI	NP	С
14.1	Refrigerator			Х	
14.2	Dishwasher	Х			
14.3	Range/Oven	Х			
14.4	Microwave	Х			
14.5	Washer/Dryer	Х			Х
	IN = Inspected NI = Not Inspected NP = Not F	resen	t C	= Com	ments

## Information

Range/Oven: Energy Source	Range/Oven: Exhaust Hood Type	Washer/Dryer: Dryer power
Electric	Vented to soffit	source

110 Volt, 220 Electric

## Life Expectancy of built-in appliances

Kitchen

Note: Life expectancy of built-in appliances varies with usage, installation, maintenance, and quality of materials. Appliances that are not built in (refrigerators, washers, dryers countertop microwaves etc) are not part of a standard home inspection. The link below includes a general guideline for life expectancy for common house appliances. InterNACHI's Standard Estimated Life Expectancy Chart for Homes

## Limits of built-in appliance inspection

Kitchen

A standard home inspection will inspect built-in appliances for basic fundamental operation. We do not inspect for performance. For example, we will not put garbage in the garbage disposal, dishes in the dishwasher, food in the oven or liquid in the microwave. For complete inspection limitations see Section 10 Interiors of the ASHI Standards of Practice.

## **Refrigerator: Refrigerator**

Kitchen

Not present

Refrigerators fall outside the parameters of a home inspection (See ASHI SOP) because they are considered an appliance that is not permanently installed (like a washer/dryer). Therefore, it was not inspected. The inspector will, however, address defects in plumbing or electricity that are related to the unit itself.

Important Note: refrigerators require adequate ventilation on the sides, top and rear.

**Refrigerator Ventilation** 



## **Refrigerator: Water/Ice Supply Line**

Plastic, Copper

Certain material (i.e. plastic) is subject to early failure which could result in significant water damage.



## **Dishwasher:** Dishwasher

The inspector will test the operation of the dishwasher using normal controls and report on its condition. Defects will be commented on separately.

Over time, a heavy film build-up from hard water minerals can become deposited on the inside walls and heating element of the dishwasher. After removing all of dishes, pans, silverware etc. and with no detergent in your dishwasher, the following should be done to remove the type of scale shown: Mold: Place one tablespoon of bleach in your dishwasher and then run it for a full cycle.

Rust: Place about half of a small container of Tang brand orange-flavored drink mix and then run it for a regular cycle. The citric acid in the Tang helps to loosen hard water deposits and cleans the scale from your dishwasher.

Stains: Place a cupful of white vinegar in your dishwasher and then run it for a full cycle. An alternative to vinegar is baking soda.



#### Range/Oven: Range/Oven

The inspector will test the operation of the range/oven using normal controls and report on its condition. Defects will be commented on separately.



## **Microwave: Microwave**

The inspector will test the operation of the microwave using normal controls and report on its condition. Defects will be commented on separately.



### Washer/Dryer: Washer/Dryer present - partially inspected

1st Floor

A washer and dryer were present and were inspected for general function. This includes running water to the washing machine, draining it and running the dryer. Not all functions of the washer dryer were tested as per ASHI Standards of Practice which does not require that washer and dryers be inspected. For a complete evaluation, consult a qualified appliance technician.



## **Comments**

14.5.1 Washer/Dryer

## **3-PRONG DRYER OUTLET**

AT DRYER

**\*\*Shock Hazard\*\*** - At the time of the inspection, there was a 220v three-pronged outlet present. Industry safety standards now call for four-pronged outlets at washers and dryers and ranges in order to prevent potential electrical shock. <u>Important</u>: This allows for the neutral wire and the ground wire to move on separate lines, thus removing the potential shock hazard. I recommend a licensed professional to evaluate and to bring the outlet up to current standards. A proper installation will require a new four wire to be installed from the electric panel to the appliance and terminated in a four wire plug.

Article on Three vs. Four prong outlets

What's the Difference between 3-prong and 4-prong?





## 14.5.2 Washer/Dryer

## **DRAIN PAN RECOMMENDED**



UNDER WASHING MACHINE

At the time of inspection there was no drain pan under the washing machine. The absence of a drain pan can result in significant damage to walls and floors in the event of a water leak at the washer. I recommend a qualified professional install a drain pan waste line for the pan.



Illustration



# 15: SCOPE AND LIMITATIONS

## Information

## **KEYS TO THE HOME INSPECTION**

The home inspection or any portion thereof, was performed in accordance with the Standard of Practice and Code of Ethics of the American Society of Home Inspectors (ASHI). These standards are included in the report under each section summary. An earnest effort was made on your behalf to discover all visible defects, however, in the event of an oversight, maximum liability must be limited to two times the price of the home inspection. This inspection is an evaluation of the condition of the home in a period of time that is limited to several hours of investigation. It would take days to comprehensively evaluate the condition of a home.

Any areas that are not safe, readily accessible and/or visible to the inspector will not be included in the home inspection is not intended as a substitute for a Sellers Disclosure. This home inspection is not a compliance inspection or certification of any kind. It simply is an inspection of the condition of the home at the time of the inspection. This inspection does not cover items or conditions that may be only discovered by invasive methods. No removal of materials or dismantling of systems shall be performed under this inspection. This is not a technically exhaustive inspection. The inspection report lists the systems and components inspected by Precise Inspecting, LLC. Items not found in this report are considered beyond the scope of the inspection and should not be considered inspected at this time.

Your home inspection is a snapshot in time. The defects found by Precise Inspecting during your inspection are the ones that were present at the time of the inspection. All defects and recommendations in this report should be evaluated by a licensed professional prior to settlement so that repairs can be made. If this is not done existing defects may persist and increased damage may result.

While we do your best to identify potential future problems and suggest preventive measures, you will experience future issues in the house that cannot be predicted by your inspection. Furthermore, your home inspection will only cover a representative sample. That means not every outlet or window or faucet will be checked.

This report contains technical information that may not be readily understandable to the lay person. Therefore, a verbal consultation with the inspector is an important part of this inspection. If you choose not to consult with your inspector, Precise Inspecting, LLC cannot be held liable for your understanding or misunderstanding of this reports contents. If you were not present during this inspection, please call the office at (717-808-5997) to arrange for your verbal consultation.

## **INSPECTION CATEGORIES**

1) Maintenance Items - Primarily comprised of small cosmetic items and handyman maintenance items. These observations are more informational in nature and function as a future to-do list rather than something you might use as a negotiation or seller-repair item.

2) Recommendations - Most items typically fall into this category. These observations usually require a qualified contractor to evaluate further, in order to determine if repairs or replacements are necessary. Also included in this category are mechanical and structural systems that are nearing the end of their useful life but are still working. Items in this category may or may not enter into negotiations. Please consult your real estate agent.

3) **Defects** - This category is composed of "material defects" (as defined by the state of Pennsylvania). These defects normally enter into the negotiation phase of the home sale. They consist of systems, structures or components that are broken, not working as intended, not installed properly, of immediate safety concern or have a significant adverse impact on the value of the property. These items should be addressed by a qualified contractor as soon as possible.

**Limitations** - This section is not a category. It is a **"tabbed heading"** within each general section which describes any limiting factors that may be present on the day of the inspection. These can best be described as a circumstance or condition that makes it difficult or impossible to conduct a normal inspection of the area, component or system. For example: snow on the roof. The specific limitation will be described and in some cases pictures will be added. These limitations are in addition to the standard limitations that affect all home inspections and are described in the ASHI SOP.

## **NOTICE: CODES AND REGULATIONS**

Home inspections are not code inspections. The report is based on an examination of the <u>visible portion</u> of the structure at the time of the inspection with a focus on safety and function, not on current building or municipality codes.

While many home defects have roots in code compliance, we are not qualified to inspect to specific building codes. It is always recommended to check with the Building and Codes Department of your local township or municipality for permit information and code requirements when there is a question regarding the proper construction methods or code requirements for a particular defect present in the home.

### NOTICE TO THIRD PARTIES OR OTHER PURCHASERS

Receipt of this report by any purchasers of this property other than the party(ies) identified on the cover page of this report, as the buyer, is not authorized by the inspector. Liability under this report is limited to the party identified on the cover page of this report as the buyer.

#### THIS REPORT IS NOT A WARRANTY

This report is not a home warranty. it is recommended that a home warranty be purchased prior to the purchase of the home in the event that any defects arise after the inspection and purchase. The report is based on an examination of the visible portion of the structure at the time of the inspection with a focus on safety and function, not on current building or municipality codes. Structure and mechanical parts of the house can and will change after the inspection and Precise Inspecting is not responsible for these changes or their effects. Any and all evaluations and recommendations made by Precise Inspecting, LLC should be carried out prior to closing. We recommend that you and/or your representative carry out a final walk-through inspection immediately before closing to check the condition of the property.

Furthermore, receipt of this report by any purchasers of this property other than the party(ies) identified on the cover page of this report is not authorized by the inspector. The inspector strongly advises against any reliance on this report by such party(ies). We recommend that you retain a qualified home inspector to provide you with your own inspection and report on this property. Liability under this report is limited to the party identified on the cover page of this report. The Home Inspection and the Inspection Report do not constitute and shall not be considered to be a warranty, either expressed or implied, concerning the present or future condition of the Property, the presence or absence of latent or hidden defects that are not reasonably ascertainable in a competently performed home inspection, or the remaining useful life of any system or component of the property. This report is not binding unless the pre-inspection agreement has been signed by the client and returned to Precise Inspecting, LLC along with payment of the inspection fee.

#### THE LIMITS OF A HOME INSPECTION

A home inspection is a visual examination of the home's physical structure and systems. Because we can only inspect what we can see, we cannot account for anything hidden from view. Such things include but are not limited to those that are obstructed by furniture or personal belongings, including things behind walls or below ground.

Some examples of note would be any and all interior and exterior plumbing drain lines and roof, gutter and perimeter drainage systems that are underground or otherwise hidden. I recommend these systems and lines be evaluated by a qualified professional prior to settlement in the event that hidden damage may exist.

In addition, there are numerous items, systems, and areas that are **not included** in the scope of this inspection as provided by the **ASHI Standards of Practice.** It is **important** that you take time to **read** and understand these limitations as they will affect the completed inspection report.

## PER PENNSYLVANIA STATE ACT 2000-114:

A home inspection as defined by Pennsylvania law is "A non-invasive, visual examination of some combination of the mechanical, electrical or plumbing systems or the structural and essential components of a residential dwelling designed to identify material defects in those systems and components, and performed for a fee in connection with or preparation for a proposed or possible residential real estate transfer. The term also includes any consultation regarding the property that is represented to be a home inspection or that is described by any confusingly similar term. The term does not include an examination of a single system or component of a residential dwelling such as, for example, its electrical or plumbing system or its roof. The term also does not include an examination that is limited to inspection for, or of, one or more of the following; wood destroying insects, underground tanks and wells, septic systems, swimming pools and spas, alarm systems, air and water guality, tennis courts and playground equipment, pollutants, toxic chemicals and environmental hazards." A home inspection is intended to assist in evaluation based on observation of the visible and apparent condition of the structure and its components on the date of inspection. The results of this home inspection are not intended to make any representation regarding the presence or absence of latent or concealed defects that are not reasonably ascertainable in a competently performed home inspection. No warranty or guaranty is expressed or implied. If the person conducting your home inspection is not a licensed structural engineer of the overall condition of the dwelling. The inspection is not a professional whose license authorizes the rendering of opinion as to the structural integrity of a building or its other component parts, you may be advised to seek a professional opinion as to any defects or concerns mentioned in the report. This home inspection report is not to be construed as an appraisal and may not be used as such for any purpose.

# 16: ENVIRONMENTAL CONCERNS

## Information

## Asbestos

Asbestos is a fibrous material that was used in many building materials. The asbestos fibers can cause cancer and other types of lung disease if inhaled. Asbestos can only be identified by laboratory analysis, therefore its identification is beyond the scope of the inspection. Asbestos was banned entirely in the United States in 1978. For further information regarding asbestos please visit www.epa.gov/asbestos.

### Lead Paint (prior to 1978):

Lead-based paint was common in use until about 1974. According to the Federal Department of Housing and Urban Development, a lead hazard can be present in a house built on or before 1978. It is believed that the primary danger would be to small children who may somehow ingest chips of lead-based paint. For further information regarding lead-based paint please visit www.hud.gov/offices/lead.

### Mold

This inspection is not an inspection for mold. Mold, mildew and indoor or outdoor air quality concerns can be found in many environments and may be especially prevalent in the home. If the home inspection report discloses evidence of moisture or water penetration, whether active or inactive, mold may be present within the property. The identification or detection of any mold, mildew and/or indoor/outdoor air quality is beyond the scope of the inspection **unless a specific request for IAQ or mold screening is requested, a contract signed and a fee paid to Precise Inspecting, LLC.** This company cannot and will not offer any representations, guarantees or warranties of any kind, written or oral, that the property is free from any mold, mildew and/or indoor/outdoor air quality concerns. Inspection for mold, mildew and/or indoor/outdoor air quality should be performed, detected and evaluated by a specialist of the customer's choice or by Precise Inspecting, LLC. For further information regarding mold please visit www.epa.gov/mold.

#### **Radon Gas**

Radon gas naturally occurs in our environment. Radon gas is a class A carcinogen and is the second leading cause of lung cancer, after smoking. The U.S. Environmental Protection Agency (EPA) and the Surgeon General strongly recommend taking further action when the home's radon test results are 4.0 pCi/L or greater. The national average indoor radon level is about 1.3 pCi/L. The higher the home's radon level the greater the health risk to you and your family. Reducing your radon levels can be done easily, effectively and fairly inexpensively. Even homes with very high radon levels can be reduced below 4.0 pCi/L. For further information about radon please visit www.epa.gov/radon. The EPA and Precise Inspecting LLC strongly recommends testing all homes for the presence of radon gas.

## **Urea Formaldehyde (Foam Insulation)**

U.F.F.I. became popular as a residential retrofit insulation in the mid-1970's. It was banned in the U.S.A. in 1982, then the ban was lifted. Formaldehyde gas usually dissipates with time and proper ventilation. However, this gas is known to be a respiratory irritant, particularly to younger and older people. The EPA has not adopted any standards as to harmful levels of formaldehyde gas, however it does caution exposure. <u>Note</u>: various other countries consider exposure to this gas harmful in concentrations of one-fiftieth of the amounts considered safe by the EPA. Consult with your inspection service for additional information.

# 17: CHECKLIST

IN = Inspected NI = Not Inspected NP = Not Present

NI NP C

## Information

**Key in lockbox?** Yes Doors locked? Yes

**Dishwasher off?** Yes Oven/stove off?



Lights off except those that were on? Yes

IN

Water main off? On when arrived

**Electric panel cover replaced?** Yes **Furnace cover replaced?** Yes Fridge/Freezer On Basement Confirmed on



## Wall Heater

Garage **Off** 

Off



## **Reset Thermostat?**

Yes, See photo



# STANDARDS OF PRACTICE

#### **Inspection Details**

2.2 The *inspector* shall:

A. *inspect readily accessible*, visually observable, *installed systems* and *components* listed in this Standard. B. provide the client with a written report, using a format and medium selected by the *inspector*, that states: 1. those *systems* and *components* inspected that, in the professional judgment of the *inspector*, are not functioning properly, significantly deficient, *unsafe*, or are near the end of their service lives, 2. recommendations to correct, or monitor for future correction, the deficiencies reported in 2.2.B.1, or items needing *further evaluation* (Per Exclusion 13.2.A.5, the *inspector* is NOT required to determine methods, materials, or costs of corrections.), 3. reasoning or explanation as to the nature of the deficiencies reported in 2.2.B.1, that are not self-evident, 4. those *systems* and *components* designated for inspection in this Standard that were present at the time of the *home inspection* but were not inspected and the reason(s) they were not inspected.

C. adhere to the ASHI Code of Ethics for the Home Inspection Profession.

#### 2.3 This Standard is not intended to limit the *inspector* from:

A. including other services or *systems* and *components* in addition to those required in Section 2.2.A. B. designing or specifying repairs provided the *inspector* is appropriately qualified and willing to do so. C. excluding *systems* and *components* from the *inspection* if requested or agreed to by the client.

#### Roofing

5.1 The inspector shall: A. inspect: 1. roofing materials. 2. roof drainage systems. 3. flashing. 4. skylights, chimneys, and roof penetrations. B. describe: 1. roofing materials. 2. methods used to inspect the roofing.

5.2 The inspector is NOT required to inspect: A. antennas. B. interiors of vent systems, flues, and chimneys that are not readily accessible. C. other installed accessories.

#### Exterior

4.1 The inspector shall: A. inspect: 1. wall coverings, flashing, and trim. 2. exterior doors. 3. attached and adjacent decks, balconies, stoops, steps, porches, and their associated railings. 4. eaves, soffits, and fascias where accessible from the ground level. 5. vegetation, grading, surface drainage, and retaining walls that are likely to adversely affect the building. 6. adjacent and entryway walkways, patios, and drive- ways. B. describe wall coverings.

4.2 The inspector is NOT required to inspect: A. screening, shutters, awnings, and similar seasonal accessories. B. fences, boundary walls, and similar structures. C. geological and soil conditions. D. recreational facilities. E. outbuildings other than garages and carports. F. seawalls, break-walls, and docks. G. erosion control and earth stabilization measures.

#### Interiors

10.1 The inspector shall inspect: A. walls, ceilings, and floors. B. steps, stairways, and railings. C. countertops and a representative number of installed cabinets. D. a representative number of doors and windows. E. garage vehicle doors and garage vehicle door operators. F. installed ovens, ranges, surface cooking appliances, microwave ovens, dishwashing machines, and food waste grinders by using normal operating controls to activate the primary function.

10.2 The inspector is NOT required to inspect: A. paint, wallpaper, and other finish treatments. B. floor coverings. C. window treatments. D. coatings on and the hermetic seals between panes of window glass. E. central vacuum systems. F. recreational facilities. G. installed and free-standing kitchen and laundry appliances not listed in Section 10.1.F. H. appliance thermostats including their calibration, adequacy of heating elements, self cleaning oven cycles, indicator lights, door seals, timers, clocks, timed features, and other specialized features of the appliance. I. operate, or confirm the operation of every control and feature of an inspected appliance.

#### Structural Components

3. STRUCTURAL COMPONENTS 3.1 The inspector shall: A. inspect structural components including the foundation and framing. B. describe: 1. the methods used to inspect under floor crawlspaces and attics. 2. the foundation. 3. the floor structure. 4. the wall structure. 5. the ceiling structure. 6. the roof structure.

3.2 The inspector is NOT required to: A. provide engineering or architectural services or analysis. B. offer an opinion about the adequacy of structural systems and components. C. enter under floor crawlspace areas that have less than 24 inches of vertical clearance between components and the ground or that have an access opening smaller than 16 inches by 24 inches. D. traverse attic load-bearing components that are concealed by insulation or by other materials.

#### **Insulation and Ventilation**

11.1 The inspector shall: A. inspect: 1. insulation and vapor retarders in un-finished spaces. 2. ventilation of attics and foundation areas. 3. kitchen, bathroom, laundry, and similar exhaust systems. 4. clothes dryer exhaust systems. B.

describe: 1. insulation and vapor retarders in unfinished spaces. 2. absence of insulation in unfinished spaces at conditioned surfaces.

11.2 The inspector is NOT required to disturb insulation.

#### Heating

8.1 The inspector shall: A. open readily openable access panels. B. inspect: 1. installed heating equipment. 2. vent systems, flues, and chimneys. 3. distribution systems. C. describe: 1. energy source(s). 2. heating systems.

8.2 The inspector is NOT required to: A. inspect: 1. interiors of vent systems, flues, and chimneys that are not readily accessible. 2. heat exchangers. 3. humidifiers and dehumidifiers. 4. electric air cleaning and sanitizing devices. 5. heating systems using ground-source, water-source, solar, and renewable energy technologies. 6. heat-recovery and similar whole-house mechanical ventilation systems. B. determine: 1. heat supply adequacy and distribution balance. 2. the adequacy of combustion air components.

#### Air Conditioning - Abandoned

9.1 The inspector shall: A. open readily openable access panels. B. inspect: 1. central and permanently installed cooling equipment. 2. distribution systems. C. describe: 1. energy source(s). 2. cooling systems.

9.2 The inspector is NOT required to: A. inspect electric air cleaning and sanitizing devices. B. determine cooling supply adequacy and distribution balance. C. inspect cooling units that are not permanently installed or that are installed in windows. D. inspect cooling systems using ground-source, water-source, solar, and renewable energy technologies.

#### **Air Conditioning**

9.1 The inspector shall: A. open readily openable access panels. B. inspect: 1. central and permanently installed cooling equipment. 2. distribution systems. C. describe: 1. energy source(s). 2. cooling systems.

9.2 The inspector is NOT required to: A. inspect electric air cleaning and sanitizing devices. B. determine cooling supply adequacy and distribution balance. C. inspect cooling units that are not permanently installed or that are installed in windows. D. inspect cooling systems using ground-source, water-source, solar, and renewable energy technologies.

#### Plumbing

6.1 The inspector shall: A. inspect: 1. interior water supply and distribution systems including fixtures and faucets. 2. interior drain, waste, and vent systems including fixtures. 3. water heating equipment and hot water supply systems. 4. vent systems, flues, and chimneys. 5. fuel storage and fuel distribution systems. 6. sewage ejectors, sump pumps, and related piping. B. describe: 1. interior water supply, drain, waste, and vent piping materials. 2. water heating equipment including energy source(s). 3. location of main water and fuel shut-off valves. 6.2 The inspector is NOT required to: A. inspect: 1. clothes washing machine connections. 2. interiors of vent systems, flues, and chimneys that are not readily accessible. 3. wells, well pumps, and water storage related equipment. 4. water conditioning systems. 5. solar, geothermal, and other renewable energy water heating systems. 6. manual and automatic re-extinguishing and sprinkler systems and landscape irrigation systems. 7. septic and other sewage disposal systems. B. determine: 1. whether water supply and sewage disposal are public or private. 2. water quality. 3. the adequacy of combustion air components. C. measure water supply flow and pressure, and well water quantity. D. fill shower pans and fixtures to test for leaks.

#### Electrical

7.1 The inspector shall: A. inspect: 1. service drop. 2. service entrance conductors, cables, and raceways. 3. service equipment and main disconnects. 4. service grounding. 5. interior components of service panels and subpanels. 6. conductors. 7. overcurrent protection devices. 8. a representative number of installed lighting fixtures, switches, and receptacles. 9. ground fault circuit interrupters and arc fault circuit interrupters. B. describe: 1. amperage rating of the service. 2. location of main disconnect(s) and subpanels. 3. presence or absence of smoke alarms and carbon monoxide alarms. 4. the predominant branch circuit wiring method.

7.2 The inspector is NOT required to: A. inspect: 1. remote control devices. 2. or test smoke and carbon monoxide alarms, security systems, and other signaling and warning devices. 3. low voltage wiring systems and components. 4. ancillary wiring systems and components not a part of the primary electrical power distribution system. 5. solar, geothermal, wind, and other renewable energy systems. B. measure amperage, voltage, and impedance. C. determine the age and type of smoke alarms and carbon monoxide alarms.

#### **Fireplaces and Fuel-Burning Appliances**

12.1 The inspector shall: A. inspect: 1. fuel-burning fireplaces, stoves, and fireplace inserts. 2. fuel-burning accessories installed in fireplaces. 3. chimneys and vent systems. B. describe systems and components listed in 12.1.A.1 and .2. 12.2

The inspector is NOT required to: A. inspect: 1. interiors of vent systems, flues, and chimneys that are not readily accessible. 2. fire screens and doors. 3. seals and gaskets. 4. automatic fuel feed devices. 5. mantles and fireplace surrounds. 6. combustion air components and to determine their adequacy. 7. heat distribution assists (gravity fed and fan assisted). 8. fuel-burning fireplaces and appliances located outside the inspected structures. B. determine draft characteristics. C. move fireplace inserts and stoves or firebox contents.

### Built-in Appliances

13.1 The inspector shall inspect: F. **installed** ovens, ranges, surface cooking appliances, microwave ovens, dishwashing machines, and food waste grinders by using normal operating controls to activate the primary function.

13.2 The inspector is NOT required to inspect:

- installed and free standing kitchen and laundry appliances not listed in Section 13.1.
- appliance thermostats including their calibration,
- adequacy of heating elements,
- self-cleaning oven cycles,
- indicator lights,
- door seals,
- timers, clocks, timed features, and other specialized features of the appliance.
- operate, or control the operation of every control and feature of an inspected appliance.

#### **Scope and Limitations**

General limitations

A. The inspector is NOT required to perform actions, or to make determinations, or to make recommendations not specifically stated in this Standard.

B. Inspections performed using this Standard:

1. are not technically exhaustive.

2. are not required to identify and to report:

a. concealed conditions, latent defects, consequential

damages, and

b. cosmetic imperfections that do not significantly affect a components performance of its intended function.

C. This Standard applies to buildings with four or fewer dwelling units and their attached and detached garages and carports.

D. This Standard shall not limit or prevent the inspector from meeting state statutes which license professional home inspection and home inspectors.

E. Redundancy in the description of the requirements, limi- tations, and exclusions regarding the scope of the home inspection is provided for emphasis only.

13.2 General exclusions

A. The inspector is NOT required to determine:

1. the condition of systems and components that are not readily accessible.

2. the remaining life expectancy of systems and components.

3. the strength, adequacy, effectiveness, and efficiency of systems and components.

4. the causes of conditions and deficiencies.

5. methods, materials, and costs of corrections.

6. future conditions including but not limited to failure of systems and components.

7. the suitability of the property for specialized uses.

ASHI Standard of Practice for Home Inspections Effective March 1, 2014

This supersedes all previous ASHI Standard of Practice for Home Inspections versions.

Copyright 2014 American Society of Home Inspectors, Inc. All rights reserved. 5.

The Standard of Practice for Home Inspections and Code of Ethics of the American Society of Home Inspectors

8. compliance of systems and components with past and present requirements and guidelines (codes, regula- tions, laws, ordinances, specifications, installation and maintenance instructions, use and care guides, etc.).

9. the market value of the property and its marketability.

10. the advisability of purchasing the property.

11. the presence of plants, animals, and other life forms and substances that may be hazardous or harmful to humans including, but not limited to, wood destroying organisms, molds and mold-like substances.

12. the presence of environmental hazards including, but not limited to, allergens, toxins, carcinogens, electro- magnetic radiation, noise, radioactive substances, and contaminants in building materials, soil, water, and air.

13. the effectiveness of systems installed and methods used to control or remove suspected hazardous plants, animals, and environmental hazards.

14. operating costs of systems and components.

15. acoustical properties of systems and components.

16. soil conditions relating to geotechnical or hydrologic specialties.

17. whether items, materials, conditions and components are subject to recall, controversy, litigation, product liability,

and other adverse claims and conditions.

B. The inspector is NOT required to offer:

1. or to perform acts or services contrary to law or to

government regulations.

2. or to perform architectural, engineering, contracting, or surveying services or to confirm or to evaluate such services performed by others.

3. or to perform trades or professional services other than

home inspection.

4. warranties or guarantees.

C. The inspector is NOT required to operate:

1. systems and components that are shut down or

otherwise inoperable.

2. systems and components that do not respond to normal

operating controls.

3. shut-off valves and manual stop valves. 4. automatic safety controls.

6. ASHI Standard of Practice for Home Inspections Effective March 1, 2014

This supersedes all previous ASHI Standard of Practice for Home Inspections versions.

D. The inspector is NOT required to enter:

1. areas that will, in the professional judgment of the inspector, likely be dangerous to the inspector or to other persons, or to damage the property or its systems and components.

2. under-floor crawlspaces and attics that are not readily accessible.

E. The inspector is NOT required to inspect:

1. underground items including, but not limited to, underground storage tanks and other underground indications of their presence, whether abandoned or active.

2. items that are not installed.

3. installed decorative items.

4. items in areas that are not entered in accordance with 13.2.D.

5. detached structures other than garages and carports.

6. common elements and common areas in multi- unit housing, such as condominium properties and cooperative housing.

7. every occurrence of multiple similar components.

8. outdoor cooking appliances.

F. The inspector is NOT required to:

1. perform procedures or operations that will, in the professional judgment of the inspector, likely be dangerous to the inspector or to other persons, or to damage the property or its systems or components.

2. describe or report on systems and components that are not included in this Standard and that were not inspected. 3. move personal property, furniture, equipment, plants, soil, snow, ice, and debris.

4. dismantle systems and components, except as explicitly required by this Standard.

5. reset, reprogram, or otherwise adjust devices, systems, and components affected by inspection required by this Standard.

6. ignite or extinguish fires, pilot lights, burners, and other open flames that require manual ignition.

7. probe surfaces that would be damaged or where no deterioration is visible or presumed to exist.